

# Fredericksburg Historic Resources Survey Update Survey Report

January 2003  
(Revised July 2003)



Prepared for:  
City of Fredericksburg  
126 W. Main Street  
Fredericksburg, Texas 78624

Prepared by:  
HHM, Inc.  
Austin, TX

## ABSTRACT

The City of Fredericksburg contracted HHM Inc. of Austin, Texas, to conduct a comprehensive architectural survey of all properties in the Fredericksburg Historic District and adjoining areas. The survey team documented and assessed a total of 650 resources within the district's boundaries. Of these properties, HHM determined 360 to be *HIGH* or *MEDIUM* preservation priorities and thus Contributing elements to the historic district. The remaining 290 properties were classified as *LOW* preservation priority and therefore are Noncontributing to the Fredericksburg Historic District. The survey team also identified 21 empty lots within the Historic District.

Besides documenting properties within the Historic District, the survey team examined areas just beyond the district's borders to determine if the boundaries should be changed. HHM targeted four areas previously identified as worthy of such consideration during the 1983 survey and subsequently recorded and evaluated 199 resources for this phase of the survey. HHM determined that the area directly southeast of the Historic District was the strongest candidate for integration into the Historic District's boundaries. The survey team also identified another area north of the existing district for possible designation either as a separate historic district or for possible inclusion in the Fredericksburg Historic District. The other two other areas – to the northwest and west – were deemed to be weaker candidates for inclusion in the Historic District.

During the final phase of the project, HHM documented the more significant historic resources in other areas of the city. Specifically, HHM targeted the remaining 67 properties previously ranked as "1" or "2" priority in the 1983 survey. Each of the targeted resources were photographed and analyzed to the criteria developed for the survey update. While most of these properties still retain their architectural integrity and remain important local landmarks, some have been changed and their architectural integrity has been compromised. Priority rankings reflect this analysis.

The report includes three appendices that provide more detailed information about the historic resources survey of 2002-03. Appendix A includes a map that indicates the locations and priorities of those properties in and immediately outside the Historic District. Appendix B includes an inventory of all properties in and immediately outside the Historic District, as well as properties previously ranked as "1" or "2" priority in the 1983 survey. Appendix C contains a list of all properties identified in the 1983 survey and notes any changes in address and reclassification within the new priority rating system.

**H I S T O R I C   R E S O U R C E   S U R V E Y   U P D A T E**

---

**TABLE OF CONTENTS**

I. Survey Report

Abstract.....	1
Table of Contents .....	3
Introduction.....	5
Research Methods .....	7
Survey Methods.....	7
Data Analysis .....	8
Criteria for Evaluation .....	8
Recommendations .....	11

II. Appendices

- Appendix A: Map of Fredericksburg Historic District
- Appendix B: Inventory of Surveyed Properties
- Appendix C: Update of the Fredericksburg Historic Resources Survey of 1983

**H I S T O R I C R E S O U R C E S U R V E Y U P D A T E**

---

## INTRODUCTION

The Fredericksburg Historic Resources Survey Update is primarily a documentation and evaluation of all resources, regardless of age and architectural integrity, within the boundaries of the Fredericksburg Historic District. The District, which was listed in the National Register of Historic Places in 1970, encompasses a nearly 40-block area that is roughly bounded by the south side of Schubert, E. Travis, and E. Austin Streets on the north; the north side of Creek and E. San Antonio Streets on the south; the east side of Acorn Street on the west; and the west side of Elk Street on the east (*Appendix A*). In 1983, Preservation Consultant David Moore surveyed the project area and reassessed the contributing/noncontributing status of all properties within the district's boundaries as part of the Fredericksburg Historic Resources Survey. In July 2002, the City of Fredericksburg, Texas, contracted HHM of Austin, Texas, to document and re-evaluate all properties within the district's boundaries. HHM also examined areas directly adjacent to the District in order to determine if the district's boundaries should be expanded and then documented significant properties in other areas of the city. The current survey's work products will serve as a tool for the City of Fredericksburg in its ongoing effort to manage its historically significant resources.

The scope of work consisted of:

- Surveying all properties within the boundaries of the Fredericksburg Historic District, regardless of age, condition, or architectural integrity;
- Surveying properties directly adjacent to the district's boundaries;
- Determining the preservation priority status of each surveyed resource; and
- Compiling the survey and research results into a final report.

Survey work products include three types of documentation: survey report, survey forms, and photographs. The survey report describes the project goals, survey methodology, and the manner in which the properties were evaluated. This report includes:

- A discussion of the project goals and objectives;
- A description of the project area;
- A definition of the survey methodology;
- A discussion of preservation priority assessments;

- Recommendations for the expansion of district boundaries and the delineation of a separate potential historic district;
- A map that depicts the Historic District's boundaries, priority ratings (*HIGH / MEDIUM / LOW*) for all properties in and immediately surrounding the Historic District (Appendix A);
- An inventory of properties identified in the survey (Appendix B); and
- A list of properties (Appendix C) documented in the 1983 survey and current preservation priority ratings based on the new system developed for the update.

Accompanying the survey report is a separate volume that contains individual Survey Data Sheets for all recorded historic resources. The survey forms include a thumbnail photograph of each property and note its current owner, estimated date of construction, physical characteristics, and preservation priority assessment. A separate compact disc contains color digital images of all properties, Portable Document Format (PDF) copies of historic insurance maps prepared by the Sanborn Map Company, and a computerized inventory of the survey information.

David W. Moore, Jr., served as Project Director and oversaw the project's completion. Architectural Historians Karen Hughes and Jennifer Ross comprised the survey team that identified, documented, photographed, and evaluated the historic resources. Both Ms. Ross and Ms. Hughes authored the survey report. Brian Jordan, Director of Development Services with the City of Fredericksburg, represented the City of Fredericksburg and provided technical assistance with the project's completion.

## **RESEARCH METHODS**

### ***HISTORICAL RESEARCH***

Prior to fieldwork, the HHM survey team collected Sanborn Fire Insurance Maps from 1896, 1902, 1910, 1915, 1924, and 1938. Sanborn Fire Insurance Maps depict building footprints that note construction materials, the number of stories of the properties, and any ancillary buildings. The survey team also consulted local histories and the 1983 Fredericksburg Historic Resource Survey. The local histories provided an inventory of significant buildings throughout Fredericksburg. The past survey provided photographs, physical information, and estimated construction dates for a number of the properties documented in the current survey. These materials enabled the survey team to more accurately assess the age of surveyed resources and to justify preservation priority ratings. In a handful of instances, the survey also enabled the survey team to identify alterations undertaken after 1983.

### ***LEGAL RESEARCH***

HHM accessed Gillespie County Appraisal District information, posted on the Internet (<http://www.txcountydata.com/>) by the Software Group, to obtain the names of current owners and account numbers that were used to establish hyperlinks with the survey database. These records also enabled the HHM survey team to locate addresses not collected in the field.

## **SURVEY METHODS**

### ***FIELD INVESTIGATIONS***

The survey team included Architectural Historians Jennifer Ross and Karen Hughes. The field team's objectives were to:

- Identify and document all individual properties within the project area regardless of age or condition;
- Note each property's physical features and alterations;
- Plot the location of each surveyed property on a map;
- Photograph each identified resource; and
- Assess each property's relative architectural and/or historical significance.

Field investigations took place through a series of pedestrian surveys conducted in August 2002, December 2002, and April 2003.

## DATA ANALYSIS

Following completion of fieldwork, the HHM survey team initiated a review of all physical data and priority assessments recorded in the field. This process began with a comparison of each survey form to its associated photo or photos. Any discrepancies between information collected in the field and the true appearance of the property were noted and corrected on the survey forms. The construction date assigned to each property was checked for accuracy using Sanborn maps and the 1983 historic resources survey.

After reviewing all physical data collected in the field for accuracy, the survey team assessed all preservation priorities assigned in the field. All surveyed properties were compared to one another, re-evaluated for their relative integrity within the project area, and assigned final recommendations of *HIGH*, *MEDIUM*, and *LOW* architectural value. Once all the properties received their final rating, the survey team noted any concentrations of *HIGH* and *MEDIUM* priority properties outside the District's boundaries.

## CRITERIA FOR EVALUATION

Each primary resource, with the exception of empty lots, was evaluated and assigned a rating based upon its current architectural integrity and, if known, historical and cultural value. These evaluations reflect an assessment of each property's relative significance within a local context. These assessments should not be considered static, but can and should be changed to reflect the evolving status of properties. Since the scope of work did not include any site-specific historical research, the priority assessments may be upgraded if future research reveals significant historical or cultural associations. A property's rating may also change if future rehabilitation efforts or alterations affect its historic architectural integrity.

The Fredericksburg Historic Resources Survey of 1983 rated properties based upon a four-tier numeric system (1, 2, 3, 4). This system's highest rating, a "1," was assigned to the project area's most significant properties, while a "4" rating represented the least significant class of properties. In an effort to provide a more intuitive, clearly defined means of indicating the subject properties' significance, the current survey effort established a three-tier rating system (*HIGH* / *MEDIUM* / *LOW*). According to this system, properties with a *HIGH* rating are the most significant. Properties classified as *MEDIUM* priority are still significant but have been moderately altered or are typical examples of a common architectural style or form. Properties in the *LOW* priority category are the least important of the resources identified in the study because they have been altered or were built within the last 50 years. In addition, all within the Fredericksburg Historic District properties classified in either the *HIGH* or *MEDIUM* ratings are Contributing elements to the district, while the *LOW* priority properties are Noncontributing elements.

### ***HIGH PRIORITY***

Properties ranked in the *HIGH* category are the city's most significant historic resources and are considered to be outstanding, unique, or good examples of architecture, engineering, or crafted design. Some are unique to the Fredericksburg area and are indicative of rare German-Texan vernacular forms and/or unusual building techniques. Others are noteworthy examples of widely built 19<sup>th</sup> and early 20<sup>th</sup> century architectural types, styles, and forms that were erected using local building materials and construction technologies. Properties in this category are either individually listed or are good candidates for listing in the National Register of Historic Places (NRHP). If situated within an historic district, they are classified as Contributing elements. Properties identified with a *HIGH* rating typically retain their contextual integrity to a high degree. If moved, these resources have strong historic associations and retain their architectural integrity to a remarkable degree.

*HIGH* priority resources that remain in situ may have undergone minimal alteration since their construction, and they retain their original exterior materials, fenestration pattern, form, and massing to a high degree. If altered, changes are typically of historic age (50 years or more) and are in keeping with original design, scale, and workmanship. Many of these properties have small additions, particularly to the side or rear, that often represent historic-age porch enclosures or additions to provide expanded interior space. Non-historic alterations undertaken as part of regular building maintenance, such as the replacement of original exterior roofing materials, porch flooring, etc. are acceptable only if materials are replaced in kind and do not detract from the historic appearance of the resource.

In its documentation of secondary domestic structures such as storage sheds, cisterns, windmills, garages, barns, and outhouses, the HHM survey team limited its efforts to photographing each auxiliary resource and noting its presence on the survey form of its associated primary building. Although these resources were not extensively documented and assessed, in many cases they are noteworthy features and serve to strengthen the significance of a property as a whole. A number of *HIGH* priority resources retain such historic secondary structures. In general, these resources contribute to the greater cultural landscape and thus add to the District's overall historic character. When associated with a *HIGH* priority resource, these features should be preserved whenever possible as an integral component of the property.

### ***MEDIUM PRIORITY***

Resources in the *MEDIUM* priority category are those properties that are not individually eligible for listing in the NRHP because they are older properties that have been modified or are typical examples of common building forms. Though not identified as architecturally significant on an individual basis, these properties are nonetheless valuable resources that add to the district's overall historic character. *MEDIUM* priority resources generally retain their historic integrity to a good to moderate degree. Despite

changes to their exterior materials, doors, and/or fenestration, these resources retain their overall form and massing.

Many of the *MEDIUM* priority resources have had their original exteriors covered or replaced with non-historic materials, but the overall effect does not significantly impact a property's overall historic appearance. The replacement of a property's original exterior materials is acceptable when the alteration does not significantly impact a property's overall historic appearance. For example, exterior horizontal cladding such as vinyl, aluminum, or fiber-based hardboard siding resembles beveled wood siding, a common original exterior siding, and therefore does not significantly impact a building's historic appearance. However, certain types of exterior cladding such as vertical plywood siding, permastone, or asphalt shingles markedly alter a building's historic appearance, thus negatively impacting its historic integrity. Non-historic doors and/or windows do not represent major modifications provided window openings and overall fenestration pattern have not been altered.

In certain cases, older resources, rare examples of architectural types, or "high style" properties with significant non-historic alterations are designated as *MEDIUM* priority properties because they have been altered and their historic integrity has been diminished. These properties typically have been remodeled and renovated but have not been restored to their original appearance. Changes that have modified character-defining elements such as massing, form, and materials may have resulted in some of the city's older properties to be classified as *MEDIUM* priority properties. It is important to remember that the preservation priority rating is based on architectural and historic integrity and not necessarily the building's present condition. Nonetheless, *MEDIUM* priority properties still possess sufficient architectural significance to be classified as Contributing elements to the Historic District even though their historic and architectural significance may have been adversely affected by more recent renovations.

### ***LOW PRIORITY***

The *LOW* priority category includes properties that represent typical examples of more recent, common local building forms, architectural styles, or are examples of distinctive building forms, architectural styles, or plan types that have been severely altered. Among the types of alterations that collectively may warrant classification in the *LOW* priority category include the replacement of original exterior cladding with materials that adversely affect a building's historic appearance, the truncation or enclosure of original window or door openings, and major additions, particularly to publicly visible views, that alter the property's form, roofline, and/or massing.

Finally, all buildings within the Fredericksburg Historic District constructed after 1952 are classified as *LOW* priorities because they lack the necessary age to meet the usual 50-year threshold for NRHP listing and do not appear to meet the NRHP standard for "exceptional significance" for properties less than 50 years of age. Although the majority of these post-1952 properties display little evidence of integrity loss, these resources do

not display the physical qualities that distinguish the area as a historic district and are thus determined to be Noncontributing elements to the District. Once these properties reach 50 years of age, the priority assessments may change, based upon an individual property's relative historic and architectural significance within the Historic District.

## RECOMMENDATIONS

### *EXPANSION OF THE FREDERICKSBURG HISTORIC DISTRICT*

The Fredericksburg Historic Resources Survey of 1983 specifically targeted four distinct groupings of properties for possible inclusion in the Fredericksburg Historic District. Each area directly abutted the Fredericksburg Historic District and contained individually significant historic properties that were similar to many of the houses within the district. As defined by the Historic Resources Survey of 1983, these groupings were defined as:

- Area A, which extends along the west side of the 100 – 200 blocks of S. Acorn Street and the west side of the 100 block of N. Acorn Street;
- Area B, which extends along the north side of the 200 – 500 blocks of W. Schubert Street;
- Area C, which extends along the north side of the 200 – 500 blocks of E. Austin Street; and
- Area D, which extends along the south side of the 300 block of E. San Antonio Street as well as both sides of the 200 – 300 blocks of E. Creek Street and both sides of the 200 – 300 blocks of S. Lincoln Street.

Besides documenting the Historic District, the survey update of 2002-03 specifically targeted these four groupings of historic properties for detailed study and analysis. Surveyors conducted a comprehensive survey in each area and documented every property, regardless of age, construction, or condition. These properties were then evaluated based upon the Criteria developed for the Historic District and defined earlier in this report. The results of this comprehensive survey effort have been integrated into the Inventory of Properties (Appendix B), and the resources are listed in address order.

Of the four groupings, the strongest candidate for inclusion in the Historic District is Area D, which is directly southeast of the Historic District and retains its historic character to a noteworthy degree. Of the area's 32 resources, 16 were given a designation of *HIGH* or *MEDIUM* priority rating and retain sufficient physical and architectural integrity to convey a strong sense of the past. Area D's overall character is generally similar to that of the Historic District because it contains intact groupings of 19<sup>th</sup> century and early 20<sup>th</sup> century residential plan types, including linear center passage and L-plans, modified L-plans, and bungalows. Lot orientations and sizes are generally similar to

those in the district. Finally, Baron's Creek, which forms the southern and eastern boundary of the proposed district expansion area, serves as a logical natural boundary for the Fredericksburg Historic District.

Perhaps the most intact concentration of historic properties among the four groupings targeted for study in this phase of the survey occurs within Area C. The 1983 survey originally defined Area C as the 200 – 500 blocks of E. Travis Street, and the survey update confirmed that the node still retains its historic character and integrity to an exceptional degree. However, the survey update called for the scrutiny of surrounding properties, and the surveyors determined that both Cora and N. Adams Streets likewise contained a cohesive collection of historic residences. Whereas the Historic District presents an eclectic character with a wide variety of building types, styles and forms, the newly enlarged Area C contains a more homogenous grouping of houses, the majority of which date from the late 19<sup>th</sup> and early 20<sup>th</sup> centuries. Most of the houses fronting onto E. Travis Street are late 19<sup>th</sup> and early 20<sup>th</sup> century dwellings that include linear-plan, center-passage, L-plan, or modified L-plan residences; however, there are a few smaller Craftsman bungalows. The houses along Cora and N. Adams Streets are not as old as those in the Historic District and were constructed over a relatively short period of time (1920s and 1930s). The houses typically display stylistic influences that are more characteristic of the Craftsman and Colonial Revival movements. The houses along E. Travis Street present a north-south orientation that is consistent with the Historic District; however, the houses on Cora and N. Adams Street face east-west and stand on smaller sized lots.

Area C is obviously a significant collection of historic properties that adds to the city's rich heritage and architectural character. The area can be considered for inclusion in the Historic District but the patterns of development, lot orientation, and its generally homogenous architectural character make it a more distinct grouping that is distinguished from its surroundings. This sense is further reinforced by Town Creek, which physically separates the neighborhood from the Historic District. Furthermore, the 200 – 300 blocks of E. Schubert Street, which lie between the Historic District and Area C, contain houses that are generally not as old or as architecturally significant as those within the Historic District and Area C. This stretch disrupts the historic and architectural continuity that otherwise exists to the north and south. In conclusion, Area C is worthy of historic designation either as a separate historic district or as part of the Fredericksburg Historic District.

Areas A and B contain less significant groupings of historic properties that are not as strong as candidates for inclusion in the Fredericksburg Historic District. Both areas claim individually significant dwellings but they generally lack the cohesiveness and continuity that exists in the Historic District and in Areas C and D.

***UPDATE OF HISTORIC RESOURCES IN OTHER AREAS OF FREDERICKSBURG***

Besides conducting a comprehensive survey of all properties within and immediately adjoining the existing boundaries of the Fredericksburg Historic District, HHM also examined all previously surveyed historic resources ranked as “1” or “2” priority properties. To fulfill this phase of the project, HHM encoded the 1983 survey results into a database program and compiled a list of “1” or “2” rated properties subject for re-evaluation. HHM surveyors subsequently photographed and recorded the physical attributes of the targeted resources and then evaluated them according to the standards developed to assess historic properties identified in the previous phases of the survey update. The results of this supplemental effort have been integrated into the database and are presented in address order within the Inventory of Properties (Appendix B) and the multi-volume set of Survey Data Sheets.


Of the 67 buildings previously rated as “1” or “2” priority properties that are outside the Historic District, 44 still retain most of their historic character and convey a strong sense of the past. They have been re-classified as *HIGH* priority properties (see Appendix C). Like similarly rated properties within the Historic District, these properties are considered to be local landmarks and should be preserved.

A total of 20 of the “1” or “2” priority properties are classified in the *MEDIUM* priority category because alterations, modifications, and/or neglect have negatively impacted their historic character. Nevertheless, they remain of local interest and are encouraged to be preserved. If rehabilitation or restoration efforts are undertaken in accordance with local design guidelines, a historic property ranked in the *MEDIUM* priority can be reclassified as *HIGH* priority resources. Conversely, any alterations that further diminish a *MEDIUM* priority property’s ability to convey a sense of the past may warrant reclassification to the *LOW* priority category.

The remaining three of the “1” or “2” priority properties are classified as *LOW* priority. Physical changes to these buildings have severely affected their historic character and they no longer retain their historic integrity.

The 1983 survey included rankings of “3” and “4” for those historic properties that are of a lesser significance to the city’s historic architectural character. These categories include some of the city’s oldest historic properties that have been moderately or severely altered, and they also include historic properties of more recent (post-World War I) construction that are typical examples of common building forms or architectural styles. For the purposes of the survey update, those historic resources formerly classified in the “3” rating, unless otherwise noted, are re-categorized as *MEDIUM* priority properties and are encouraged to be preserved. Historic resources previously in the “4” category ranking are re-classified in the *LOW* priority category. If the Historic Review Board applies the Criteria developed for the survey update and determines that properties formerly ranked as “3” or “4” and re-classified as *MEDIUM* or *LOW* priority properties warrant reclassification, a property can be re-categorized.

**APPENDIX A: MAP OF  
FREDERICKSBURG  
HISTORIC DISTRICT**

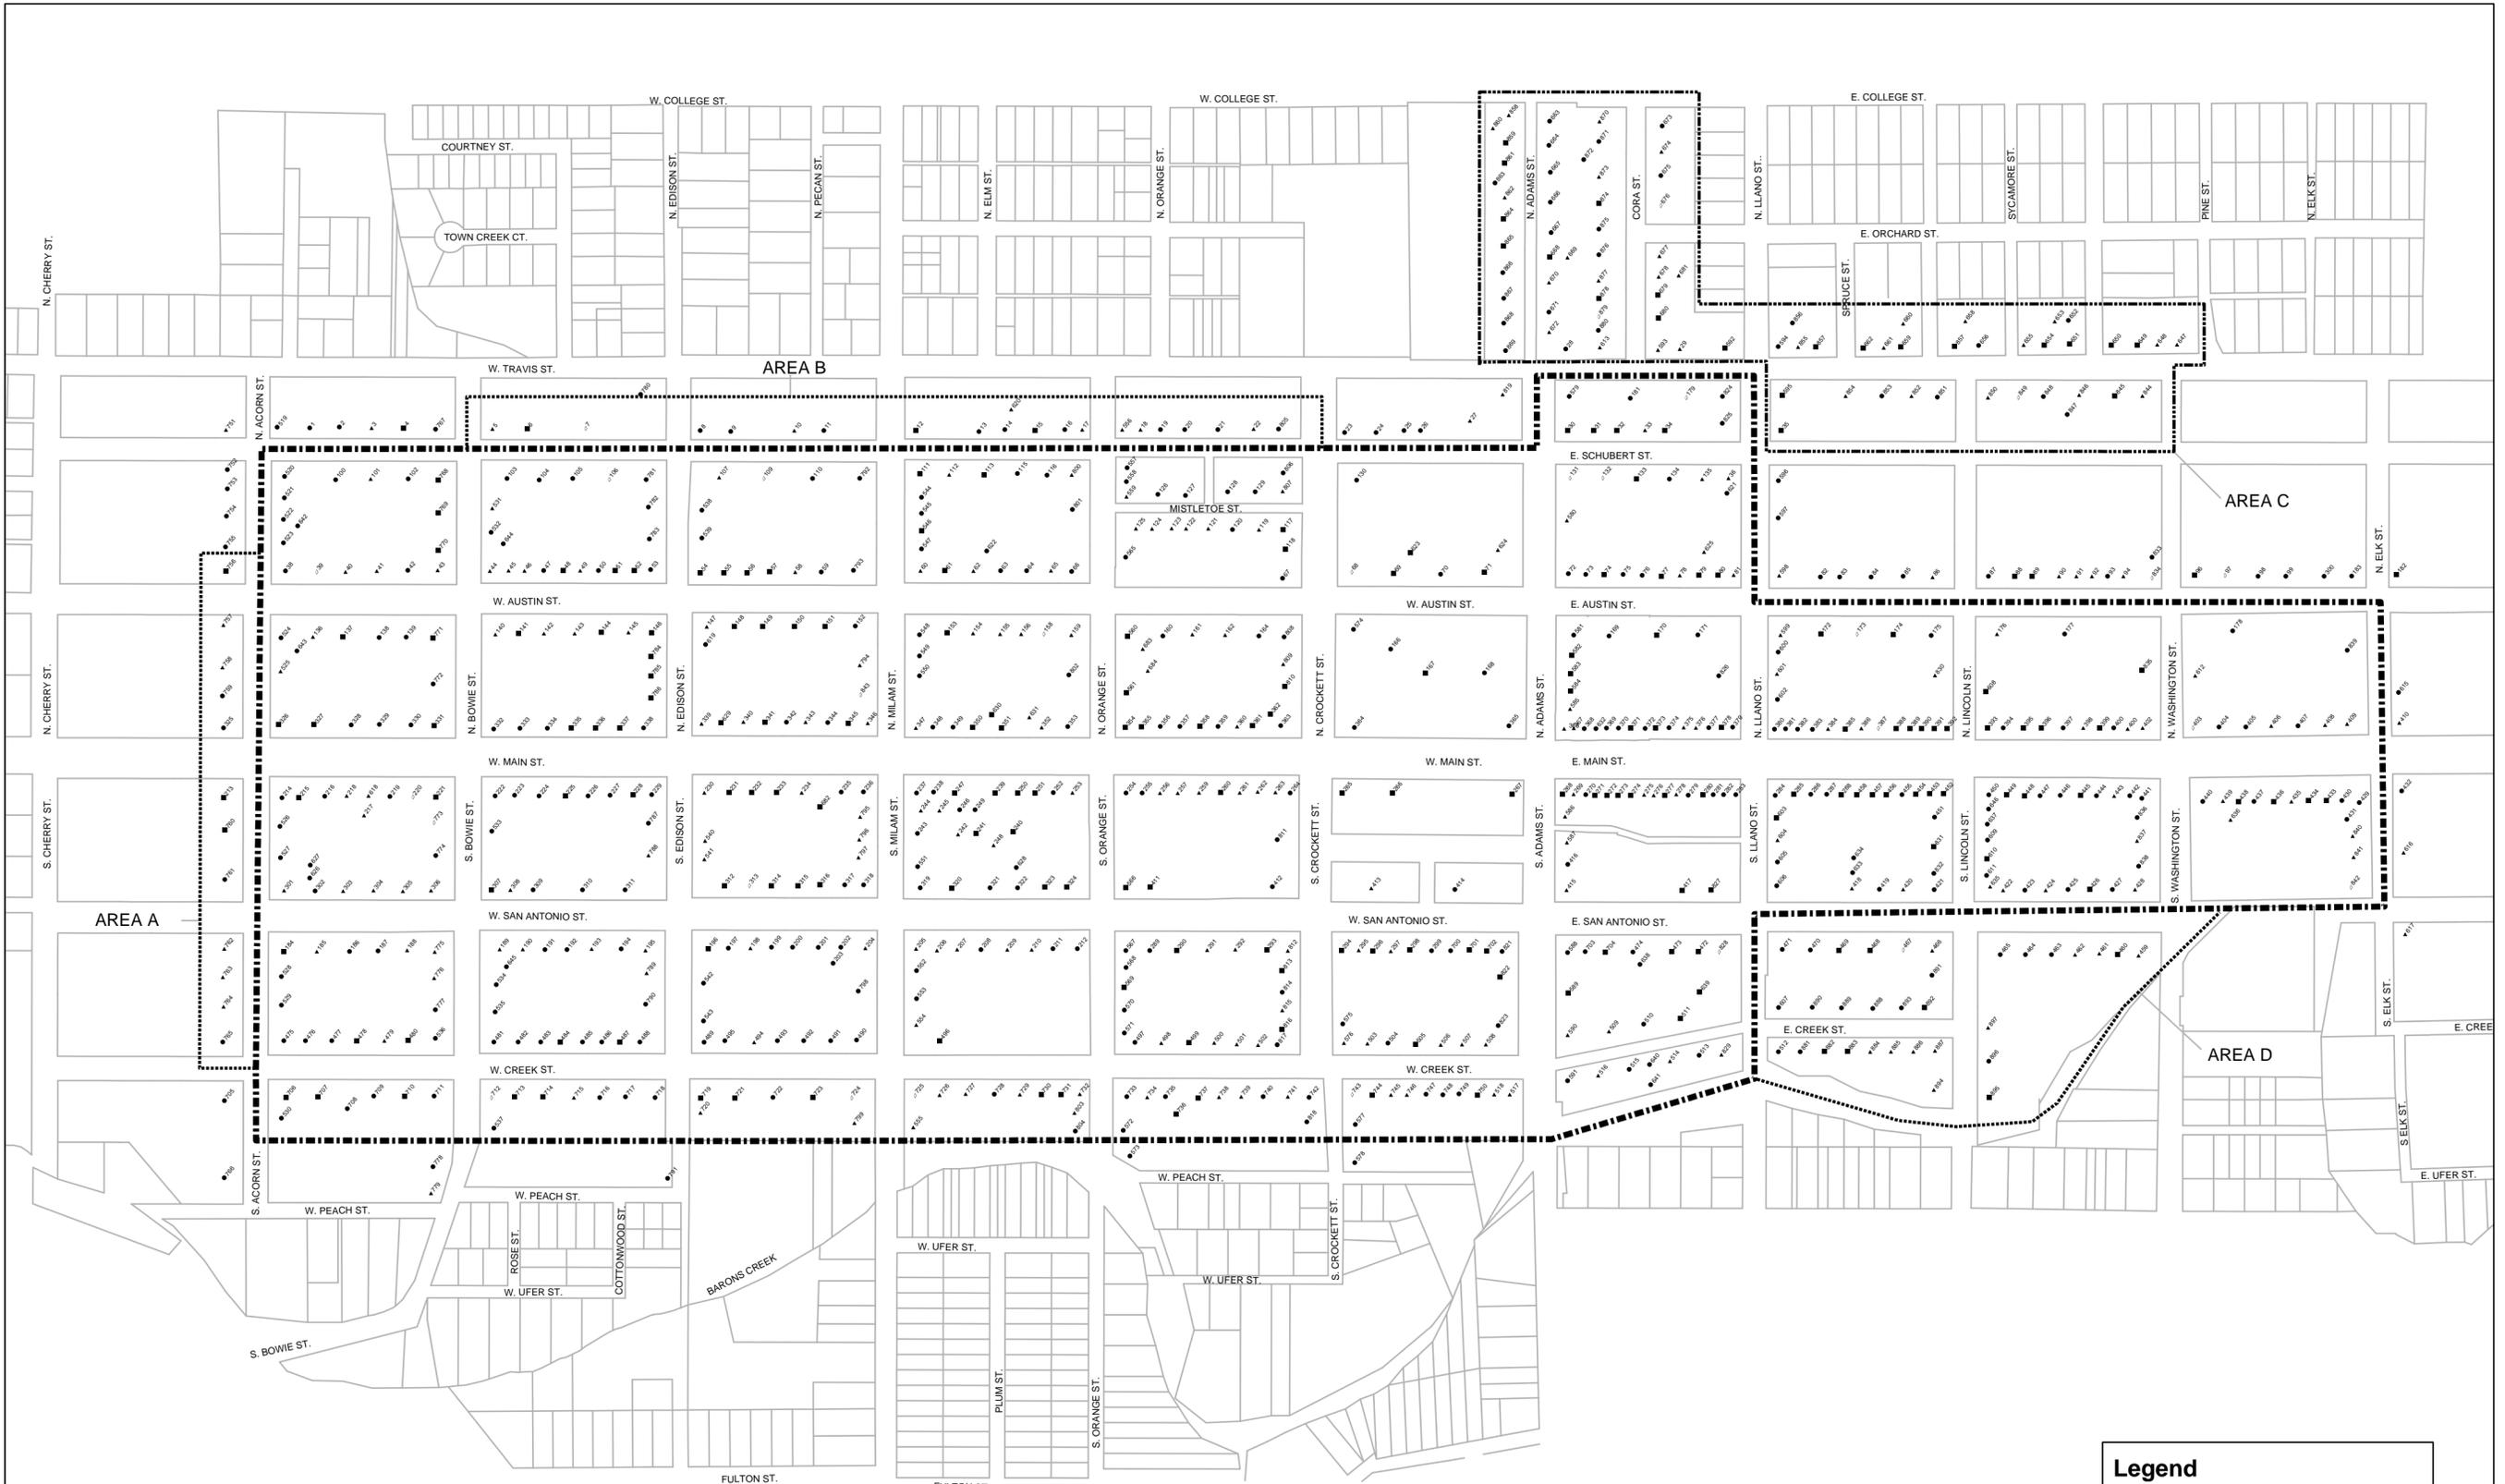

**Legend**

- Fredericksburg Historic District
- - - Potential Historic District
- ..... Potential Extension of Boundaries
- High
- ▲ Medium
- Low
- ◇ Empty Lot

Not to Scale

# Fredericksburg Historic Resources Survey

**APPENDIX B: INVENTORY OF  
SURVEYED PROPERTIES**

## Fredericksburg, Texas: Historic Resources Survey of 2002-03

The Fredericksburg Historic Resources Survey is a comprehensive inventory of all properties within the Fredericksburg Historic District and adjoining areas, as well as an update of local landmarks (properties outside the historic district but classified in 1983 historic resources survey as Priority "1" or "2" properties). Survey team members took digital images of each property, regardless of age, and also photographed empty lots within the district. As the surveyors identified each property, they assigned a unique site number to each resource. This designation is also used for mapping and photographic identification purposes. The site number links the database to a GIS (Geographic Information System) map that the City of Fredericksburg maintains. In addition, all digital images taken during field investigations incorporate the site number and photo sequence number in their file names. The inventory also includes information from the 1983 historic resources survey and is presented for cross-referencing purposes. The category GCAD Hyperlink is the parcel number that the Gillespie County Appraisal District assigned to the identified property and was obtained at the following website: [www.texascountydata.com](http://www.texascountydata.com). Data in the GCAD Hyperlink and Owner categories reflect conditions at the time of the survey and may have changed since the survey was completed. More detailed information on each identified property is presented in separate reports that were generated from the same database. The Survey Data Sheet includes physical information such as foundation materials, structural systems, roof forms and materials, exterior materials, window and door types and materials.

### Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

105 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 525  
**Address** 105 N. Acorn  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28936](#)  
**Owner** TRAVIS, GORDON D ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Exterior walls re clad with aluminum siding.

1983 Historic Resources Survey	
Previous Site No.	1
Previous Ranking	2
Previous Photo References	
Roll	29 29
Frame	5 6

106 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 759  
**Address** 106 N. Acorn  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R17764](#)  
**Owner** KUNZE, F J & LUCYLLE  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

107 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 524  
**Address** 107 N. Acorn  
**Date** 1993  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R63815](#)  
**Owner** TRAVIS, GORDON D ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

107 (rear) N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 643  
**Address** 107 (rear) N. Acorn  
**Date** 1993  
**Stylistic Influence**  
**GCAD Hyperlink** [R63815](#)  
**Owner** TRAVIS, GORDON D ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is a garage apartment at 107 N. Acorn.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

108 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 758  
**Address** 108 N. Acorn  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17511](#)  
**Owner** WALLACE, GRACE LORAINÉ  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has significant non-historic rear additions

1983 Historic Resources Survey	
Previous Site No.	<u>2</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	22 22 22
Frame	15 16 17

112 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 757  
**Address** 112 N. Acorn  
**Date** 1915  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19062](#)  
**Owner** MOORE, CAROLYN J  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>3</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	22
Frame	14

203 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 523  
**Address** 203 N. Acorn  
**Date** 1975  
**Stylistic Influence**  
**GCAD Hyperlink** [R28100](#)  
**Owner** HOLLAND, ALVIN ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 755  
**Address** 204 N. Acorn  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R67214](#)  
**Owner** WEIDMANN, ROBERT E & LELA C  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

205 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 522  
**Address** 205 N. Acorn  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R35193](#)  
**Owner** BETELGEUSE TRUST THE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

<b>1983 Historic Resources Survey</b>	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

205 (rear) N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 642  
**Address** 205 (rear) N. Acorn  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R35193](#)  
**Owner** BETELGEUSE TRUST THE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

<b>1983 Historic Resources Survey</b>	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

206 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 754  
**Address** 206 N. Acorn  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R25185](#)  
**Owner** WUNDERLICH, ADELA  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

<b>1983 Historic Resources Survey</b>	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

207 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 521  
**Address** 207 N. Acorn  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R35192](#)  
**Owner** BOWDEN, SARA YVONNE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

<b>1983 Historic Resources Survey</b>	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

208 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 753  
**Address** 208 N. Acorn  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R25111](#)  
**Owner** SEITZ, MARK R & DIANA A  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Carport attached on south side and original exterior materials covered w/asbestos shingles.

<b>1983 Historic Resources Survey</b>	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

209 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 520  
**Address** 209 N. Acorn  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R28099](#)  
**Owner** ALLDAY, WALTER F  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls reclad w/vinyl siding and all original windows replaced w/aluminum sash units. Resource has a non-historic side façade shed-roof addition.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

210 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 752  
**Address** 210 N. Acorn  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R15453](#)  
**Owner** STILER, MARSHALL & KATHERINE K  
**Historic District** No Outside Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

301 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 519  
**Address** 301 N. Acorn  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R16309](#)  
**Owner** NIGH, JOHN W & SANDRA D  
**Historic District** No Outside Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes** Exterior walls reclad with asbestos shingles, aluminum sash windows added to hipped-roof wing.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

302 N. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 751  
**Address** 302 N. Acorn  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R27583](#)  
**Owner** TREIBS, JOHN EARL  
**Historic District** No Outside Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey

Previous Site No. 4

Previous Ranking 3

Previous Photo References

Roll 22

Frame 13

105 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 526  
**Address** 105 S. Acorn  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R22520](#)  
**Owner** HANSON, WANDA  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is a trailer home.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

105 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 530  
**Address** 105 S. Acorn  
**Date** 2002  
**Stylistic Influence**  
**GCAD Hyperlink** [R22520](#)  
**Owner** HANSON, WANDA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** House is under construction.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

109 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 527  
**Address** 109 S. Acorn  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R22584](#)  
**Owner** DOLGENER, META MARIE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Wing added to south façade.

1983 Historic Resources Survey	
Previous Site No.	<u>8</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>29</u>
Frame	<u>7</u>

110 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 761  
**Address** 110 S. Acorn  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14272](#)  
**Owner** CRENWELGE, JULIA MAE  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Porch partially infilled and extended. Aluminum-sash windows added.

1983 Historic Resources Survey	
Previous Site No.	<u>9</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>29</u>
Frame	<u>8</u>

202 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 762  
**Address** 202 S. Acorn  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14335](#)  
**Owner** PENICK, JIMMY R  
**Historic District** No Outside Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>10</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>22</u>
Frame	<u>29</u>

205 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 528  
**Address** 205 S. Acorn  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R14876](#)  
**Owner** WELCH, FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

206 S. Acorn



2002 Re-evaluation

High  Medium  Low

Site ID No. 763  
 Address 206 S. Acorn  
 Date 1930  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R23202](#)  
 Owner PRESSLER, KATHERINE C  
 Historic District No Outside Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

207 S. Acorn



2002 Re-evaluation

High  Medium  Low

Site ID No. 529  
 Address 207 S. Acorn  
 Date 1945  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R25366](#)  
 Owner SAENGER, FREDERICK H  
 Historic District Yes Historic District  
 Assessment Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes Exterior walls reclad with vinyl siding.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

209 S. Acorn



2002 Re-evaluation

High  Medium  Low

Site ID No. 475  
 Address 209 S. Acorn  
 Date 1997  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R2603](#)  
 Owner HILL COUNTRY COMMUNITY NEEDS COUNCIL  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

212 S. Acorn



2002 Re-evaluation

High  Medium  Low

Site ID No. 765  
 Address 212 S. Acorn  
 Date 1887  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R16390](#)  
 Owner JUETT, GWYNNE UNDERWOOD  
 Historic District No Outside Historic District  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes House has a significant two-story addition w/corrugated metal exterior cladding.

1983 Historic Resources Survey	
Previous Site No.	11
Previous Ranking	2
Previous Photo References	
Roll	22 22
Frame	27 28

212 A S. Acorn



2002 Re-evaluation

High  Medium  Low

Site ID No. 764  
 Address 212 A S. Acorn  
 Date 1990  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R16390](#)  
 Owner JUETT, GWYNNE UNDERWOOD  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

312 S. Acorn



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 766  
**Address** 312 S. Acorn  
**Date** 1960  
**Stylistic Influence** Ranch  
**GCAD Hyperlink** [R2176](#)  
**Owner** LEIGH, ERNEST H ETUX  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

103 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 585  
**Address** 103 N. Adams  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R25859](#)  
**Owner** KRAUSKOPF, HERMINA M  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original primary entrance and windows replaced with aluminum frame units.

1983 Historic Resources Survey	
Previous Site No.	12
Previous Ranking	2
Previous Photo References	
Roll	30
Frame	8

105 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 584  
**Address** 105 N. Adams  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R7574](#)  
**Owner** SCHMIDT, GERALD W & PATRICIA J  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Original front façade windows replaced.

1983 Historic Resources Survey	
Previous Site No.	13
Previous Ranking	2
Previous Photo References	
Roll	30
Frame	7

107 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 583  
**Address** 107 N. Adams  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R13896](#)  
**Owner** WADE, KENNETH & MARIE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	14
Previous Ranking	2
Previous Photo References	
Roll	30 30
Frame	5 6

109 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 582  
**Address** 109 N. Adams  
**Date** 1898  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17509](#)  
**Owner** JENNINGS, THOMAS PAUL & LEE CHAMPE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** F.W. Arhelger Building. Resource is a Recorded Texas Historic Landmark.

1983 Historic Resources Survey	
Previous Site No.	15
Previous Ranking	2
Previous Photo References	
Roll	30 30
Frame	3 4

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

119 N. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 581  
**Address** 119 N. Adams  
**Date** 1915  
**Stylistic Influence**  
**GCAD Hyperlink** [R16557](#)  
**Owner** FRANZ, WESLEY A MRS -ELSIE- %G FRANZ/P SCHNELLE, PTR  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Former auto garage. Some window openings have been infilled w/plywood panels and current door openings not original.

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_

**Previous Ranking** \_\_\_\_\_

**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

211 -? N. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 580  
**Address** 211 -? N. Adams  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R74615](#)  
**Owner** ATWELL, FAMILY INVESTMENTS LTD  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Window openings and primary entry door transom infilled w/plywood panels.

**1983 Historic Resources Survey**

**Previous Site No.** 16

**Previous Ranking** 3

**Previous Photo References**

Roll 30  
 Frame 2

303 N. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 579  
**Address** 303 N. Adams  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** Does not appear on Sanborn map updated to 1945

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_

**Previous Ranking** \_\_\_\_\_

**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

304 N. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 819  
**Address** 304 N. Adams  
**Date** 1918  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink** [R14112](#)  
**Owner** CONNELLY, ROBERT  
**Historic District** No Outside Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance. Property contributes significantly to local history or broader historical patterns.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** 17

**Previous Ranking** 2

**Previous Photo References**

Roll 8  
 Frame 5

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

403 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 672  
**Address** 403 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R14867](#)  
**Owner** GRIER, CHARLES W & MARJORIE  
**Historic District** Yes Potential Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	18
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	26

404 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 869  
**Address** 404 N. Adams  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R28520](#)  
**Owner** MILLER, EUGENE H  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

405 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 671  
**Address** 405 N. Adams  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R21812](#)  
**Owner** MANER, LISTON Z  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

406 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 868  
**Address** 406 N. Adams  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R18113](#)  
**Owner** PYLATE, MARLENE J  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

407 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 670  
**Address** 407 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18523](#)  
**Owner** NEWMAN, JOHN G & GWEN C  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes House attached to side façade by enclosed breezeway.

1983 Historic Resources Survey	
Previous Site No.	19
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	25

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

408 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 867  
**Address** 408 N. Adams  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R24917](#)  
**Owner** PYLATE, MARLENE J  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	20
Previous Ranking	4
Previous Photo References	
Roll	8
Frame	6

410 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 866  
**Address** 410 N. Adams  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R27060](#)  
**Owner** DURST, SHERMAN D & VALERIE % FBG REALTY  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

412 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 865  
**Address** 412 N. Adams  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R16589](#)  
**Owner** BRELSFORD, HAROLD JOHN ETAL  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes Exterior walls were reclad in brick c. 1920.

1983 Historic Resources Survey	
Previous Site No.	21
Previous Ranking	2
Previous Photo References	
Roll	8 8
Frame	8 9

503 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 668  
**Address** 503 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Resource displays distinctive stylistic elements.

Notes Resource has a small house to the rear (see site ID # 669).

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

503 (rear) N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 669  
**Address** 503 (rear) N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes Sliding glass doors added to front façade. House located the rear of 503 N. Adams (see site ID # 668).

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

504 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 864  
**Address** 504 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18844](#)  
**Owner** HOWARD, GERALD E  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey

Previous Site No. 23  
 Previous Ranking 3  
 Previous Photo References

Roll 8  
 Frame 10

505 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 667  
**Address** 505 N. Adams  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R27357](#)  
**Owner** KIMBRELL, NANCY D  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Original exterior materials, windows, and porch posts replaced.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

506 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 862  
**Address** 506 N. Adams  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

506 (rear) N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 863  
**Address** 506 (rear) N. Adams  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R28833](#)  
**Owner** BURNS, BARNETT R & EVELYN F  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. 24  
 Previous Ranking 3  
 Previous Photo References

Roll 8  
 Frame 11

507 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 666  
**Address** 507 N. Adams  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R15625](#)  
**Owner** ECKHARDT, CURTIS  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Original widows and exterior materials replaced; garage enclosed and connected to house.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

508 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 861  
**Address** 508 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19830](#)  
**Owner** HOFMANN, MARJORIE  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	25
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	12

509 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 665  
**Address** 509 N. Adams  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R28532](#)  
**Owner** COX, WILLIAM G & LORNA M  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

510 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 859  
**Address** 510 N. Adams  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R16701](#)  
**Owner** NICHOLS, THOMAS BRUCE & PATSY  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

510 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 860  
**Address** 510 N. Adams  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R16701](#)  
**Owner** NICHOLS, THOMAS BRUCE & PATSY  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	26
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	13

514 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 858  
**Address** 514 N. Adams  
**Date** 1915  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R15422](#)  
**Owner** DUNBAR, S V  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Exterior walls re clad with asbestos shingles. House has an historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	27
Previous Ranking	4
Previous Photo References	
Roll	8
Frame	14

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

515 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 664  
**Address** 515 N. Adams  
**Date** 1930  
**Stylistic Influence** Mediterranean Revival  
**GCAD Hyperlink** [R25821](#)  
**Owner** SCHMIDT, CHESTER V MRS  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Sanborn maps show vacant lot in 1945 update; house may have been moved onto this site after 1945

1983 Historic Resources Survey	
Previous Site No.	28
Previous Ranking	3
Previous Photo References	
Roll	8 8
Frame	21 22

517 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 663  
**Address** 517 N. Adams  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R15714](#)  
**Owner** ECKHARDT, TAMMIE SUE  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Original front porch has been infilled; rear addition constructed circa 1960; original exterior materials replaced; and some original windows replaced w/casement units.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

606 N. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 958  
**Address** 606 N. Adams  
**Date** 1909  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R15890](#)  
**Owner** BRITT, JOHN C  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** RTHL. Historic rear shed.

1983 Historic Resources Survey	
Previous Site No.	30
Previous Ranking	2
Previous Photo References	
Roll	8
Frame	16

101 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 586  
**Address** 101 S. Adams  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	34
Previous Ranking	3
Previous Photo References	
Roll	30
Frame	9

105 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 587  
**Address** 105 S. Adams  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R28276](#)  
**Owner** WEIDENFELLER, DAYTON E & CLARA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original entrance replaced with aluminum frame door. Resource has two rear wings that may predate its c.1945 portion.

1983 Historic Resources Survey	
Previous Site No.	35
Previous Ranking	4
Previous Photo References	
Roll	30
Frame	10

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

201 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 588  
**Address** 201 S. Adams  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R16173](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority. Resource has undergone alterations.

**Notes** Most original window openings infilled w/brick.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 821  
**Address** 204 S. Adams  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R23803](#)  
**Owner** PAPE, MARLENE A ESTATE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

206 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 822  
**Address** 206 S. Adams  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24254](#)  
**Owner** PEDREGON, DAVID C & SAWTELL, CRISTINA  
 PEDREGON  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	38
Previous Ranking	1
Previous Photo References	
Roll	23 23 23
Frame	26 27 29

207 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 589  
**Address** 207 S. Adams  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16174](#)  
**Owner** PENICK, JIMMY R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	39
Previous Ranking	2
Previous Photo References	
Roll	30 30
Frame	14 15

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

209 S. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 590  
**Address** 209 S. Adams  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19930](#)  
**Owner** KLAERNER, AMANDA MAE -LIFE EST D/O  
 KENNIE A KLAERNER ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.  
**Notes** Concrete block addition constructed c. 1955.

1983 Historic Resources Survey	
Previous Site No.	40
Previous Ranking	3
Previous Photo References	
Roll	30 30
Frame	16 17

210 S. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 823  
**Address** 210 S. Adams  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13951](#)  
**Owner** PEDREGON, DAVID C & SAWTELL, CRISTINA  
 PEDREGON  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.  
**Notes** Resource has significant recent side facade additions.

1983 Historic Resources Survey	
Previous Site No.	41
Previous Ranking	1
Previous Photo References	
Roll	23 23
Frame	25 28

301 S. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 591  
**Address** 301 S. Adams  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.  
**Notes** Exterior walls reclad w/vertical plywood siding and brick veneer and original windows replaced on front façade.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

402 S. Adams



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 909  
**Address** 402 S. Adams  
**Date** 1905  
**Stylistic Influence** vernacular/Queen Anne  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes**

1983 Historic Resources Survey	
Previous Site No.	42
Previous Ranking	2
Previous Photo References	
Roll	16
Frame	2

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

404 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 910  
**Address** 404 S. Adams  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19713](#)  
**Owner** BURG, KARLA  
**Historic District** No Local Landmark  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials.

**Notes** rear stone lean-to

### 1983 Historic Resources Survey

**Previous Site No.** 43  
**Previous Ranking** 2  
**Previous Photo References**

Roll 16 16  
 Frame 3 4

703 S. Adams



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 911  
**Address** 703 S. Adams  
**Date** 1905  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23985](#)  
**Owner** JONES, MICHAEL C & GRETCHEN  
**Historic District** No Local Landmark  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 47  
**Previous Ranking** 2  
**Previous Photo References**

Roll 15  
 Frame 35

400 Block E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 95  
**Address** 400 Block E. Austin  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common bridge type.

**Notes** Resources is a bridge at the intersection of E. Austin & N. Washington

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

100 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 72  
**Address** 100 E. Austin  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R7597](#)  
**Owner** ALLEN, VERNE K & CORNELIA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Originally exterior materials and windows replaced.

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

102 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 73  
**Address** 102 E. Austin  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R17267](#)  
**Owner** ALLEN, VERNE K & CORNELIA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Original exterior materials and windows replaced.

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

104 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 74  
 Address 104 E. Austin  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R14581](#)  
 Owner CROUCH, HELEN S  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Original porch replaced c. 1985. Also original windows replaced (w/wood sash units).

1983 Historic Resources Survey			
Previous Site No.	51		
Previous Ranking	1		
Previous Photo References			
Roll	25	25	30
Frame	13	14	35

104 A E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 75  
 Address 104 A E. Austin  
 Date 1980  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R14581](#)  
 Owner CROUCH, HELEN S  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

106 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 76  
 Address 106 E. Austin  
 Date 1980  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R32193](#)  
 Owner BECKMANN, MAX ROY  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

107 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 169  
 Address 107 E. Austin  
 Date 1880  
 Stylistic Influence Gothic Revival  
 GCAD Hyperlink [R2638](#)  
 Owner FREDBG BIBLE CHURCH INC  
 Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Large addition added along west side, rear and along the front principal façade

1983 Historic Resources Survey			
Previous Site No.	52		
Previous Ranking	3		
Previous Photo References			
Roll	18	18	_____
Frame	18	19	_____

108 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 77  
 Address 108 E. Austin  
 Date 1925  
 Stylistic Influence Craftsman  
 GCAD Hyperlink [R15108](#)  
 Owner NANCE, WILLIAM A & MOLLY  
 Historic District Yes Historic District

Assessment Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey			
Previous Site No.	53		
Previous Ranking	3		
Previous Photo References			
Roll	25	_____	_____
Frame	15	_____	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

110 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 78  
**Address** 110 E. Austin  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19833](#)  
**Owner** KEYSER, ALBERT JR & SHIRLEY  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes** Building's exterior walls have been re clad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

111 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 170  
**Address** 111 E. Austin  
**Date** 1883  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2637](#)  
**Owner** GILLESPIE COUNTY HISTORICAL SOCIETY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Recorded Texas Historic Landmark.

1983 Historic Resources Survey	
Previous Site No.	54
Previous Ranking	1
Previous Photo References	
Roll	18 18 18
Frame	15 16 17

112 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 79  
**Address** 112 E. Austin  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R14809](#)  
**Owner** DURHAM, OSCAR R & SHERRILL  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes** Resource has a small house to the rear (see site ID# 625).

1983 Historic Resources Survey	
Previous Site No.	55
Previous Ranking	3
Previous Photo References	
Roll	25
Frame	16

112 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 625  
**Address** 112 E. Austin  
**Date** 1925  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R14809](#)  
**Owner** DURHAM, OSCAR R & SHERRILL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has an historic, side shed-roof addition. Located to the rear of 112 E. Austin (see site ID# 79).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

114 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 80  
**Address** 114 E. Austin  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R1714](#)  
**Owner** AUSTIN STREET LLC  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes** Excellent example of its type.

1983 Historic Resources Survey	
Previous Site No.	56
Previous Ranking	3
Previous Photo References	
Roll	25
Frame	17

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

115 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 171  
**Address** 115 E. Austin  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R26848](#)  
**Owner** MADDUX, RONALD ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** The exterior material on the front façade has been changed to stucco. An addition was added at the rear.

1983 Historic Resources Survey	
Previous Site No.	57
Previous Ranking	4
Previous Photo References	
Roll	18
Frame	14

116 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 81  
**Address** 116 E. Austin  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R1716](#)  
**Owner** KUSENBERGER, DENNIS  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a small rear addition w/ wood siding. Brick veneer is an historic alteration.

1983 Historic Resources Survey	
Previous Site No.	58
Previous Ranking	2
Previous Photo References	
Roll	25
Frame	18

203 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 172  
**Address** 203 E. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20742](#)  
**Owner** CARTER, CHERYLL B & ROBERT BARRETT  
 CARTER FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes** Rear half timbered addition erected to connect house with cistern.

1983 Historic Resources Survey	
Previous Site No.	59
Previous Ranking	3
Previous Photo References	
Roll	18 18
Frame	12 13

203 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 173  
**Address** 203 E. Austin  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R20742](#)  
**Owner** CARTER, CHERYLL B & ROBERT BARRETT  
 CARTER FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

204 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 82  
**Address** 204 E. Austin  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R16529](#)  
**Owner** FRANTZEN, ALYX SUZANNE  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

206 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 83  
**Address** 206 E. Austin  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R16502](#)  
**Owner** FRANTZEN, ALYX SUZANNE  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

209 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 174  
**Address** 209 E. Austin  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19664](#)  
**Owner** KEIDEL FAMILY GENERAL PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

Front porch has been added. Areas of the stone have been repointed in concrete. Rear dogtrot enclosed to connect house with original detached kitchen.

1983 Historic Resources Survey	
Previous Site No.	60
Previous Ranking	1
Previous Photo References	
Roll	18 18 18
Frame	9 10 11

210 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 84  
**Address** 210 E. Austin  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

212 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 85  
**Address** 212 E. Austin  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R23796](#)  
**Owner** DEWOLFE, CLINTON  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

216 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 86  
**Address** 216 E. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17795](#)  
**Owner** HARRISON, KATHRYN N  
**Historic District** No Outside Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Kanter-Kleck Home. Fachwerk, 2-room original portion erected c. 1870. Frame portion added c. 1895. Primary entrance altered. New porch added.

1983 Historic Resources Survey			
Previous Site No.	61		
Previous Ranking	1		
Previous Photo References			
Roll	25	25	25
Frame	27	28	29

301 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 176  
**Address** 301 E. Austin  
**Date** 1920  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R20337](#)  
**Owner** NIMITZ, ADMIRAL FOUNDATION THE  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Exterior siding has been changed to asbestos siding.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

302 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 87  
**Address** 302 E. Austin  
**Date** 2002  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R16228](#)  
**Owner** CITY OF FREDERICKSBURG  
**Historic District** No Outside Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

306 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 88  
**Address** 306 E. Austin  
**Date** 1910  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R16230](#)  
**Owner** CITY OF FREDERICKSBURG  
**Historic District** No Outside Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	62		
Previous Ranking	2		
Previous Photo References			
Roll	25	_____	
Frame	31	_____	

308 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 89  
**Address** 308 E. Austin  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16226](#)  
**Owner** CITY OF FREDERICKSBURG  
**Historic District** No Outside Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original porch and porch flooring removed.

1983 Historic Resources Survey			
Previous Site No.	63		
Previous Ranking	2		
Previous Photo References			
Roll	25	_____	
Frame	32	_____	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

310 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 90  
**Address** 310 E. Austin  
**Date** 1930  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R18073](#)  
**Owner** NIMITZ, ADMIRAL FOUNDATION THE  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

312 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 91  
**Address** 312 E. Austin  
**Date** 1940  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R27907](#)  
**Owner** WAHL, MONROE A MRS  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

314 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 92  
**Address** 314 E. Austin  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R2168](#)  
**Owner** BLALOCK, NELSON L & VERA L  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	64
Previous Ranking	4
Previous Photo References	
Roll	25
Frame	33

316 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 93  
**Address** 316 E. Austin  
**Date** 1965  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R25116](#)  
**Owner** SATTLER, SHEILA D  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

318 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 94  
**Address** 318 E. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R27886](#)  
**Owner** VOLLMAR, OMALEE MRS  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	65
Previous Ranking	4
Previous Photo References	
Roll	25
Frame	34

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

318 ? E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 834  
**Address** 318 ? E. Austin  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R27886](#)  
**Owner** VOLLMAR, OMALEE MRS  
**Historic District** No Outside Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

402 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 96  
**Address** 402 E. Austin  
**Date** 1851  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17805](#)  
**Owner** HARRISON, W OLIVER  
**Historic District** No Outside Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.

Notes

Walch Home. Building is a RTHL. House was not visible from right-of-way. Small garage attached to west façade.

1983 Historic Resources Survey	
Previous Site No.	<u>66</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	25
Frame	35

406 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 97  
**Address** 406 E. Austin  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R17808](#)  
**Owner** HARRISON, W OLIVER  
**Historic District** No Outside Historic District  
**Assessment** Resource is an empty lot.

Notes

Resources is an empty lot on the 400 block of East Austin Street, directly east of 406 E. Austin.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

408 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 98  
**Address** 408 E. Austin  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R21438](#)  
**Owner** LEIFESTE, ROSE MRS  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

Building's exterior walls have been reclad with vinyl siding.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

412 E. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 99  
**Address** 412 E. Austin  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R2320](#)  
**Owner** LAUGHLIN, DAVID L & PATRICIA  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

414 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 300  
 Address 414 E. Austin  
 Date 1930  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R17621](#)  
 Owner HAHNE, LILLIAN M  
 Historic District No Outside Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes Building's exterior walls have been re clad with perma stone. Original windows replaced w/aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

415 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 178  
 Address 415 E. Austin  
 Date 2002  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

416 ? E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 183  
 Address 416 ? E. Austin  
 Date 1980  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

502 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 182  
 Address 502 E. Austin  
 Date 1872  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R60374](#)  
 Owner GANNAWAY, BERRY & JACQUELINE  
 Historic District No Outside Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Despite alterations or deterioration, resource retains much of its original form and character.

Notes The house was built by a local stone mason, Peter Schmitz.

1983 Historic Resources Survey	
Previous Site No.	67
Previous Ranking	1
Previous Photo References	
Roll	25 25 26
Frame	36 37 3

805 E. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 933  
 Address 805 E. Austin  
 Date 1910  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R17375](#)  
 Owner HEEMER, JACK E & ELLEN D  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	68
Previous Ranking	2
Previous Photo References	
Roll	12 12
Frame	4 5

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

102 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 71  
**Address** 102 W. Austin  
**Date** 1891  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R26593](#)  
**Owner** ATWELL, RICHARD A & MARGARET J  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.  
**Notes** Albert Vander Stucken-Ernst Wilke Home. Resource was originally one story. Second story added early 1900s. Has a rear concrete block servants quarters (see site ID# 624).

1983 Historic Resources Survey			
Previous Site No.	70		
Previous Ranking	1		
Previous Photo References			
Roll	25	25	25
Frame	9	10	11

102 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 624  
**Address** 102 W. Austin  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R26593](#)  
**Owner** ATWELL, RICHARD A & MARGARET J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.  
**Notes** House is to the rear of 624 W. Austin (see site ID# 71). Carport added to north façade.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

110 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 70  
**Address** 110 W. Austin  
**Date** 1954  
**Stylistic Influence** Gothic Revival  
**GCAD Hyperlink** [R2639](#)  
**Owner** BETHANY LUTHERAN CHURCH, INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.  
**Notes** Bethany Lutheran Church.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

114 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 69  
**Address** 114 W. Austin  
**Date** 1880  
**Stylistic Influence** vernacular: Victorian Italianate  
**GCAD Hyperlink** [R18235](#)  
**Owner** HENNIG, JAMES E  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.  
**Notes** Felix Van Der Stucken Home. The property is a RTHL. Resource has a significant building that was originally used as a servant's quarters w/ garage attached (see site ID# 623).

1983 Historic Resources Survey			
Previous Site No.	71		
Previous Ranking	1		
Previous Photo References			
Roll	31	31	31
Frame	23	24	25

114 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 68  
**Address** 114 W. Austin  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R18237](#)  
**Owner** HENNIG, FRIEDA LIFE ESTATE  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.  
**Notes** Resource is an empty lot in the 100 block of W. Austin, associated with the house at 114 W. Austin.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

114 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 623  
**Address** 114 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1714](#)  
**Owner** AUSTIN STREET LLC  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** This resource was used by the Van Der Stucken's as a servant's quarters (see site ID# 69). Attached to this property is a garage that was formerly used as a barn.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

202 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 67  
**Address** 202 W. Austin  
**Date** 1960  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R54266](#)  
**Owner** LONE STAR GIRL SCOUT  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>72</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>25</u>
Frame	<u>8</u>

203 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 164  
**Address** 203 W. Austin  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R63820](#)  
**Owner** 203 WEST AUSTIN ST BUILDING PARTNERSHIP  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Fredericksburg Tiles Inc.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

205 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 162  
**Address** 205 W. Austin  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14243](#)  
**Owner** SOLBRIG, MERIDEL S  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Recorded Texas Historic Landmark  
 Half-timber portion is a recent addition.

1983 Historic Resources Survey	
Previous Site No.	<u>73</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>18</u>
Frame	<u>21</u>

209 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 161  
**Address** 209 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R31490](#)  
**Owner** LASKOSKIE, BELINDA  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Recorded Texas Historic Landmark  
 Rear addition that extends out on west side

1983 Historic Resources Survey	
Previous Site No.	<u>74</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>18</u>
Frame	<u>22</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

211 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 160  
 Address 211 W. Austin  
 Date 1970  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R16102](#)  
 Owner KOENNECKE, RUBY  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

300 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 66  
 Address 300 W. Austin  
 Date 1940  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R25842](#)  
 Owner ABERNATHY, MICHAEL G & JEANNE E  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes Building's exterior walls have been reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

302 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 65  
 Address 302 W. Austin  
 Date 1920  
 Stylistic Influence Craftsman  
 GCAD Hyperlink [R17660](#)  
 Owner LOWE, FLORENCE C  
 Historic District Yes Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	75
Previous Ranking	3
Previous Photo References	
Roll	25
Frame	7

303 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 159  
 Address 303 W. Austin  
 Date 1910  
 Stylistic Influence Queen Anne  
 GCAD Hyperlink [R1657](#)  
 Owner SCHNEIDER, CORINNE E  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

Notes Asbestos siding added on exterior. Small addition at rear.

1983 Historic Resources Survey	
Previous Site No.	76
Previous Ranking	2
Previous Photo References	
Roll	_____
Frame	_____

303 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 158  
 Address 303 W. Austin  
 Date \_\_\_\_\_  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R1657](#)  
 Owner SCHNEIDER, CORINNE E  
 Historic District Yes Historic District  
 Assessment Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

304 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 64  
**Address** 304 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R2629](#)  
**Owner** FOUR-M LAND & CATTLE CO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

1983 Historic Resources Survey

Previous Site No. 77  
 Previous Ranking 4  
 Previous Photo References

Roll 25 6  
 Frame 6

**Notes** Porch partially screened in, rear addition with asbestos shingle exterior cladding added.

308 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 63  
**Address** 308 W. Austin  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R26380](#)  
**Owner** SEGNER, EWALD H  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

**Notes** Extensively altered former two-room dwelling, according to current owner.

309 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 156  
**Address** 309 W. Austin  
**Date** 1936  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R26839](#)  
**Owner** WOELLHOF, RONALD L ETUX  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

1983 Historic Resources Survey

Previous Site No. 78  
 Previous Ranking 3  
 Previous Photo References

Roll 18  
 Frame 23

**Notes** Window opening filled in on east side.

310 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 62  
**Address** 310 W. Austin  
**Date** 1900  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18638](#)  
**Owner** FELL, DARRELL J & SHARON &  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

1983 Historic Resources Survey

Previous Site No. 79  
 Previous Ranking 3  
 Previous Photo References

Roll 25  
 Frame 5

**Notes** Front porch likely added c. 1925, stone exterior wall cladding added. Resource has a garage apartment (see site ID# 622)

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

310 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 622  
**Address** 310 W. Austin  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R18638](#)  
**Owner** FELL, DARRELL J & SHARON & GWENDOLYN K WELLS  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.  
**Notes** Resource is a garage apartment associated w/ 310 W. Austin (see site ID# 62).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

311 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 155  
**Address** 311 W. Austin  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R24880](#)  
**Owner** REINBACH, FELIX TIMOTHY & BARBARA QUINTERO  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.  
**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

312 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 61  
**Address** 312 W. Austin  
**Date** 1880  
**Stylistic Influence** vernacular; Craftsman  
**GCAD Hyperlink** [R20631](#)  
**Owner** BRANDES, ROBERT R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes** Porch exhibits Craftsman influence, likely added c. 1920.

1983 Historic Resources Survey	
Previous Site No.	80
Previous Ranking	2
Previous Photo References	
Roll	24 24 25
Frame	36 37 3

313 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 154  
**Address** 313 W. Austin  
**Date** 1920  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R22359](#)  
**Owner** HOWARD, DEBORAH L  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.  
**Notes** Large rear addition

1983 Historic Resources Survey	
Previous Site No.	81
Previous Ranking	2
Previous Photo References	
Roll	18
Frame	24

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

315 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 153  
**Address** 315 W. Austin  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19182](#)  
**Owner** JENSCHKE, ELENORA MISS  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	82
Previous Ranking	2
Previous Photo References	
Roll	18
Frame	25

403 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 151  
**Address** 403 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24096](#)  
**Owner** HENGST, HARVEY J ETUX  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	83
Previous Ranking	2
Previous Photo References	
Roll	18 18 18
Frame	26 27 30

405 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 150  
**Address** 405 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22188](#)  
**Owner** DANYSH, PETER & CORINNE  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Addition at rear

1983 Historic Resources Survey	
Previous Site No.	84
Previous Ranking	2
Previous Photo References	
Roll	18 18
Frame	28 29

406 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 59  
**Address** 406 W. Austin  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R29193](#)  
**Owner** HUTCHERSON, JOHN R & JUDY B  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Brick exterior wall cladding and attached garage likely added after original construction.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

407 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 149  
**Address** 407 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26866](#)  
**Owner** DANYSH, PETER & CORINNE  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	85
Previous Ranking	3
Previous Photo References	
Roll	18
Frame	31

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

408 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 58  
**Address** 408 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2284](#)  
**Owner** CLEMENTS, DAVID E & CYNTHIA E  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character. Alterations are sensitive to original historic appearance.

**Notes** Original, c. 1870 mass is the log cabin. Rock portion was added c.1890 and fachwerk portion added c. 1985. John Walter Home

1983 Historic Resources Survey			
Previous Site No.	86		
Previous Ranking	1		
Previous Photo References			
Roll	24	24	24
Frame	32	33	34

409 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 148  
**Address** 409 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R1285](#)  
**Owner** ZION EVANGELICAL LUTHERAN CHURCH  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	87		
Previous Ranking	3		
Previous Photo References			
Roll	18		
Frame	32		

412 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 57  
**Address** 412 W. Austin  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23492](#)  
**Owner** SCHLIETER, ROBERT A & PATRICIA  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	88		
Previous Ranking	2		
Previous Photo References			
Roll	24	24	
Frame	30	31	

414 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 56  
**Address** 414 W. Austin  
**Date** 1865  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25175](#)  
**Owner** GRAHAM, JOHN JR ETUX  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Strackbein-Roeder Home.

1983 Historic Resources Survey			
Previous Site No.	89		
Previous Ranking	1		
Previous Photo References			
Roll	24	24	24
Frame	26	37	28

415 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 147  
**Address** 415 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2613](#)  
**Owner** ZION LUTHERAN CHURCH  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character. Outstanding decorative features contribute to the resource's significance.

**Notes** Recent addition at rear

1983 Historic Resources Survey			
Previous Site No.	90		
Previous Ranking	2		
Previous Photo References			
Roll	18	18	
Frame	33	34	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

415 A W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 619  
**Address** 415 A W. Austin  
**Date** 1998  
**Stylistic Influence**  
**GCAD Hyperlink** [R2613](#)  
**Owner** ZION LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

418 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 55  
**Address** 418 W. Austin  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14250](#)  
**Owner** RITTER, KARL W  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Vogel Sunday House. Building is a RTHL.

1983 Historic Resources Survey	
Previous Site No.	<u>91</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>24 24</u>
Frame	<u>24 25</u>

420 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 54  
**Address** 420 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25377](#)  
**Owner** RITTER, KARL W  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes The H.H. Sagebeil Home.

1983 Historic Resources Survey	
Previous Site No.	<u>92</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>24 29</u>
Frame	<u>23 10</u>

502 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 53  
**Address** 502 W. Austin  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R2206](#)  
**Owner** METZGER, CONSTRUCTION CO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes Building's exterior walls have been reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

503 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 146  
**Address** 503 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22147](#)  
**Owner** KROCHMAN, RUDOLF E JR  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>93</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>18 18</u>
Frame	<u>35 36</u>

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

504 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 52  
**Address** 504 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular; Victorian Italianate  
**GCAD Hyperlink** [R17372](#)  
**Owner** METZGER, JAMES H  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. 94  
 Previous Ranking 2  
 Previous Photo References

Roll 24  
 Frame 22

505 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 145  
**Address** 505 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23781](#)  
**Owner** NELMS, LEE FAHRENBROOK  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance.

Notes Large rear addition was added in 2001

### 1983 Historic Resources Survey

Previous Site No. 95  
 Previous Ranking 2  
 Previous Photo References

Roll 19  
 Frame 2

507 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 144  
**Address** 507 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16447](#)  
**Owner** FLINT IDA MAE  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Resource displays distinctive stylistic elements.

Notes

### 1983 Historic Resources Survey

Previous Site No. 97  
 Previous Ranking 2  
 Previous Photo References

Roll 19  
 Frame 3

508 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 51  
**Address** 508 W. Austin  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20876](#)  
**Owner** METZGER, JAMES H  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. 98  
 Previous Ranking 3  
 Previous Photo References

Roll 24  
 Frame 20

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

509 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 143  
**Address** 509 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22842](#)  
**Owner** MOORE, ROSALEE -LIFE ESTATE-D/O PATRICIA ANN MONK ETAL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes** Exterior wall reclad w/brick (historic alteration). An addition was added on to the rear of the house.

1983 Historic Resources Survey	
Previous Site No.	99
Previous Ranking	2
Previous Photo References	
Roll	19
Frame	4

510 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 50  
**Address** 510 W. Austin  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26635](#)  
**Owner** SOLLOHUB, DOUGLAS R & LINDA M  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Permastone added to front façade, garage added to east façade, and all original windows replaced.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

511 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 142  
**Address** 511 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19686](#)  
**Owner** HARRISON, CLARA B -CONTRACT- D/O HARRISON FAMILY TRUST  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

512 W. Austin



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 49  
**Address** 512 W. Austin  
**Date** 1915  
**Stylistic Influence**  
**GCAD Hyperlink** [R15560](#)  
**Owner** RAMSEY, JAMES W & DEBRA  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes** House has a recent rear addition with aluminum frame windows.

1983 Historic Resources Survey	
Previous Site No.	100
Previous Ranking	3
Previous Photo References	
Roll	24
Frame	19

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

513 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 141  
**Address** 513 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R25364](#)  
**Owner** SMITH, ROBERT W & PHYLLIS  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

### 1983 Historic Resources Survey

**Previous Site No.** 101  
**Previous Ranking** 3  
**Previous Photo References**

Roll 19  
 Frame 5

514 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 48  
**Address** 514 W. Austin  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18769](#)  
**Owner** VINCENT, JUDITH A  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

### 1983 Historic Resources Survey

**Previous Site No.** 102  
**Previous Ranking** 2  
**Previous Photo References**

Roll 24 24  
 Frame 17 18

515 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 140  
**Address** 515 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20403](#)  
**Owner** BUSCH, CHARLES R & LOIS BUSH  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Addition at rear

### 1983 Historic Resources Survey

**Previous Site No.** 103  
**Previous Ranking** 3  
**Previous Photo References**

Roll  
 Frame

516 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 47  
**Address** 516 W. Austin  
**Date** 1950  
**Stylistic Influence** Ranch  
**GCAD Hyperlink** [R22343](#)  
**Owner** METZGER, LOUISE M  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.


Notes

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

518 W. Austin

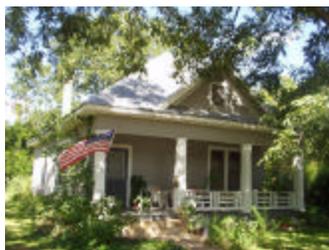

2002 Re-evaluation

High  Medium  Low

**Site ID No.** 46  
**Address** 518 W. Austin  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19415](#)  
**Owner** HARVEY, RICHARD & VELDEN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character. Outstanding decorative features contribute to the resource's significance.

Notes Building's exterior walls have been reclad with asbestos shingles.

### 1983 Historic Resources Survey

**Previous Site No.** 104  
**Previous Ranking** 3  
**Previous Photo References**

Roll 24  
 Frame 16

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

522 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 45  
**Address** 522 W. Austin  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Building's exterior walls have been reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	105
Previous Ranking	2
Previous Photo References	
Roll	24
Frame	15

524 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 44  
**Address** 524 W. Austin  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R14356](#)  
**Owner** CRENWELGE, EUGENE G MRS  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes** Building's exterior walls have been reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	106
Previous Ranking	4
Previous Photo References	
Roll	24
Frame	14

602 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 43  
**Address** 602 W. Austin  
**Date** 1875  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26256](#)  
**Owner** WENDEL, MARTIN CONRAD  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Anton Kunz Home. Front façade stone has been repointed with cement. Resource has rear and side wood-frame additions w/asbestos shingle siding.

1983 Historic Resources Survey	
Previous Site No.	107
Previous Ranking	1
Previous Photo References	
Roll	24 24 24
Frame	9 10 11

603 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 139  
**Address** 603 W. Austin  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R24808](#)  
**Owner** REEH, THOMAS WAYNE & MICHAEL E  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

604 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 42  
**Address** 604 W. Austin  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R26254](#)  
**Owner** WENDEL, MARTIN CONRAD  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Original porch posts replaced w/metal columns.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

605 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 138  
**Address** 605 W. Austin  
**Date** 2002  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19545](#)  
**Owner** BROWN, LARRY D & BARBARA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

606 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 41  
**Address** 606 W. Austin  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27376](#)  
**Owner** ARNOLD, JACK EDWARD & LUCY ANN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Former center passage with c. 1920 additions. Original porch likely removed.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

607 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 137  
**Address** 607 W. Austin  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2135](#)  
**Owner** BURSON, LARRY E ETUX  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	108
Previous Ranking	2
Previous Photo References	
Roll	19
Frame	6

608 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 40  
**Address** 608 W. Austin  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R13660](#)  
**Owner** AVERY, CHRIS M & RUTH  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	109
Previous Ranking	3
Previous Photo References	
Roll	24
Frame	8

609 W. Austin



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 136  
**Address** 609 W. Austin  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R18185](#)  
**Owner** CONN, DAVID BLAINE & PAIGE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** The exterior material was changed to brick (historic alteration) and a large addition was added on the rear and side.

1983 Historic Resources Survey	
Previous Site No.	110
Previous Ranking	2
Previous Photo References	
Roll	19
Frame	7

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

610 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 39  
 Address 610 W. Austin  
 Date \_\_\_\_\_  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment Resource is an empty lot.

Notes Resource is an empty lot.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

612 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 38  
 Address 612 W. Austin  
 Date 1935  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R21590](#)  
 Owner LOCHTE, ATLEE G  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	111
Previous Ranking	4
Previous Photo References	
Roll	29
Frame	4

702 W. Austin



2002 Re-evaluation

High  Medium  Low

Site ID No. 756  
 Address 702 W. Austin  
 Date 1915  
 Stylistic Influence Queen Anne  
 GCAD Hyperlink [R22002](#)  
 Owner LINKA, ROBERT A & NINA LYN  
 Historic District No Outside Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	112
Previous Ranking	3
Previous Photo References	
Roll	9
Frame	30

108 ? N. Bowie



2002 Re-evaluation

High  Medium  Low

Site ID No. 772  
 Address 108 ? N. Bowie  
 Date 1990  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R2061](#)  
 Owner WILBURN, LYNNE  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

110 N. Bowie



2002 Re-evaluation

High  Medium  Low

Site ID No. 771  
 Address 110 N. Bowie  
 Date 1880  
 Stylistic Influence Victorian Italianate  
 GCAD Hyperlink [R2061](#)  
 Owner WILBURN, LYNNE  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Resource has historic rear additions.

1983 Historic Resources Survey	
Previous Site No.	130
Previous Ranking	1
Previous Photo References	
Roll	19 19
Frame	8 14

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

204 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 770  
**Address** 204 N. Bowie  
**Date** 1921  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20902](#)  
**Owner** BROOKSHIRE, DONALD W & ELISABETH K  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes** Rear addition and brick veneer are historic alterations.

### 1983 Historic Resources Survey

Previous Site No. 131

Previous Ranking 2

### Previous Photo References

Roll 19

Frame 9

205 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 532  
**Address** 205 N. Bowie  
**Date** 2000  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R70710](#)  
**Owner** BENTCH, H LEONARD & SUE T  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

### Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

205 (rear) N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 644  
**Address** 205 (rear) N. Bowie  
**Date** 2000  
**Stylistic Influence**  
**GCAD Hyperlink** [R70710](#)  
**Owner** BENTCH, H LEONARD & SUE T  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is a garage apartment at 205 N. Bowie.

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

### Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

206 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 769  
**Address** 206 N. Bowie  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R15982](#)  
**Owner** STOTZ, RONALD A & KATHI  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 132

Previous Ranking 2

### Previous Photo References

Roll 19

Frame 10

209 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 531  
**Address** 209 N. Bowie  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17053](#)  
**Owner** RICHARDS, THOMAS R & VERNA D  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Some original windows replaced.

### 1983 Historic Resources Survey

Previous Site No. 133

Previous Ranking 2

### Previous Photo References

Roll 22 28

Frame 10 33

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

210 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 768  
**Address** 210 N. Bowie  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27385](#)  
**Owner** DUDERSTADT, W C  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Property is a Recorded Texas Historic Landmark. Was documented by HABS (Historic American Building Survey) in 1934 (HABS, TEX,86-FREBU,3-).

**1983 Historic Resources Survey**

**Previous Site No.** 134  
**Previous Ranking** 1  
**Previous Photo References**

Roll 19 19 19  
 Frame 11 12 13

302 N. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 767  
**Address** 302 N. Bowie  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R26746](#)  
**Owner** BIERSCHWALE, CREDIT & LENDING  
**Historic District** No Outside Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

108 ? S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 773  
**Address** 108 ? S. Bowie  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

109 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 533  
**Address** 109 S. Bowie  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R21134](#)  
**Owner** WALLACE, GRACE LORAINE  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

110 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 774  
**Address** 110 S. Bowie  
**Date** 1905  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R28335](#)  
**Owner** LEE, RONALD E JR  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Resource has a significant addition

**1983 Historic Resources Survey**

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

202 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 775  
**Address** 202 S. Bowie  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R58755](#)  
**Owner** COX, LINDA JANE P  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Garage has been attached to the rear of this resource.

1983 Historic Resources Survey	
Previous Site No.	135
Previous Ranking	2
Previous Photo References	
Roll	22 22
Frame	31 32

205 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 534  
**Address** 205 S. Bowie  
**Date** 1933  
**Stylistic Influence**  
**GCAD Hyperlink** [R27485](#)  
**Owner** SCHELL, JERRY C JR  
**Historic District** Yes Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes** All original windows replaced w/aluminum frame units. Rear wing added which extended out roofline.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

205 (rear) S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 645  
**Address** 205 (rear) S. Bowie  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R81968](#)  
**Owner** SCHELL, JERRY C JR  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls reclad, all original windows replaced w/aluminum sash units, and original entrance altered. Resource is a former carriage house/domestic quarters.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

206 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 776  
**Address** 206 S. Bowie  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18998](#)  
**Owner** SMITH, BARRY A & JOYCE  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has an historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	136
Previous Ranking	2
Previous Photo References	
Roll	22
Frame	30

207 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 535  
**Address** 207 S. Bowie  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25563](#)  
**Owner** HOGGARD, JOHN C & PATRICIA  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** All doorways embellished w/incompatible log elements, original porch posts replaced, and most original windows replaced. Resource also has non-historic side and rear façade additions.

1983 Historic Resources Survey	
Previous Site No.	137
Previous Ranking	2
Previous Photo References	
Roll	29
Frame	9

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

208 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 777  
**Address** 208 S. Bowie  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R25563](#)  
**Owner** HOGGARD, JOHN C & PATRICIA  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

210 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 536  
**Address** 210 S. Bowie  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R14599](#)  
**Owner** MCCRACKEN, J R LIVING TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

Exterior walls reclad with vinyl siding, all original windows replaced w/aluminum sash units, original porch posts replaced with metal columns, and garage enclosed. Also small wing added to garage.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

305 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 537  
**Address** 305 S. Bowie  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R18572](#)  
**Owner** WEBER, CALVIN E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

Exterior walls reclad with asbestos shingles and vertical plywood panels and a small wing w/ aluminum sash window has been added to north façade.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

308 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 778  
**Address** 308 S. Bowie  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

310 S. Bowie



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 779  
**Address** 310 S. Bowie  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1287](#)  
**Owner** CARPENTER, JAMES & CYNTHIA  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

Resource's porch likely altered c. 1920.

1983 Historic Resources Survey	
Previous Site No.	138
Previous Ranking	3
Previous Photo References	
Roll	5
Frame	32

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

211 W. Burbank



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 947  
**Address** 211 W. Burbank  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1874](#)  
**Owner** BRANDT, MELROY I ETUX  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	141
Previous Ranking	2
Previous Photo References	
Roll	5 13
Frame	17 32

407 W. Burbank



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 946  
**Address** 407 W. Burbank  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20546](#)  
**Owner** THAYER, RUSS & CECILIA  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

Circa-1960 rear addition. Rose block for the main house was manufactured in the historic 1900 barn; 1930s historic cistern shed.

1983 Historic Resources Survey	
Previous Site No.	143
Previous Ranking	2
Previous Photo References	
Roll	5
Frame	16

104 E. Centre



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 953  
**Address** 104 E. Centre  
**Date** 1918  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1434](#)  
**Owner** SMITH, ROBERT W & PHYLLIS  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

Historic rear shed.

1983 Historic Resources Survey	
Previous Site No.	144
Previous Ranking	2
Previous Photo References	
Roll	3 3
Frame	4 5

112 E. Centre



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 954  
**Address** 112 E. Centre  
**Date** 1906  
**Stylistic Influence** Italianate  
**GCAD Hyperlink** [R15464](#)  
**Owner** DURST, ELSA -LIFE ESTATE-  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

Added second story, historic rear shed

1983 Historic Resources Survey	
Previous Site No.	146
Previous Ranking	1
Previous Photo References	
Roll	2 3
Frame	37 2

206 E. Centre



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 930  
**Address** 206 E. Centre  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R22092](#)  
**Owner** KIZER, ELSIE E  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

Porch support replaced and flooring removed.

1983 Historic Resources Survey	
Previous Site No.	147
Previous Ranking	2
Previous Photo References	
Roll	2
Frame	36

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

110 W. Centre



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 952  
**Address** 110 W. Centre  
**Date** 1900  
**Stylistic Influence** vernacular: Queen Anne  
**GCAD Hyperlink** [R18402](#)  
**Owner** RIEDER, COURTENAY NICHOLS &  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic barn and cistern building.

### 1983 Historic Resources Survey

**Previous Site No.** 155  
**Previous Ranking** 2  
**Previous Photo References**

Roll 3  
 Frame 7

203 W. Centre



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 951  
**Address** 203 W. Centre  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23630](#)  
**Owner** ROBERTS, OPAL CHRISTINE  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic addition.

### 1983 Historic Resources Survey

**Previous Site No.** 157  
**Previous Ranking** 2  
**Previous Photo References**

Roll 4  
 Frame 30

104 N. Cherry



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 935  
**Address** 104 N. Cherry  
**Date** 1904  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R18145](#)  
**Owner** CHASE, FLOYD, C & JOYCE  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic rear addition; historic smokehouse, potting shed, and c. 1914 garage.

### 1983 Historic Resources Survey

**Previous Site No.** 158  
**Previous Ranking** 2  
**Previous Photo References**

Roll 9  
 Frame 5

110 N. Cherry



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 936  
**Address** 110 N. Cherry  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26051](#)  
**Owner** SMITH, DOROTHY CAROLINE -LIFE EST-  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** 2 rear additions, one is historic, one non-historic. Also a 1925 smokehouse with cistern and 1903 cellar house (Weber Das Keller Haus, RTHL).

### 1983 Historic Resources Survey

**Previous Site No.** 159  
**Previous Ranking** 2  
**Previous Photo References**

Roll 9  
 Frame 6

211 N. Cherry



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 937  
**Address** 211 N. Cherry  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27554](#)  
**Owner** MARCOM, EDYTH STANTON ESTATE  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Non-historic rear addition, historic smokehouse/cistern and barn.

### 1983 Historic Resources Survey

**Previous Site No.** 160  
**Previous Ranking** 2  
**Previous Photo References**

Roll 7 9  
 Frame 28 37

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

102 S. Cherry



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 919  
**Address** 102 S. Cherry  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R20262](#)  
**Owner** MITCHELL, MARK E & JASON D RUSTIN  
**Historic District** No Local Landmark  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 161  
 Previous Ranking 2  
 Previous Photo References

Roll 9  
 Frame 4

312 E. College



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 925  
**Address** 312 E. College  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R16152](#)  
**Owner** CARLISLE, KARLEEN  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 166  
 Previous Ranking 2  
 Previous Photo References

Roll 2  
 Frame 30

408 E. College



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 924  
**Address** 408 E. College  
**Date** 1905  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1644](#)  
**Owner** BAUER, LAURA M C/O KATHLEEN OUTLAW  
**Historic District** No Local Landmark  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 168  
 Previous Ranking 2  
 Previous Photo References

Roll 2  
 Frame 31

112 W. College



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 950  
**Address** 112 W. College  
**Date** 1905  
**Stylistic Influence** vernacular; Queen Anne  
**GCAD Hyperlink** [R17191](#)  
**Owner** REAVES, DOUGLAS A & JEANNIE D  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes Historic rear addition; non-historic garage.

1983 Historic Resources Survey

Previous Site No. 173  
 Previous Ranking 2  
 Previous Photo References

Roll 2 2  
 Frame 24 25

306 W. College



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 948  
**Address** 306 W. College  
**Date** 1900  
**Stylistic Influence** Classical Revival  
**GCAD Hyperlink** [R2082](#)  
**Owner** STEHLING, GARY C & DENISE L  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes Non-historic exterior brick cladding added.

1983 Historic Resources Survey

Previous Site No. 179  
 Previous Ranking 2  
 Previous Photo References

Roll 2  
 Frame 18

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

401 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 593  
**Address** 401 Cora  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R25114](#)  
**Owner** RODE, ELSA  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a small rear addition.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

402 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 613  
**Address** 402 Cora  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R2564](#)  
**Owner** TROTTER, BART W & MIMI  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Bathroom window opening partially enclosed and replaced with aluminum sash unit and primary entry door's transom and sidelights partially enclosed. Resource also has a rear shed-roof addition.

1983 Historic Resources Survey	
Previous Site No.	192
Previous Ranking	2
Previous Photo References	
Roll	8
Frame	27

403 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 680  
**Address** 403 Cora  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R28389](#)  
**Owner** KUNZ, PATICK A & CYNTHIA A  
**Historic District** Yes Potential Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	193
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	37

405 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 679  
**Address** 405 Cora  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R29198](#)  
**Owner** THOMPSON, JON RANDALL & SUSAN  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	194
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	36

406 N. Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 880  
**Address** 406 N. Cora  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

407 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 678  
**Address** 407 Cora  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2471](#)  
**Owner** KNOPP, KENNETH P  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a rear shed-roof addition w/synthetic exteriors and aluminum sash windows. Also rear cistern house has been converted to living quarters (see site ID# 681).

1983 Historic Resources Survey	
Previous Site No.	195
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	35

408 N. Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 878  
**Address** 408 N. Cora  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R15593](#)  
**Owner** COLLIER, TERRILL D  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Exterior material alteration is historic.

1983 Historic Resources Survey	
Previous Site No.	196
Previous Ranking	2
Previous Photo References	
Roll	8
Frame	28

408 N. Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 879  
**Address** 408 N. Cora  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R15595](#)  
**Owner** COLLIER, TERRILL D  
**Historic District** Yes Potential Historic District  
**Assessment** Resource is an empty lot.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

409 Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 677  
**Address** 409 Cora  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R20401](#)  
**Owner** KNOPP, MINNA  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a side façade addition.

1983 Historic Resources Survey	
Previous Site No.	197
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	34

410 N. Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 877  
**Address** 410 N. Cora  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R13732](#)  
**Owner** RANKIN, WILLIAM J & LOIS K  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

502 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 876  
 Address 502 N. Cora  
 Date 1900  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R1529](#)  
 Owner WHITEN, CHARLES & VALERIE  
 Historic District Yes Potential Historic District  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

504 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 875  
 Address 504 N. Cora  
 Date 1970  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R27487](#)  
 Owner THIELE, NORMA R  
 Historic District Yes Potential Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

505 Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 676  
 Address 505 Cora  
 Date \_\_\_\_\_  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Potential Historic District  
 Assessment Resource is an empty lot.

Notes Resource is an empty lot with shed, windmill, and cistern.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

506 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 874  
 Address 506 N. Cora  
 Date 1920  
 Stylistic Influence Craftsman  
 GCAD Hyperlink [R15783](#)  
 Owner OWENS, MARGARET & HELEN OWENS SIMS  
 Historic District Yes Potential Historic District  
 Assessment Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials.

Notes

1983 Historic Resources Survey	
Previous Site No.	198
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	30

507 Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 675  
 Address 507 Cora  
 Date 1940  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R25105](#)  
 Owner HEPP, SEAN X & CASSELL D  
 Historic District Yes Potential Historic District  
 Assessment Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

508 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 872  
 Address 508 N. Cora  
 Date 1990  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R26101](#)  
 Owner PROCH, THOMAS JAMES & JANET  
 Historic District Yes Potential Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

508 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 873  
 Address 508 N. Cora  
 Date 1910  
 Stylistic Influence Tudor Revival  
 GCAD Hyperlink [R26101](#)  
 Owner PROCH, THOMAS JAMES & JANET  
 Historic District Yes Potential Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

509 Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 674  
 Address 509 Cora  
 Date 1935  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R15315](#)  
 Owner HICKS, ROSA M  
 Historic District Yes Potential Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

510 N. Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 871  
 Address 510 N. Cora  
 Date 1930  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R25933](#)  
 Owner FELLER, STEPHEN K & CAROL JEAN  
 Historic District Yes Potential Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

511 Cora



2002 Re-evaluation

High  Medium  Low

Site ID No. 673  
 Address 511 Cora  
 Date 1945  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R13774](#)  
 Owner CARLISLE, KARLEEN  
 Historic District Yes Potential Historic District  
 Assessment Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

512 W. Cora



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 870  
**Address** 512 W. Cora  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R16406](#)  
**Owner** HARPER, SANDRA JO  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	199
Previous Ranking	3
Previous Photo References	
Roll	8
Frame	32

103 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 516  
**Address** 103 E. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13287](#)  
**Owner** FLOYD, FRANK E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has non-historic rear and side façade additions.

1983 Historic Resources Survey	
Previous Site No.	200
Previous Ranking	2
Previous Photo References	
Roll	21
Frame	29

105 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 515  
**Address** 105 E. Creek  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R8736](#)  
**Owner** HUNTER, J D ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Exterior walls reclad with vertical plywood panels. Original windows replaced with aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

105 (rear) E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 640  
**Address** 105 (rear) E. Creek  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R8736](#)  
**Owner** HUNTER, J D ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is a B&B cottage at the same address as site ID# 515.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

105 (rear) E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 641  
**Address** 105 (rear) E. Creek  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R8736](#)  
**Owner** HUNTER, J D ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is a B&B cottage at the same address as site ID# 515. Property was obscured from street and therefore not photographed.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

106 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 509  
**Address** 106 E. Creek  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14299](#)  
**Owner** MAVERICK, JAMIE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Two original side façade windows have been replaced w/aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	201
Previous Ranking	2
Previous Photo References	
Roll	28
Frame	9

107 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 514  
**Address** 107 E. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19347](#)  
**Owner** LASSWELL, M W ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original windows replaced w/aluminum sash units and tile added to porch floor.

1983 Historic Resources Survey	
Previous Site No.	202
Previous Ranking	3
Previous Photo References	
Roll	21 21
Frame	30 31

108 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 510  
**Address** 108 E. Creek  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R14589](#)  
**Owner** OBOYLE, DEBORAH JEAN  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

110 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 511  
**Address** 110 E. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2621](#)  
**Owner** OBOYLE, DEBORAH JEAN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Excellent example of its type.

1983 Historic Resources Survey	
Previous Site No.	203
Previous Ranking	2
Previous Photo References	
Roll	28 28 28
Frame	10 11 12

110 (rear) E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 639  
**Address** 110 (rear) E. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14592](#)  
**Owner** OBOYLE, DEBORAH JEAN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Small Sunday house to the rear of 110 E. Creek (see site ID# 511).

1983 Historic Resources Survey	
Previous Site No.	204
Previous Ranking	2
Previous Photo References	
Roll	28
Frame	13

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

111 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 513  
**Address** 111 E. Creek  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R24252](#)  
**Owner** LASSWELL, M W ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	205
Previous Ranking	4
Previous Photo References	
Roll	21
Frame	32

201 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 881  
**Address** 201 E. Creek  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R1894](#)  
**Owner** BENEDICT, C DEL  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	206
Previous Ranking	4
Previous Photo References	
Roll	13
Frame	28

201 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 512  
**Address** 201 E. Creek  
**Date** 1915  
**Stylistic Influence**  
**GCAD Hyperlink** [R62642](#)  
**Owner** BENEDICT, C DEL  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

Front façade porch added. Some original windows replaced with aluminum sash unties. Endwall chimney added to front façade.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

202 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 607  
**Address** 202 E. Creek  
**Date** 1959  
**Stylistic Influence**  
**GCAD Hyperlink** [R23086](#)  
**Owner** BOLTON, J TIMOTHY  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

Rear loading dock has been enclosed, some window openings have been enclosed, and a rear concrete block wing was constructed c. 1970.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 890  
**Address** 204 E. Creek  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R16092](#)  
**Owner** BOLTON, JOHN T & CAROL  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

205 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 882  
**Address** 205 E. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23599](#)  
**Owner** STARRY, MELISSA OSBOURN  
**Historic District** Yes Extension of Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has historic additions.

1983 Historic Resources Survey	
Previous Site No.	<u>207</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>27</u>

207 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 883  
**Address** 207 E. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R22789](#)  
**Owner** MOLBERG, H CARL  
**Historic District** Yes Extension of Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Resource displays distinctive stylistic elements.

**Notes** Resource has historic addition.

1983 Historic Resources Survey	
Previous Site No.	<u>208</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>26</u>

209 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 884  
**Address** 209 E. Creek  
**Date** 1930  
**Stylistic Influence** Craftsman; Tudor Revival  
**GCAD Hyperlink** [R14194](#)  
**Owner** SLYKER, ELIZABETH CLARE REIGEL  
**Historic District** Yes Extension of Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>209</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>25</u>

210 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 889  
**Address** 210 E. Creek  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R1630](#)  
**Owner** HAHN, JAMES F & CHERYL  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls have been reclad with vinyl siding and garage has been attached to house.

1983 Historic Resources Survey	
Previous Site No.	<u>210</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>31</u>

211 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 885  
**Address** 211 E. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R21286](#)  
**Owner** LANGERHANS, CHESTER  
**Historic District** Yes Extension of Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>211</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>24</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

212 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 888  
**Address** 212 E. Creek  
**Date** 1998  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25625](#)  
**Owner** SIMONSEN, W J ETUX  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

213 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 886  
**Address** 213 E. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23034](#)  
**Owner** DOYLE, PATRICK J & NANCY M  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Cistern has been attached to the rear of the house w/ a wood-frame enclosed breezeway.

1983 Historic Resources Survey	
Previous Site No.	<u>212</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>13</u>
Frame	<u>23</u>

217 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 887  
**Address** 217 E. Creek  
**Date** 1938  
**Stylistic Influence**  
**GCAD Hyperlink** [R20233](#)  
**Owner** OEHLER, GREGORY L & DONNA T  
**Historic District** Yes Extension of Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials.

**Notes** Alterations are historic.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

411 E. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 899  
**Address** 411 E. Creek  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19342](#)  
**Owner** TREAT, DAVID L & LISA S  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** Resource has historic rear additions.

1983 Historic Resources Survey	
Previous Site No.	<u>213</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>10 10 11</u>
Frame	<u>20 21 5</u>

603 S. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 934  
**Address** 603 S. Creek  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R29426](#)  
**Owner** CRENWELGE, MARVIN J & BARBARA  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** Lot Overgrown

1983 Historic Resources Survey	
Previous Site No.	<u>225</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>10 10</u>
Frame	<u>28 29</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

101 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 517  
**Address** 101 W. Creek  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16408](#)  
**Owner** BOURQUEIN, BARBARA JO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Jordan-Tatsch Finkernagel Home. Resource has a non-historic rear and side façade additions. Porch added c. 1985.

1983 Historic Resources Survey			
Previous Site No.	226		
Previous Ranking	2		
Previous Photo References			
Roll	21	21	21
Frame	26	27	28

103 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 518  
**Address** 103 W. Creek  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18813](#)  
**Owner** MOOD, MARY  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Exterior walls re-clad with asbestos shingles, metal exterior staircase added to east façade, and original porch replaced.

1983 Historic Resources Survey			
Previous Site No.	227		
Previous Ranking	2		
Previous Photo References			
Roll	21		
Frame	25		

104 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 508  
**Address** 104 W. Creek  
**Date** 1925  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R24947](#)  
**Owner** PEDREGON, HECTOR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Small board-and-batten shed has been attached to the building's east façade.

1983 Historic Resources Survey			
Previous Site No.	228		
Previous Ranking	4		
Previous Photo References			
Roll	28	28	
Frame	6	7	

105 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 750  
**Address** 105 W. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R29196](#)  
**Owner** SEGNER, CYNTHIA ANN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	229		
Previous Ranking	3		
Previous Photo References			
Roll	21		
Frame	24		

106 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 507  
**Address** 106 W. Creek  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R22190](#)  
**Owner** TATUM, CAROL JOAN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Has an upper story addition and a rear addition with board-and-batten exteriors.

1983 Historic Resources Survey			
Previous Site No.	230		
Previous Ranking	3		
Previous Photo References			
Roll	28	28	
Frame	5	8	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

107 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 749  
**Address** 107 W. Creek  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R29200](#)  
**Owner** IMMEL, SCOTT & JENNIFER  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

108 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 506  
**Address** 108 W. Creek  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26880](#)  
**Owner** PEDREGON, CRISTINA & DAVID J SAWTELLE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

109 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 748  
**Address** 109 W. Creek  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R29205](#)  
**Owner** ZENNER, MILTON E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

111 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 747  
**Address** 111 W. Creek  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R16954](#)  
**Owner** WUNDERLICH, ARTHUR W & DONNA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

112 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 505  
**Address** 112 W. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19228](#)  
**Owner** TEAGUE, BILL ETAL D/B/A TEAGUE INVESTMENTS  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** 231  
**Previous Ranking** 3  
**Previous Photo References**

Roll 28  
 Frame 3

113 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 746  
**Address** 113 W. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20989](#)  
**Owner** MERCER, LIANNE E  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** 232  
**Previous Ranking** 3  
**Previous Photo References**

Roll 21  
 Frame 23

114 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 504  
**Address** 114 W. Creek  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R26817](#)  
**Owner** BRAMMER, LYNN S  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

115 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 745  
**Address** 115 W. Creek  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13503](#)  
**Owner** CHESER, ELAINE B  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** 233  
**Previous Ranking** 2  
**Previous Photo References**

Roll 21 21 21  
 Frame 20 21 22

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

116 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 503  
**Address** 116 W. Creek  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R21160](#)  
**Owner** CASEY, WILLOMAE  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

119 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 744  
**Address** 119 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16814](#)  
**Owner** HOCKER, JOHN W & NANCY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>234</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	21
Frame	19

121 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 743  
**Address** 121 W. Creek  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

201 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 742  
**Address** 201 W. Creek  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R20363](#)  
**Owner** KNOPP, JEFFREY E ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes House appears to have been altered c. 1945.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

203 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 741  
**Address** 203 W. Creek  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17907](#)  
**Owner** RESER, JERE NEELLEY  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Resource has a recent rear addition.

1983 Historic Resources Survey	
Previous Site No.	<u>235</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>21 21</u>
Frame	<u>17 18</u>

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

204 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 502  
**Address** 204 W. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18055](#)  
**Owner** HEINEMANN, MARGARET  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Has recent rear addition w/incompatible exterior materials, some original windows replaced with aluminum sash units, exterior walls reclad with permastone, and prominent side wall buff brick chimney added to west façade.

1983 Historic Resources Survey	
Previous Site No.	236
Previous Ranking	2
Previous Photo References	
Roll	27
Frame	37

205 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 740  
**Address** 205 W. Creek  
**Date** 1920  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17925](#)  
**Owner** COLLINS, WANDA W  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Garage attached to side façade.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

206 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 501  
**Address** 206 W. Creek  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24998](#)  
**Owner** HARRIS, JOAN P  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Asphalt roll added to front gable end.

1983 Historic Resources Survey	
Previous Site No.	237
Previous Ranking	2
Previous Photo References	
Roll	27
Frame	36

207 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 739  
**Address** 207 W. Creek  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26201](#)  
**Owner** MEAR, PETER & SHARON  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource consists of two houses joined by an enclosed breezeway. Significant non-historic rear additions impact this resource's integrity.

1983 Historic Resources Survey	
Previous Site No.	238
Previous Ranking	1
Previous Photo References	
Roll	21 21 21
Frame	13 14 15

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

208 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 500  
**Address** 208 W. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R17629](#)  
**Owner** BRUNS, RICHARD M & ROXANNE M  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

### 1983 Historic Resources Survey

**Previous Site No.** 239  
**Previous Ranking** 3  
**Previous Photo References**

Roll 27  
 Frame 35

210 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 499  
**Address** 210 W. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19558](#)  
**Owner** HANNON, ANGELA K ETAL  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

### 1983 Historic Resources Survey

**Previous Site No.** 240  
**Previous Ranking** 3  
**Previous Photo References**

Roll 27  
 Frame 34

211 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 738  
**Address** 211 W. Creek  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27146](#)  
**Owner** MEAR, SHARON B  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

### 1983 Historic Resources Survey

**Previous Site No.** 241  
**Previous Ranking** 3  
**Previous Photo References**

Roll 21 21  
 Frame 11 12

212 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 498  
**Address** 212 W. Creek  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23433](#)  
**Owner** COOTER, KIRK  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Resource has a rear wood-frame shed roof addition.

### 1983 Historic Resources Survey

**Previous Site No.** 242  
**Previous Ranking** 2  
**Previous Photo References**

Roll 27  
 Frame 33

213 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 737  
**Address** 213 W. Creek  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26330](#)  
**Owner** GREENLEE, STIRLING  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Resource is a Recorded Texas Historic Landmark

### 1983 Historic Resources Survey

**Previous Site No.** 243  
**Previous Ranking** 1  
**Previous Photo References**

Roll 21 21 21  
 Frame 6 7 8

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

214 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 497  
**Address** 214 W. Creek  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R28410](#)  
**Owner** WEINHEIMER, CAREY ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Concrete block garage appended to rear, original porch posts replaced with metal columns.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

215 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 736  
**Address** 215 W. Creek  
**Date** 1840  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource is a Recorded Texas Historic Landmark

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

217 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 735  
**Address** 217 W. Creek  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R20864](#)  
**Owner** KRAUS, GERTRUDE MISS  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes** Front-gabled portion is a recent addition.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

219 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 734  
**Address** 219 W. Creek  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R26910](#)  
**Owner** PEHL, LEROY ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Wood-frame carport has been added to side façade.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

223 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 733  
**Address** 223 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19211](#)  
**Owner** JENSCHKE, EMMA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Porch partially infilled with non-historic stone addition.

1983 Historic Resources Survey

Previous Site No. 244  
 Previous Ranking 1  
 Previous Photo References

Roll 21 21  
 Frame 4 5

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

301 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 732  
**Address** 301 W. Creek  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1634](#)  
**Owner** BASSE, ANNIE BETTY -LIFE ESTATE- D/O HENRY W BASSE ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character. Resource displays distinctive stylistic elements.  
**Notes** Stone building has been attached to rear.

1983 Historic Resources Survey	
Previous Site No.	245
Previous Ranking	2
Previous Photo References	
Roll	21
Frame	3

305 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 731  
**Address** 305 W. Creek  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R26064](#)  
**Owner** LEHMANN, BRENDA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.  
**Notes**

1983 Historic Resources Survey	
Previous Site No.	246
Previous Ranking	3
Previous Photo References	
Roll	21
Frame	2

311 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 730  
**Address** 311 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1177](#)  
**Owner** PEARSON, GRAHAM D  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.  
**Notes** Resource has an historic rear shed-roof addition.

1983 Historic Resources Survey	
Previous Site No.	247
Previous Ranking	2
Previous Photo References	
Roll	21
Frame	1

313 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 729  
**Address** 313 W. Creek  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R28176](#)  
**Owner** SNAPP, LISA A  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.  
**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

314 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 496  
**Address** 314 W. Creek  
**Date** 1875  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21261](#)  
**Owner** HOERSTER, RICHARD & MAXIE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Ahrens-Spaeth-Langehenning Home.

1983 Historic Resources Survey			
Previous Site No.	248		
Previous Ranking	1		
Previous Photo References			
Roll	27	27	27
Frame	30	31	32

315 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 728  
**Address** 315 W. Creek  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R26633](#)  
**Owner** HEATH, BRIAN M & ANGELA C  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Exterior wall partially reclad with stone veneer and synthetic siding.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	-----		
Frame	-----		

317 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 727  
**Address** 317 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25566](#)  
**Owner** PEAKE, DAVID W & KATHERINE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	249		
Previous Ranking	2		
Previous Photo References			
Roll	-----		
Frame	-----		

319 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 726  
**Address** 319 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23888](#)  
**Owner** PANKRATZ, JONATHAN JAY & MARILEE R  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a major rear addition.

1983 Historic Resources Survey			
Previous Site No.	250		
Previous Ranking	3		
Previous Photo References			
Roll	-----		
Frame	-----		

321 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 725  
**Address** 321 W. Creek  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R60378](#)  
**Owner** WATSON, WALTER WILLIAM  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	-----		
Frame	-----		

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

401 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 724  
**Address** 401 W. Creek  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R25337](#)  
**Owner** BURKE, JACK JR & ROBIN  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	251
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	37

402 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 490  
**Address** 402 W. Creek  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R23791](#)  
**Owner** SMITH, EDWARD J & BARBARA J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Some original windows replaced w/aluminum sash units, significant side and rear façade wings added c. 1980.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

403 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 723  
**Address** 403 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular: Gothic Revival  
**GCAD Hyperlink** [R15872](#)  
**Owner** BURKE, JACK JR & ROBIN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	252
Previous Ranking	2
Previous Photo References	
Roll	20
Frame	36

404 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 491  
**Address** 404 W. Creek  
**Date** 1965  
**Stylistic Influence** Ranch  
**GCAD Hyperlink** [R14738](#)  
**Owner** SCHMIDTZINSKY, CELESTE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

405 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 722  
**Address** 405 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular; Tudor Revival  
**GCAD Hyperlink** [R17696](#)  
**Owner** HANNEMANN, HEROLD H & DORTHY L  
 REVOCABLE LIVING  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Tudoresque front gable added to porch c. 1930. Exterior walls reclad with asbestos shingles (rear addition) and permastone.

1983 Historic Resources Survey	
Previous Site No.	253
Previous Ranking	3
Previous Photo References	
Roll	20 20
Frame	34 35

408 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 492  
**Address** 408 W. Creek  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R17354](#)  
**Owner** KEESE, NORA % WITTIG, CLARA  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes** Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

409 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 721  
**Address** 409 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20969](#)  
**Owner** SULTEMEIER, ELLA MAE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	254
Previous Ranking	2
Previous Photo References	
Roll	20 20
Frame	32 33

412 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 493  
**Address** 412 W. Creek  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R14363](#)  
**Owner** GRONA, DELBERT & IMOGENE  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes** Original windows replaced with aluminum sash units. Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

413 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 719  
**Address** 413 W. Creek  
**Date** 1849  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18436](#)  
**Owner** HAMILTON, PAUL R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Kuenemann House.

### 1983 Historic Resources Survey

**Previous Site No.** 255  
**Previous Ranking** 2  
**Previous Photo References**

Roll 20 20 20  
 Frame 28 29 30

413 A W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 720  
**Address** 413 A W. Creek  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18436](#)  
**Owner** HAMILTON, PAUL R  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes** Resource consists of two joined houses.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

414 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 494  
**Address** 414 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** \_\_\_\_\_  
**Owner** \_\_\_\_\_  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 256  
**Previous Ranking** 3  
**Previous Photo References**

Roll 27  
 Frame 29

416 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 495  
**Address** 416 W. Creek  
**Date** 1900  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R19463](#)  
**Owner** JUNG, EDNA -LIFE ESTATE- D/O CURTIS JUNG ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Front façade gabled wings w/ casement windows likely not original and exterior walls reclad with permastone.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

418 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 489  
**Address** 418 W. Creek  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22714](#)  
**Owner** SCHOFIELD JANE H  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Resource appears to be an early center passage with an L-plan added. Has a c. 1970 rear two-story wing added. Asbestos shingles added to I-plan portion of the house.

### 1983 Historic Resources Survey

Previous Site No. 257  
 Previous Ranking 3  
 Previous Photo References

Roll 27  
 Frame 28

501 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 718  
**Address** 501 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19138](#)  
**Owner** JENKINS, JERALD E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 258  
 Previous Ranking 3  
 Previous Photo References

Roll 20  
 Frame 27

502 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 488  
**Address** 502 W. Creek  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14103](#)  
**Owner** CONLON, FAMILY TRUST % DOROTHY CONLON TRUSTEE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

504 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 487  
**Address** 504 W. Creek  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26875](#)  
**Owner** SCHILTHUIS, CAROLYN  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 259  
 Previous Ranking 2  
 Previous Photo References

Roll 27  
 Frame 26

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

505 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 717  
**Address** 505 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13903](#)  
**Owner** AVERY, JAMES  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** All original windows replaced, exterior walls reclad w/asbestos shingles and stone, and front porch enclosed.

### 1983 Historic Resources Survey

**Previous Site No.** 717  
**Previous Ranking** 3  
**Previous Photo References**

Roll 13  
 Frame 37

506 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 486  
**Address** 506 W. Creek  
**Date** 1915  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20965](#)  
**Owner** KRAUSKOPF, PATRICIA ETAL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Exterior walls reclad with asbestos shingles, some windows replaced with aluminum sash units, glass block added around primary entrance, original porch location changed (per Sanborn maps).

### 1983 Historic Resources Survey

**Previous Site No.** 260  
**Previous Ranking** 4  
**Previous Photo References**

Roll 27  
 Frame 25

507 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 716  
**Address** 507 W. Creek  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R26082](#)  
**Owner** SCHNERR, BILLY MARVIN & PARKER, DORIS JEAN  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls reclad with brick.

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

508 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 485  
**Address** 508 W. Creek  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R29045](#)  
**Owner** PARKER, JAMES CRAIG & MARGARET A  
**Historic District** Yes Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes** Original exterior materials covered with asbestos shingles and original porch posts replaced.

### 1983 Historic Resources Survey

**Previous Site No.** 261  
**Previous Ranking** 4  
**Previous Photo References**

Roll 27  
 Frame 27

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

509 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 715  
**Address** 509 W. Creek  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23948](#)  
**Owner** MERDIAN, DONALD C & ROSEMARY S  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

511 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 714  
**Address** 511 W. Creek  
**Date** 1915  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R16337](#)  
**Owner** FIEDLER, KERMIT  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>262</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>20</u>
Frame	<u>26</u>

512 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 484  
**Address** 512 W. Creek  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26592](#)  
**Owner** OWEN, DIAN GRAVES  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>263</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>27 27 27</u>
Frame	<u>18 19 20</u>

513 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 713  
**Address** 513 W. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26552](#)  
**Owner** PACKARD, FRANCIS DOUGLAS ETUX  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>264</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>20</u>
Frame	<u>25</u>

513 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 712  
**Address** 513 W. Creek  
**Date** \_\_\_\_\_  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R26552](#)  
**Owner** PACKARD, FRANCIS DOUGLAS ETUX  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

514 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 483  
**Address** 514 W. Creek  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R1481](#)  
**Owner** WENIG, JAN  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

516 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 482  
**Address** 516 W. Creek  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R14688](#)  
**Owner** HOGGARD, JOHN C & PATRICIA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority. Resource has undergone alterations.

**Notes** House was drastically altered c. 2001.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

518 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 481  
**Address** 518 W. Creek  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1858](#)  
**Owner** STEWART, GEORGE R JR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Former center passage renovated circa 1920. Resource has a rear dogtrot connecting it to old stone kitchen. Exterior walls reclad with asbestos shingles. Original porch posts and balustrade replaced.

1983 Historic Resources Survey	
Previous Site No.	265
Previous Ranking	3
Previous Photo References	
Roll	27
Frame	17

601 W. Creek



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 710  
**Address** 601 W. Creek  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2602](#)  
**Owner** EPISCOPAL CHURCH CORPORATION IN WEST TEXAS  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Property is a Recorded Historic Texas Landmark

1983 Historic Resources Survey	
Previous Site No.	266
Previous Ranking	1
Previous Photo References	
Roll	20 20 20
Frame	22 23 24

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

601 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 708  
**Address** 601 W. Creek  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R2602](#)  
**Owner** EPISCOPAL CHURCH CORPORATION IN WEST TEXAS  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

601 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 709  
**Address** 601 W. Creek  
**Date** 1960  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2602](#)  
**Owner** EPISCOPAL CHURCH CORPORATION IN WEST TEXAS  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

601 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 711  
**Address** 601 W. Creek  
**Date** 1964  
**Stylistic Influence**  
**GCAD Hyperlink** [R2602](#)  
**Owner** EPISCOPAL CHURCH CORPORATION IN WEST TEXAS  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

606 W. Creek



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 480  
**Address** 606 W. Creek  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19589](#)  
**Owner** KAMMLAH, WALTER MRS  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	267
Previous Ranking	3
Previous Photo References	
Roll	27
Frame	16

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

608 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 479  
 Address 608 W. Creek  
 Date 1930  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R26873](#)  
 Owner STEHLING, THOMAS  
 Historic District Yes Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes Brick veneer added to exterior walls.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

610 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 478  
 Address 610 W. Creek  
 Date 1895  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R26875](#)  
 Owner SCHILTHUIS, CAROLYN  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	268
Previous Ranking	2
Previous Photo References	
Roll	27 27
Frame	14 15

612 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 477  
 Address 612 W. Creek  
 Date 1995  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R29306](#)  
 Owner SCHAEFER, GLENN R & TERRY L  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

613 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 707  
 Address 613 W. Creek  
 Date 1920  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R28094](#)  
 Owner WIEMERS, WILLIAM R ETUX  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	270
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	20

614 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 476  
 Address 614 W. Creek  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R24914](#)  
 Owner RENDON, EVANGELINA  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Front façade porch enclosed.  
 Non-historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	271
Previous Ranking	3
Previous Photo References	
Roll	27 27
Frame	12 13

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

615 W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 706  
 Address 615 W. Creek  
 Date 1920  
 Stylistic Influence Craftsman  
 GCAD Hyperlink [R14118](#)  
 Owner DOYLE, PATRICK J & NANCY M  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>272</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>20</u>
Frame	<u>19</u>

701 ? W. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 705  
 Address 701 ? W. Creek  
 Date 2002  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District No Outside Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

112 N. Crockett



2002 Re-evaluation

High  Medium  Low

Site ID No. 810  
 Address 112 N. Crockett  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R14109](#)  
 Owner CONNELLY, ROBERT  
 Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>275</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>23 23 23</u>
Frame	<u>15 16 19</u>

114 N. Crockett



2002 Re-evaluation

High  Medium  Low

Site ID No. 809  
 Address 114 N. Crockett  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>276</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	<u>23 23 23</u>
Frame	<u>17 18 20</u>

115 N. Crockett



2002 Re-evaluation

High  Medium  Low

Site ID No. 574  
 Address 115 N. Crockett  
 Date 1990  
 Stylistic Influence  
 GCAD Hyperlink [R5523](#)  
 Owner SECURITY STATE BANK & TRUST  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

116 N. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 808  
**Address** 116 N. Crockett  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R16587](#)  
**Owner** TRAN, HUYEN  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

206 N. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 807  
**Address** 206 N. Crockett  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R25680](#)  
**Owner** WEHMEYER, BERNICE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>277</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>7</u>
Frame	<u>5</u>

208 N. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 806  
**Address** 208 N. Crockett  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R19848](#)  
**Owner** MAZUREK, SHELLY JO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

209 N. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 130  
**Address** 209 N. Crockett  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R8128](#)  
**Owner** SUMMERS, MICHAEL Z  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

302 N. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 805  
**Address** 302 N. Crockett  
**Date** 1960  
**Stylistic Influence** Ranch  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

118 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 811  
**Address** 118 S. Crockett  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R1711](#)  
**Owner** BECKMANN, ROY F & JANET ETAL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

118 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 412  
**Address** 118 S. Crockett  
**Date** 2000  
**Stylistic Influence**  
**GCAD Hyperlink** [R1711](#)  
**Owner** BECKMANN, ROY F & JANET ETAL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

202 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 812  
**Address** 202 S. Crockett  
**Date** 1935  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R13947](#)  
**Owner** DOVER, BARBARA A  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 813  
**Address** 204 S. Crockett  
**Date** 1898  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26907](#)  
**Owner** MESKILL, WILLIAM DANIEL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	281
Previous Ranking	1
Previous Photo References	
Roll	23
Frame	13

206 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 814  
**Address** 206 S. Crockett  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R22340](#)  
**Owner** PENICK, MICHAEL R ETAL % JIMMY PENICK  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

207 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 575  
**Address** 207 S. Crockett  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R1723](#)  
**Owner** BECKMANN, ROY F & JANET A  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

208 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 815  
**Address** 208 S. Crockett  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2137](#)  
**Owner** RANDOLPH, JANE KEESE & JEAN KEESE RENSFRO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Resource has a significant side addition.

### 1983 Historic Resources Survey

**Previous Site No.** 282  
**Previous Ranking** 2  
**Previous Photo References**

Roll 23  
 Frame 12

211 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 576  
**Address** 211 S. Crockett  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23054](#)  
**Owner** PENICK, ZOLA M  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Wunderlich-Fritz Home.  
 One room stone portion erected c. 1855. Two story wood-frame addition erected c. 1900. Windows openings on stone portion altered.

### 1983 Historic Resources Survey

**Previous Site No.** 283  
**Previous Ranking** 3  
**Previous Photo References**

Roll 29 29  
 Frame 33 34

212 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 816  
**Address** 212 S. Crockett  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26781](#)  
**Owner** ROACH, JOSEPH E & JOANN C  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 284  
**Previous Ranking** 1  
**Previous Photo References**

Roll 23 23  
 Frame 10 11

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

214 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 817  
**Address** 214 S. Crockett  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R24162](#)  
**Owner** HEIMANN, ERNO MRS -LOUISE-  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

304 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 818  
**Address** 304 S. Crockett  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

305 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 577  
**Address** 305 S. Crockett  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Exterior walls reclad w/asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 S. Crockett



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 578  
**Address** 307 S. Crockett  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

108 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 786  
**Address** 108 N. Edison  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17126](#)  
**Owner** SENKBEIL, MARIE D  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	786
Previous Ranking	2
Previous Photo References	
Roll	1
Frame	32

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

110 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 785  
**Address** 110 N. Edison  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25961](#)  
**Owner** MALDONADO, CYNTHIA E ET AL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	289
Previous Ranking	2
Previous Photo References	
Roll	22 22
Frame	34 35

112 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 784  
**Address** 112 N. Edison  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24289](#)  
**Owner** MALDONADO, CYNTHIA E ET AL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	290
Previous Ranking	2
Previous Photo References	
Roll	22
Frame	33

206 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 783  
**Address** 206 N. Edison  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R13364](#)  
**Owner** WEHMEYER, ROBERT M & JULI L  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes Original porch posts replaced and carport attached.

1983 Historic Resources Survey	
Previous Site No.	783
Previous Ranking	2
Previous Photo References	
Roll	
Frame	

207 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 539  
**Address** 207 N. Edison  
**Date** 1995  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R67270](#)  
**Owner** DUNCAN, CHARLES A & ELLEN  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

208 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 782  
**Address** 208 N. Edison  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R22213](#)  
**Owner** MEIER, CARLOS A  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	782
Previous Ranking	2
Previous Photo References	
Roll	31
Frame	17

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

210 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 781  
**Address** 210 N. Edison  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R1678](#)  
**Owner** DUNNEGAN, PATRICK TED  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	781
Previous Ranking	3
Previous Photo References	
Roll	1
Frame	30

211 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 538  
**Address** 211 N. Edison  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R25177](#)  
**Owner** DANZ, ARTHUR A & MARY A  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

301 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 8  
**Address** 301 N. Edison  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R19755](#)  
**Owner** TATSCH, CURTIS WAYNE  
**Historic District** No Outside Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes

Original exterior materials covered w/asbestos shingles and original porch posts replaced w/metal poles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

304 N. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 780  
**Address** 304 N. Edison  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

104 S. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 787  
**Address** 104 S. Edison  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R2532](#)  
**Owner** FROST, RICHARD N  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	787
Previous Ranking	3
Previous Photo References	
Roll	1
Frame	33

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

105 S. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 540  
**Address** 105 S. Edison  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23544](#)  
**Owner** MCLERRAN, JERRILYN B ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Fuhrmann-Ochs Home.  
 Original, c. 1855 portion is a single-pen log cabin. Stone portion added c. 1870. Front façade windows infilled, asbestos shingles added. Garage attached to c. 1920 portion of house.

1983 Historic Resources Survey			
Previous Site No.	293		
Previous Ranking	2		
Previous Photo References			
Roll	29	29	29
Frame	12	13	14

106 S. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 788  
**Address** 106 S. Edison  
**Date** 1930  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R51944](#)  
**Owner** GREATER LIFE CHRISTIAN CENTER OF FREDBG INC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	294		
Previous Ranking	3		
Previous Photo References			
Roll	22		
Frame	36		

107 S. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 541  
**Address** 107 S. Edison  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

204 S. Edison



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 789  
**Address** 204 S. Edison  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R19889](#)  
**Owner** COMFORT, PROPERTIES LLP  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

205 S. Edison



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 542  
**Address** 205 S. Edison  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R27611](#)  
**Owner** TREIBS, OPAL -LIFE ESTATE- D/O KENNETH W TREIBS ETAL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls re clad with synthetic siding and all original windows replaced w/aluminum sash units. Also wing added to north façade c. 1970.

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

207 S. Edison



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 543  
**Address** 207 S. Edison  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R24557](#)  
**Owner** PYKA, ROBERT V ET AL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls re clad with asbestos shingles and stone veneer and original porch posts replaced with metal columns.

**1983 Historic Resources Survey**

**Previous Site No.** 295  
**Previous Ranking** 4  
**Previous Photo References**

Roll 29  
 Frame 16

208 S. Edison



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 790  
**Address** 208 S. Edison  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

308 S. Edison



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 791  
**Address** 308 S. Edison  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R25819](#)  
**Owner** SCHMIDT, THERESA M -LIFE ESTATE- D/O ROBERT ALLAN SCHMIDT ETAL  
**Historic District** No Outside Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

104 N. Elk



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 839  
**Address** 104 N. Elk  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

104 S. Elk



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 840  
**Address** 104 S. Elk  
**Date** 1880  
**Stylistic Influence**  
**GCAD Hyperlink** [R34422](#)  
**Owner** BLUEBIRD LTD  
**Historic District** Yes Historic District  
**Assessment**

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>297</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>24</u>
Frame	<u>7</u>

106 S. Elk



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 841  
**Address** 106 S. Elk  
**Date** 1920  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

107 S. Elk



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 616  
**Address** 107 S. Elk  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2547](#)  
**Owner** FREDBG ENTERPRISES INC %KOTHE, KENNETH  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>298</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>10 10</u>
Frame	<u>3 4</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 ? S. Elk



2002 Re-evaluation

High  Medium  Low

Site ID No. 842  
 Address 108 ? S. Elk  
 Date \_\_\_\_\_  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R28866](#)  
 Owner BLUEBIRD LTD  
 Historic District Yes Historic District  
 Assessment Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>299</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>24</u>
Frame	<u>6</u>

710 Elite



2002 Re-evaluation

High  Medium  Low

Site ID No. 912  
 Address 710 Elite  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Local Landmark  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>296</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>12</u>
Frame	<u>29</u>

401 Fulton



2002 Re-evaluation

High  Medium  Low

Site ID No. 915  
 Address 401 Fulton  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R32643](#)  
 Owner PERRY-HUGHES, PENNY & GERALD HUGHES  
 Historic District No Local Landmark  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>308</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>6</u>
Frame	<u>9</u>

205 Goehmann



2002 Re-evaluation

High  Medium  Low

Site ID No. 962  
 Address 205 Goehmann  
 Date 1900  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R1250](#)  
 Owner PURSCH, WOODY M & BETTY A  
 Historic District No Local Landmark  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Historic outbuilding.

1983 Historic Resources Survey	
Previous Site No.	<u>312</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>22</u>
Frame	<u>37</u>

510 Granite



2002 Re-evaluation

High  Medium  Low

Site ID No. 905  
 Address 510 Granite  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Local Landmark  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>315</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>12 12 12</u>
Frame	<u>12 13 14</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

101 E. Hackberry



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 955  
**Address** 101 E. Hackberry  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26975](#)  
**Owner** LAWFORD, DAVID L & DILYSE  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** RTHL. Rear addition and 3-car garage.

1983 Historic Resources Survey	
Previous Site No.	316
Previous Ranking	2
Previous Photo References	
Roll	5
Frame	11

112 E. Highway



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 913  
**Address** 112 E. Highway  
**Date** 1905  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R32060](#)  
**Owner** NEANS, TERRY D & NANCY E  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	331
Previous Ranking	2
Previous Photo References	
Roll	12 12
Frame	33 34

302 N. Kay



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 959  
**Address** 302 N. Kay  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1264](#)  
**Owner** ANNIS, FRANCES PATRICIA  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	337
Previous Ranking	2
Previous Photo References	
Roll	9
Frame	26

Lady Bird Johnson Park



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 921  
**Address** Lady Bird Johnson Park  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	339
Previous Ranking	2
Previous Photo References	
Roll	31 31 31
Frame	2 3 4

101 N. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 608  
**Address** 101 N. Lincoln  
**Date** 1901  
**Stylistic Influence** Victorian Italianate; Craftsman  
**GCAD Hyperlink** [R27189](#)  
**Owner** STROEHER, ROY E ETAL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Front door has a stone lintel that is inscribed "Otto Kolmeier 1901." Rear porch enclosed c. 1950. Resource has a small rear shed-roof addition w/ asbestos shingle exteriors.

1983 Historic Resources Survey	
Previous Site No.	341
Previous Ranking	1
Previous Photo References	
Roll	24 30 30
Frame	3 25 26

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

102 ? N. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 830  
**Address** 102 ? N. Lincoln  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	342
Previous Ranking	4
Previous Photo References	
Roll	24
Frame	4

108 N. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 175  
**Address** 108 N. Lincoln  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R18163](#)  
**Owner** HENKE, FAY MRS C/O B GRAMS  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	343
Previous Ranking	3
Previous Photo References	
Roll	
Frame	

106 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 831  
**Address** 106 S. Lincoln  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20927](#)  
**Owner** COHN, RONALD S  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes Resource is a Recorded Texas Historic Landmark.

1983 Historic Resources Survey	
Previous Site No.	344
Previous Ranking	1
Previous Photo References	
Roll	23
Frame	36

107 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 610  
**Address** 107 S. Lincoln  
**Date** 1901  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22046](#)  
**Owner** FELL, CURTIS D & ANDREA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes Rausch Home. Property is a Recorded Texas Historic Landmark.

1983 Historic Resources Survey	
Previous Site No.	345
Previous Ranking	1
Previous Photo References	
Roll	30 30 30
Frame	28 29 30

108 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 421  
**Address** 108 S. Lincoln  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18070](#)  
**Owner** HEINEN, MAYNIE C  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

111 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 611  
**Address** 111 S. Lincoln  
**Date** 1949  
**Stylistic Influence**  
**GCAD Hyperlink** [R19676](#)  
**Owner** KEIDEL, FAMILY TRUST %EMILY KEIDEL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Primary entrance like a recent addition.

1983 Historic Resources Survey	
Previous Site No.	346
Previous Ranking	4
Previous Photo References	
Roll	30
Frame	31

203 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 897  
**Address** 203 S. Lincoln  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Rear shed-roof addition constructed circa 1950.

1983 Historic Resources Survey	
Previous Site No.	347
Previous Ranking	3
Previous Photo References	
Roll	13
Frame	19

204 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 891  
**Address** 204 S. Lincoln  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R17591](#)  
**Owner** WALSH, JERRY B  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

206 S. Lincoln



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 892  
**Address** 206 S. Lincoln  
**Date** 1910  
**Stylistic Influence** vernacular: Queen Anne  
**GCAD Hyperlink** [R25791](#)  
**Owner** IRWINE, JAMES E & JANET C  
**Historic District** Yes Extension of Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

305 S. Lincoln



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 895  
**Address** 305 S. Lincoln  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R29015](#)  
**Owner** WOERNER WAREHOUSE INC % WOERNER, BRUCE  
**Historic District** Yes Extension of Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

305 S. Lincoln



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 896  
**Address** 305 S. Lincoln  
**Date** 1935  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R29014](#)  
**Owner** WOERNER WAREHOUSE INC % WOERNER, BRUCE  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Primary entries are overhead metal doors.

1983 Historic Resources Survey	
Previous Site No.	349
Previous Ranking	3
Previous Photo References	
Roll	13
Frame	21

306 S. Lincoln



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 894  
**Address** 306 S. Lincoln  
**Date** 1930  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R22791](#)  
**Owner** OEHLER, HERBERT A  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	350
Previous Ranking	4
Previous Photo References	
Roll	15
Frame	27

200 Block N. Llano



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 37  
**Address** 200 Block N. Llano  
**Date** 1949  
**Stylistic Influence** Art Deco (picket hand rail)  
**GCAD Hyperlink** \_\_\_\_\_  
**Owner** \_\_\_\_\_  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common bridge type.

**Notes** Resources is a bridge over Town creek on the 200 block of North Llano.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

103 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 602  
**Address** 103 N. Llano  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R29128](#)  
**Owner** CARTER, ROBERT BARRET FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Sanborn maps depict a building w/the same footprint on this lot in 1924 (resource may have been built earlier than 1970).

### 1983 Historic Resources Survey

Previous Site No. 359  
 Previous Ranking 4  
 Previous Photo References

Roll 30  
 Frame 24

105 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 601  
**Address** 105 N. Llano  
**Date** 1885  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24294](#)  
**Owner** CARTER, CHERYLL B & ROBERT BARRETT  
 CARTER FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone minor alterations.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 360  
 Previous Ranking 3  
 Previous Photo References

Roll 25 25  
 Frame 24 25

107 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 600  
**Address** 107 N. Llano  
**Date** 1995  
**Stylistic Influence**  
**GCAD Hyperlink** [R69268](#)  
**Owner** CARTER, CHERYLL B & ROBERT BARRETT  
 CARTER FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

109 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 599  
**Address** 109 N. Llano  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R30172](#)  
**Owner** JENSCHKE, RUBIN G & RUBY J LIVING TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 361  
 Previous Ranking 4  
 Previous Photo References

Roll 25 25  
 Frame 22 23

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

201 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 598  
**Address** 201 N. Llano  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a rear concrete block addition. It is also attached to 203 A N. Llano by a 2-story c. 1980 wing.

### 1983 Historic Resources Survey

**Previous Site No.** 362  
**Previous Ranking** 2  
**Previous Photo References**  
 Roll 25 25 25  
 Frame 19 20 21

202 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 35  
**Address** 202 N. Llano  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has historic rear additions.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

203 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 596  
**Address** 203 N. Llano  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R25511](#)  
**Owner** DEMATERNE, BLANCA SANCHEZ-NAVARRO  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority. Resource has undergone alterations.

**Notes** Carport attaches this resource to 203A N. Llano.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

203 A N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 597  
**Address** 203 A N. Llano  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25511](#)  
**Owner** DEMATERNE, BLANCA SANCHEZ-NAVARRO  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Some windows boarded-up w/plywood, plywood siding added to front facade, fixed panel, original front façade windows replaced. Also a 2-story stucco wing erected c. 1980 attaches resource to 201 N. Llano.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

304 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 825  
**Address** 304 N. Llano  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R8123](#)  
**Owner** TEAGUE INVESTMENTS  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

305 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 595  
**Address** 305 N. Llano  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R29014](#)  
**Owner** WOERNER WAREHOUSE INC  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	363
Previous Ranking	3
Previous Photo References	
Roll	14
Frame	29

308 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 824  
**Address** 308 N. Llano  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R18208](#)  
**Owner** FRITZ, FAMILY ENTERPRIZES LIMITED PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

408 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 956  
**Address** 408 N. Llano  
**Date** 1900  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R17519](#)  
**Owner** ANDERSON, PHILLIP  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Brick veneer applied over original exterior; historic rear addition; historic garage.

1983 Historic Resources Survey	
Previous Site No.	364
Previous Ranking	2
Previous Photo References	
Roll	14
Frame	8

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

413 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 928  
**Address** 413 N. Llano  
**Date** 1902  
**Stylistic Influence** vernacular: Classical Revival  
**GCAD Hyperlink** [R22162](#)  
**Owner** CLARK, JOE R & BETTY N  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes

1983 Historic Resources Survey			
Previous Site No.	365		
Previous Ranking	1		
Previous Photo References			
Roll	14	14	14
Frame	27	28	29

501 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 929  
**Address** 501 N. Llano  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20553](#)  
**Owner** SEGNER, EWALD H  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey			
Previous Site No.	366		
Previous Ranking	2		
Previous Photo References			
Roll	14		
Frame	26		

502 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 957  
**Address** 502 N. Llano  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20511](#)  
**Owner** BASSE DOROTHY A &  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey			
Previous Site No.	367		
Previous Ranking	2		
Previous Photo References			
Roll	14		
Frame	9		

Brick veneer applied over original exterior; historic double garage, historic cistern building, historic metal windmill.

609 N. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 931  
**Address** 609 N. Llano  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22492](#)  
**Owner** KUNZ, KENNETH A ETUX  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes

1983 Historic Resources Survey			
Previous Site No.	370		
Previous Ranking	1		
Previous Photo References			
Roll	14	14	14
Frame	22	23	24

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

711 N. Llano



**Site ID No.** 932  
**Address** 711 N. Llano  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2433](#)  
**Owner** TIME WARNER  
 ENTERTAINMENT ADVANCE/NEWHOUSE  
 PARTNERSHIP  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

1983 Historic Resources Survey			
Previous Site No.	371		
Previous Ranking	1		
Previous Photo References			
Roll	14	14	14
Frame	18	19	20

**2002 Re-evaluation**

High  Medium  Low

**Notes**

103 S. Llano



**Site ID No.** 603  
**Address** 103 S. Llano  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R65447](#)  
**Owner** GUTTERY, BETTY REVOCABLE LIVING TRUST  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

1983 Historic Resources Survey			
Previous Site No.	376		
Previous Ranking	2		
Previous Photo References			
Roll	30	30	
Frame	18	19	

**2002 Re-evaluation**

High  Medium  Low

**Notes** Former tin shop. Excellent example of its type

105 S. Llano



**Site ID No.** 604  
**Address** 105 S. Llano  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R25640](#)  
**Owner** LAVENDER, ROXANNE G  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

1983 Historic Resources Survey			
Previous Site No.	377		
Previous Ranking	2		
Previous Photo References			
Roll	30		
Frame	20		

**2002 Re-evaluation**

High  Medium  Low

**Notes** Former tin shop. A carport has been attached to the south façade.

107 S. Llano



**Site ID No.** 605  
**Address** 107 S. Llano  
**Date** 1892  
**Stylistic Influence**  
**GCAD Hyperlink** [R27793](#)  
**Owner** JOHNSON-CHILCOTE, JUDY REVOCABLE  
 LIVING TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

1983 Historic Resources Survey			
Previous Site No.	378		
Previous Ranking	3		
Previous Photo References			
Roll	30	30	30
Frame	21	22	23

**2002 Re-evaluation**

High  Medium  Low

**Notes** Stoffers-Lochte Home. Resource is a former dwelling that has been converted to commercial use with the addition of a significant flat-roof storefront entrance in 1959. Despite alterations, the dwelling's historic core remains intact.

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

109 S. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 606  
**Address** 109 S. Llano  
**Date** 1975  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

112 S. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 827  
**Address** 112 S. Llano  
**Date** 1920  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R2640](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Brick exteriors are an historic alteration.

1983 Historic Resources Survey	
Previous Site No.	379
Previous Ranking	4
Previous Photo References	
Roll	23
Frame	34

208 S. Llano



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 829  
**Address** 208 S. Llano  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27181](#)  
**Owner** WAGNER, BARRY ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has non-historic rear additions.

1983 Historic Resources Survey	
Previous Site No.	380
Previous Ranking	2
Previous Photo References	
Roll	23 23 21
Frame	31 32 33

101 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 268  
**Address** 101 E. Main  
**Date** 1874  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24003](#)  
**Owner** PENICK, JIMMY R ETAL D/B/A M/J INV  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	382
Previous Ranking	2
Previous Photo References	
Roll	17 17
Frame	25 26

102 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 366  
**Address** 102 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R16605](#)  
**Owner** SCULLY, DANIEL J III & ELAINE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Front façade transom windows covered w/plywood.

1983 Historic Resources Survey	
Previous Site No.	383
Previous Ranking	3
Previous Photo References	
Roll	34
Frame	17

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

106 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 367  
**Address** 106 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R16605](#)  
**Owner** SCULLY, DANIEL J III & ELAINE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Front façade transom windows covered w/plywood.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

107 -109 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 269  
**Address** 107 -109 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R16073](#)  
**Owner** HELLUMS, JESSE M  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	384
Previous Ranking	2
Previous Photo References	
Roll	17
Frame	24

110 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 368  
**Address** 110 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

112 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 632  
**Address** 112 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls re clad and original primary entrance and front façade windows replaced.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

113 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 270  
**Address** 113 E. Main  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R24137](#)  
**Owner** PETMECKY, FREDERICK J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

114 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 369  
**Address** 114 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R33894](#)  
**Owner** BIERSCHWALE, CALVIN J TESTAMENTARY TRUST  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

115 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 271  
**Address** 115 E. Main  
**Date** 1916  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R13767](#)  
**Owner** DURST, VALERIE B FRISBIE  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** 385  
**Previous Ranking** 2  
**Previous Photo References**

Roll 17  
 Frame 23

116 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 370  
**Address** 116 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R20723](#)  
**Owner** KOWERT, JOSIE RESIDUARY TRUST % O J KOWERT  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

**1983 Historic Resources Survey**

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

118 -120 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 371  
**Address** 118 -120 E. Main  
**Date** 1898  
**Stylistic Influence** Romanesque  
**GCAD Hyperlink** [R20707](#)  
**Owner** KOWERT, JOSIE RESIDUARY TRUST % O J KOWERT  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

Bank of Fredericksburg Building. Front façade transom windows covered with plywood panels. Individually listed in the NRHP. Designed by renown architect Alfred Giles.

**1983 Historic Resources Survey**

**Previous Site No.** 387  
**Previous Ranking** 1  
**Previous Photo References**

Roll 34 34  
 Frame 19 21

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

119 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 272  
**Address** 119 E. Main  
**Date** 1936  
**Stylistic Influence** Moderne  
**GCAD Hyperlink** [R14482](#)  
**Owner** WOELLHOF, RONALD L  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

### 1983 Historic Resources Survey

Previous Site No. 386  
 Previous Ranking 3  
 Previous Photo References

Roll 17  
 Frame 22

121 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 273  
**Address** 121 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R25551](#)  
**Owner** YTURRIA, FAUSTO JR ETAL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes

### 1983 Historic Resources Survey

Previous Site No. 388  
 Previous Ranking 3  
 Previous Photo References

Roll 17  
 Frame 21

122 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 372  
**Address** 122 E. Main  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R65008](#)  
**Owner** KOWERT EXCHANGE & REAL ESTATE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

123 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 274  
**Address** 123 E. Main  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26007](#)  
**Owner** SCHNEIDER, DAVID D ETAL %O W SCHNEIDER CHILDREN'S PRTNR  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. 389  
 Previous Ranking 1  
 Previous Photo References

Roll 17 17  
 Frame 19 20

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

124 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 373  
**Address** 124 E. Main  
**Date** 1905  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27138](#)  
**Owner** RIVERA, SUZAN TYNG  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Old Central Drugstore

1983 Historic Resources Survey	
Previous Site No.	390
Previous Ranking	2
Previous Photo References	
Roll	34
Frame	20

127 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 275  
**Address** 127 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R26007](#)  
**Owner** SCHNEIDER, DAVID D ETAL %O W SCHNEIDER CHILDREN'S PRTNR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	392
Previous Ranking	4
Previous Photo References	
Roll	17
Frame	18

128 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 374  
**Address** 128 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R28048](#)  
**Owner** DORER, RICHARD L JR ETAL % RICHARD L DORER SR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Metal porch added to front facade, original front façade window and door replaced with aluminum frame units.

1983 Historic Resources Survey	
Previous Site No.	391
Previous Ranking	2
Previous Photo References	
Roll	35
Frame	1

131 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 276  
**Address** 131 E. Main  
**Date** 1914  
**Stylistic Influence**  
**GCAD Hyperlink** [R15299](#)  
**Owner** 7D ENTERPRISES LTD  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	393
Previous Ranking	3
Previous Photo References	
Roll	17
Frame	17

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

132 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 375  
**Address** 132 E. Main  
**Date** 1916  
**Stylistic Influence**  
**GCAD Hyperlink** [R19272](#)  
**Owner** ONE THIRTY TWO MAIN TRUST  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

138 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 376  
**Address** 138 E. Main  
**Date** 1910  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R13429](#)  
**Owner** BRUNS, ALTON & FLORINE  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Metal awning added to front façade, stucco added to front façade exterior walls.

1983 Historic Resources Survey	
Previous Site No.	<u>394</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>35</u>
Frame	<u>2</u>

141 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 277  
**Address** 141 E. Main  
**Date** 1889  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R15536](#)  
**Owner** PENICK, MICHAEL R ETUX  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>395</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>17</u>
Frame	<u>16</u>

142 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 377  
**Address** 142 E. Main  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R13429](#)  
**Owner** MADDUX, RONALD, EL AL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Metal awning added to front façade, stucco and permastone added to front façade exterior walls, and original storefront replaced with aluminum frame storefront.

1983 Historic Resources Survey	
Previous Site No.	<u>396</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	_____
Frame	_____

143 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 278  
**Address** 143 E. Main  
**Date** 1910  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R15531](#)  
**Owner** MOLBERG, MAXINE ETAL  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>397</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>17</u>
Frame	<u>15</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

145 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 279  
**Address** 145 E. Main  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R15529](#)  
**Owner** HERBER, CLINTON C & ELLA MAE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

146 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 378  
**Address** 146 E. Main  
**Date** 1935  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink** [R16793](#)  
**Owner** SCULLY, DANIEL J III & ELAINE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Former Palace Theatre.

1983 Historic Resources Survey	
Previous Site No.	398
Previous Ranking	3
Previous Photo References	
Roll	35
Frame	3

147 -149 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 280  
**Address** 147 -149 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R15531](#)  
**Owner** MOLBERG, MAXINE ETAL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	399
Previous Ranking	4
Previous Photo References	
Roll	17
Frame	14

150 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 826  
**Address** 150 E. Main  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R2477](#)  
**Owner** BANK ONE TEXAS N A ONE NORTH  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

150 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 379  
**Address** 150 E. Main  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R2477](#)  
**Owner** BANK ONE TEXAS N A  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

151 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 281  
**Address** 151 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R27460](#)  
**Owner** LANGERHANS, JIMMIE R & LINDA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	400
Previous Ranking	4
Previous Photo References	
Roll	17
Frame	13

153 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 282  
**Address** 153 E. Main  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R26671](#)  
**Owner** ZEOS SPORTING GOODS  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

155 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 283  
**Address** 155 E. Main  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R16675](#)  
**Owner** HELLUMS, JESSE M  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

201 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 284  
**Address** 201 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R24846](#)  
**Owner** REES, FOREST J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	401
Previous Ranking	4
Previous Photo References	
Roll	17
Frame	12

203 -207 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 285  
**Address** 203 -207 E. Main  
**Date** 1897  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R18464](#)  
**Owner** GODFREY, JONATHAN F & SHARLA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes Recorded Texas Historic Landmark

1983 Historic Resources Survey	
Previous Site No.	403
Previous Ranking	2
Previous Photo References	
Roll	17 17
Frame	10 11

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

204 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 380  
**Address** 204 E. Main  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R1151](#)  
**Owner** NEILL, EMILIE R ETAL % RILEY OSBOURN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Plywood panels added to front façade exterior walls. Most original windows replaced.

1983 Historic Resources Survey	
Previous Site No.	402
Previous Ranking	3
Previous Photo References	
Roll	35
Frame	4

206 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 381  
**Address** 206 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R24279](#)  
**Owner** PERRY, J HARDIN JR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Non-historic brick veneer added to front façade. Original windows replaced w/aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	404
Previous Ranking	4
Previous Photo References	
Roll	35
Frame	5

209 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 286  
**Address** 209 E. Main  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

210 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 382  
**Address** 210 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Front façade reclad with on-historic brick veneer. Original windows replaced with aluminum frame units.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

212 -214 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 383  
**Address** 212 -214 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R20768](#)  
**Owner** PENICK, JIMMY R  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

217 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 287  
**Address** 217 E. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R23127](#)  
**Owner** DURST, SHERMAN D  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 405  
**Previous Ranking** 4  
**Previous Photo References**

Roll 17  
 Frame 9

218 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 384  
**Address** 218 E. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26995](#)  
**Owner** DIETZ, E DONALD ETUX  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a rear concrete block addition. Concrete covered with stucco and wood shingles added to front façade.

### 1983 Historic Resources Survey

**Previous Site No.** 473  
**Previous Ranking** 1  
**Previous Photo References**

Roll 32 32  
 Frame 14 15

221 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 288  
**Address** 221 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R25788](#)  
**Owner** HEINEN, BARBARA ETAL % JEFFERY D LAWRENCE  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 407  
**Previous Ranking** 2  
**Previous Photo References**

Roll 17  
 Frame 8

222 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 385  
**Address** 222 E. Main  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28087](#)  
**Owner** COOPER, DEBRA WYN  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Richter Building. Property is a RTHL. Bay window added to front façade.

### 1983 Historic Resources Survey

**Previous Site No.** 408  
**Previous Ranking** 1  
**Previous Photo References**

Roll 35  
 Frame 7

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

223 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 458  
**Address** 223 E. Main  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R15747](#)  
**Owner** BOLTON, CAROL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	409
Previous Ranking	3
Previous Photo References	
Roll	17
Frame	7

229 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 457  
**Address** 229 E. Main  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R55922](#)  
**Owner** KNOPP & METZGER INC  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	410
Previous Ranking	2
Previous Photo References	
Roll	17 17
Frame	5 6

230 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 386  
**Address** 230 E. Main  
**Date** 1915  
**Stylistic Influence**  
**GCAD Hyperlink** [R28086](#)  
**Owner** BOLTON, JOHN T & CAROL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Resource has a side shed-roof addition.

1983 Historic Resources Survey	
Previous Site No.	412
Previous Ranking	3
Previous Photo References	
Roll	35
Frame	8

231 -235 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 456  
**Address** 231 -235 E. Main  
**Date** 1911  
**Stylistic Influence**  
**GCAD Hyperlink** [R50838](#)  
**Owner** CONE, FAMILY TRUST % CONE, MARY LAUREN BADE TRUSTEE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	411
Previous Ranking	3
Previous Photo References	
Roll	17
Frame	4

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

239 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 455  
**Address** 239 E. Main  
**Date** 1985  
**Stylistic Influence**  
**GCAD Hyperlink** [R19986](#)  
**Owner** BILLUPS, FRANCES HEARD TRUSTEE %  
 BUSBY, DARLENE BOOKKEEPING  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	413
Previous Ranking	4
Previous Photo References	
Roll	17
Frame	29

242 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 388  
**Address** 242 E. Main  
**Date** 1888  
**Stylistic Influence**  
**GCAD Hyperlink** [R19660](#)  
**Owner** KEIDEL FAMILY GENERAL PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** White Elephant Saloon. Has historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	415
Previous Ranking	1
Previous Photo References	
Roll	35
Frame	9

242 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 387  
**Address** 242 E. Main  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R19660](#)  
**Owner** KEIDEL FAMILY GENERAL PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

**Notes** Property is an empty lot associated with the building at 242 E. Main Street

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

245 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 454  
**Address** 245 E. Main  
**Date** 1926  
**Stylistic Influence**  
**GCAD Hyperlink** [R23674](#)  
**Owner** ESTENSON, RICHARD A & ROSEMARY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	414
Previous Ranking	3
Previous Photo References	
Roll	17
Frame	30

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

247 E. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 453  
 Address 247 E. Main  
 Date 1866  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Property contributes significantly to local history or broader historical patterns.

Notes

### 1983 Historic Resources Survey

Previous Site No. 417  
 Previous Ranking 1  
 Previous Photo References

Roll 17 17 17  
 Frame 31 32 34

248 E. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 389  
 Address 248 E. Main  
 Date 1909  
 Stylistic Influence  
 GCAD Hyperlink [R28745](#)  
 Owner WEBER, SAMUEL K & PATRICIA  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Keidel Drug Store. Resource is Gillespie County's first medical building. Original porch replaced.

### 1983 Historic Resources Survey

Previous Site No. 416  
 Previous Ranking 1  
 Previous Photo References

Roll 35  
 Frame 10

249 A/B E. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 452  
 Address 249 A/B E. Main  
 Date 1910  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. 418  
 Previous Ranking 3  
 Previous Photo References

Roll 17  
 Frame 33

249 C E. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 451  
 Address 249 C E. Main  
 Date 1995  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

252 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 390  
**Address** 252 E. Main  
**Date** 1860  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R19667](#)  
**Owner** BONNELL, MARGARET E -LIFE EST- D/O KEIDEL FAMILY GENERAL PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.  
**Notes** Keidel House.

1983 Historic Resources Survey	
Previous Site No.	419
Previous Ranking	2
Previous Photo References	
Roll	35
Frame	11

254 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 391  
**Address** 254 E. Main  
**Date** 1867  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2328](#)  
**Owner** LUNGKWITZ, INC  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes** Lungkwitz Home.

1983 Historic Resources Survey	
Previous Site No.	420
Previous Ranking	1
Previous Photo References	
Roll	35
Frame	12

258 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 392  
**Address** 258 E. Main  
**Date** 1883  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink** [R19671](#)  
**Owner** PERIHUEZ INVESTMENTS  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.  
**Notes** Priess Building-Keidel Clinic. Original portion of building was erected in 1883. The resource underwent an extensive renovation in 1938.

1983 Historic Resources Survey	
Previous Site No.	421
Previous Ranking	3
Previous Photo References	
Roll	35
Frame	13

302 E. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 393  
**Address** 302 E. Main  
**Date** 1896  
**Stylistic Influence**  
**GCAD Hyperlink** [R20516](#)  
**Owner** ENGEL, JANINE STROEHER ETAL % STROEHER, MARK  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes** "Otto Kolmeyer 1896" is inscribed in the building's parapet.

1983 Historic Resources Survey	
Previous Site No.	422
Previous Ranking	2
Previous Photo References	
Roll	35
Frame	14

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

306 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 394  
**Address** 306 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 450  
**Address** 307 E. Main  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18447](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 (rear) E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 637  
**Address** 307 (rear) E. Main  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18447](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Building is a shop building to the rear of 307 E. Main (see site ID# 450).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 (rear) E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 646  
**Address** 307 (rear) E. Main  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18447](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Primary entrance is a metal horizontal sliding door.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 609  
**Address** 307 E. Main  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R18447](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes** Primary entrance is a metal horizontal sliding door.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

310 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 395  
**Address** 310 E. Main  
**Date** 1908  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R16416](#)  
**Owner** WATSON, DEANE JR & ROBERT R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Robert G. Striegler Home

### 1983 Historic Resources Survey

**Previous Site No.** 423  
**Previous Ranking** 2  
**Previous Photo References**

Roll 35  
 Frame 15

312 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 396  
**Address** 312 E. Main  
**Date** 1876  
**Stylistic Influence** Second Empire  
**GCAD Hyperlink** [R16420](#)  
**Owner** PORTER, FAMILY TRUST % RICHARD & ELIZABETH PORTER  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Wahrmond Store-Bakery Building. Property is a Recorded Texas Historic Landmark.

### 1983 Historic Resources Survey

**Previous Site No.** 424  
**Previous Ranking** 1  
**Previous Photo References**

Roll 35  
 Frame 16

314 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 397  
**Address** 314 E. Main  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R77234](#)  
**Owner** STRICKLAND, JAMES E JR & DONNA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

315 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 449  
**Address** 315 E. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18285](#)  
**Owner** CRENWELGE, MILTON M & MICKEY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 425  
**Previous Ranking** 3  
**Previous Photo References**

Roll 34  
 Frame 16

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

319 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 448  
**Address** 319 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R25916](#)  
**Owner** SCHMIDT, HERBERT  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has an historic shed-roof side addition. Former living quarters to the rear of building.

1983 Historic Resources Survey	
Previous Site No.	426
Previous Ranking	3
Previous Photo References	
Roll	34
Frame	15

320 -322 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 398  
**Address** 320 -322 E. Main  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R26831](#)  
**Owner** BROWN, LARRY D & BARBARA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Front façade transom windows infilled and porch added to west façade.

1983 Historic Resources Survey	
Previous Site No.	427
Previous Ranking	4
Previous Photo References	
Roll	35
Frame	17

321 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 447  
**Address** 321 E. Main  
**Date** 1985  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

323 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 446  
**Address** 323 E. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R1987](#)  
**Owner** ALT, THOMAS E & ALETHIA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls partially re clad with stone veneer, east façade stucco portion added c.1985, balustrade added to awning, some original windows and original primary entrance covered with stone veneer.

1983 Historic Resources Survey	
Previous Site No.	429
Previous Ranking	4
Previous Photo References	
Roll	34
Frame	14

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

324 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 399  
**Address** 324 E. Main  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R29699](#)  
**Owner** HOHENBERGER, PALMER  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Maier-Alberthal Building. Property is an Recorded Texas Historic Landmark.

### 1983 Historic Resources Survey

**Previous Site No.** 428  
**Previous Ranking** 3  
**Previous Photo References**

Roll -----  
 Frame -----

326 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 400  
**Address** 326 E. Main  
**Date** 1995  
**Stylistic Influence**  
**GCAD Hyperlink** [R23046](#)  
**Owner** ENGEL, ARMIN W JR  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll -----  
 Frame -----

327 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 445  
**Address** 327 E. Main  
**Date** 1870  
**Stylistic Influence**  
**GCAD Hyperlink** [R25615](#)  
**Owner** GRIER, CHARLES W & MARJORIE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Schaeffer Building. Portion in the rear was originally used as a home. Front commercial portion was erected sometime before 1904.

### 1983 Historic Resources Survey

**Previous Site No.** 430  
**Previous Ranking** 2  
**Previous Photo References**

Roll 34 -----  
 Frame 13 -----

327 1/2 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 444  
**Address** 327 1/2 E. Main  
**Date** 1995  
**Stylistic Influence**  
**GCAD Hyperlink** [R25615](#)  
**Owner** GRIER, CHARLES W & MARJORIE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll -----  
 Frame -----

328 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 402  
**Address** 328 E. Main  
**Date** 1855  
**Stylistic Influence**  
**GCAD Hyperlink** [R2625](#)  
**Owner** NIMITZ, CHESTER MUSEUM  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Nimitz Hotel. Steamboat shaped roof added c. 1980.

### 1983 Historic Resources Survey

**Previous Site No.** 434  
**Previous Ranking** 3  
**Previous Photo References**

Roll 35 35 -----  
 Frame 19 20 -----

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

328 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 401  
**Address** 328 E. Main  
**Date** 1874  
**Stylistic Influence**  
**GCAD Hyperlink** [R2625](#)  
**Owner** NIMITZ, CHESTER MUSEUM  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Nauwald House. Porch added c. 1985.

1983 Historic Resources Survey	
Previous Site No.	431
Previous Ranking	3
Previous Photo References	
Roll	35
Frame	18

328 (rear) E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 835  
**Address** 328 (rear) E. Main  
**Date** 1930  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2625](#)  
**Owner** NIMITZ, CHESTER MUSEUM  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource is a barn to the rear of the Nimitz Museum (Site ID # 402)

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

329 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 443  
**Address** 329 E. Main  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16238](#)  
**Owner** FELLER, MIGNON KELLER ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a rear concrete block addition.

1983 Historic Resources Survey	
Previous Site No.	432
Previous Ranking	2
Previous Photo References	
Roll	34
Frame	12

333 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 442  
**Address** 333 E. Main  
**Date** 1995  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

339 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 441  
**Address** 339 E. Main  
**Date** 1880  
**Stylistic Influence**  
**GCAD Hyperlink** [R18840](#)  
**Owner** HOWARD, GERALD E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Weyrich-Howard Building. Original porch replaced. Stone and concrete added to front façade.

1983 Historic Resources Survey	
Previous Site No.	433
Previous Ranking	3
Previous Photo References	
Roll	34
Frame	11

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

340 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 177  
**Address** 340 E. Main  
**Date** 1999  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	434
Previous Ranking	3
Previous Photo References	
Roll	35 35
Frame	19 20

341 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 836  
**Address** 341 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R13730](#)  
**Owner** SMITH, EDWIN V & SHIRLEY M FAMILY LIMITED PARTNERSHIP #1  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

401 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 440  
**Address** 401 E. Main  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R17101](#)  
**Owner** GIVIGLIANO, RUTH KEIDEL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

402 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 403  
**Address** 402 E. Main  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R26996](#)  
**Owner** ATWELL, RICHARD A  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes Resource is an empty lot at the northeast corner of E. Main & N. Washington

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

403 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 439  
**Address** 403 E. Main  
**Date** 1930  
**Stylistic Influence** Spanish Colonial  
**GCAD Hyperlink** [R25891](#)  
**Owner** HEINEN, BARBARA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** House has a small house to the rear (see site ID# 636).

1983 Historic Resources Survey	
Previous Site No.	435
Previous Ranking	4
Previous Photo References	
Roll	34
Frame	10

403 (rear) E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 636  
**Address** 403 (rear) E. Main  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R25893](#)  
**Owner** HEINEN, BARBARA  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes** House is located to the rear of 403 E. Main (see site ID# 439).

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

405 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 438  
**Address** 405 E. Main  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18382](#)  
**Owner** MUNCEY, SUSAN WEINBERG  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Frederich Kiehne Home. Property is a Recorded Texas Historic Landmark and was documented by HABS (Historic American Building Survey) in 1934. Has historic rear additions.

1983 Historic Resources Survey	
Previous Site No.	436
Previous Ranking	1
Previous Photo References	
Roll	34 34 34
Frame	7 8 9

406 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 404  
**Address** 406 E. Main  
**Date** 1970  
**Stylistic Influence** Ranch  
**GCAD Hyperlink** [R18026](#)  
**Owner** HEIN BROTHERS  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

409 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 437  
**Address** 409 E. Main  
**Date** 1957  
**Stylistic Influence**  
**GCAD Hyperlink** [R29326](#)  
**Owner** DITGES, KURT F  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

411 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 436  
**Address** 411 E. Main  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R20796](#)  
**Owner** LISTON, MICHAEL W & MARY J  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	437
Previous Ranking	3
Previous Photo References	
Roll	34
Frame	6

412 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 405  
**Address** 412 E. Main  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18039](#)  
**Owner** HEIN BROTHERS  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	438
Previous Ranking	1
Previous Photo References	
Roll	32
Frame	21

413 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 435  
**Address** 413 E. Main  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R20789](#)  
**Owner** CHUDE, JAMES W ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance.

Notes Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	439
Previous Ranking	3
Previous Photo References	
Roll	34
Frame	5

414 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 406  
**Address** 414 E. Main  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18039](#)  
**Owner** HEIN BROTHERS  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Property is a Recorded Texas Historic Landmark. Concrete block wing addressed as 412 E. Main has been attached to west façade.

1983 Historic Resources Survey	
Previous Site No.	438
Previous Ranking	1
Previous Photo References	
Roll	32
Frame	21

415 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 434  
**Address** 415 E. Main  
**Date** 1887  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R22700](#)  
**Owner** SALLE, KATHRYN & JACKIE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	440
Previous Ranking	2
Previous Photo References	
Roll	34
Frame	4

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

416 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 407  
**Address** 416 E. Main  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R21707](#)  
**Owner** HOMERSTAD, REBECCA L & HENRIETTE C HUMES  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

417 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 433  
**Address** 417 E. Main  
**Date** 1880  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R34423](#)  
**Owner** SALLE, KATHRYN & JACKIE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Ransleben-Moellering Home.

1983 Historic Resources Survey

Previous Site No. 441  
 Previous Ranking 3  
 Previous Photo References

Roll 34  
 Frame 3

418 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 408  
**Address** 418 E. Main  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21707](#)  
**Owner** HOMERSTAD, REBECCA L & HENRIETTE C HUMES  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Wing addressed as 416 E. Main added to west façade.

1983 Historic Resources Survey

Previous Site No. 442  
 Previous Ranking 3  
 Previous Photo References

Roll 32  
 Frame 22

421 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 431  
**Address** 421 E. Main  
**Date** 1995  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R28012](#)  
**Owner** BLUEBIRD LTD  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. 443  
 Previous Ranking 4  
 Previous Photo References

Roll 34  
 Frame 2

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

423 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 430  
**Address** 423 E. Main  
**Date** 1995  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R69243](#)  
**Owner** BLUEBIRD LTD  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

424 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 409  
**Address** 424 E. Main  
**Date** 1853  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original full width porch replaced. Has rear additions.

1983 Historic Resources Survey	
Previous Site No.	444
Previous Ranking	2
Previous Photo References	
Roll	32 32
Frame	23 24

425 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 429  
**Address** 425 E. Main  
**Date** 1995  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

501 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 432  
**Address** 501 E. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R27261](#)  
**Owner** KOTHE, KENNETH K & JOANN  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

502 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 410  
**Address** 502 E. Main  
**Date** 1929  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Has a c. 1940 shed roof rear addition. East façade former garage bay enclosed with vertical plywood panels.

1983 Historic Resources Survey	
Previous Site No.	445
Previous Ranking	4
Previous Photo References	
Roll	32
Frame	25

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

504 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 615  
**Address** 504 E. Main  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R2121](#)  
**Owner** PARDI, VIRGIE E ETAL  
**Historic District** No Outside Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

511 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 963  
**Address** 511 E. Main  
**Date** 1845  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16583](#)  
**Owner** KOTHE, KENNETH K  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes RTHL. Rear addition; porch changes

1983 Historic Resources Survey	
Previous Site No.	447
Previous Ranking	2
Previous Photo References	
Roll	16 16 16
Frame	9 10 11

600 E. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 961  
**Address** 600 E. Main  
**Date** 1887  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes Christian Metropolitan Episcopal Church. Texas State Subject Marker

1983 Historic Resources Survey	
Previous Site No.	452
Previous Ranking	2
Previous Photo References	
Roll	32
Frame	28

100 (Playground) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 166  
**Address** 100 (Playground) W. Main  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

100 (Vereins Kirche) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 167  
**Address** 100 (Vereins Kirche) W. Main  
**Date** 1934  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Property contributes significantly to local history or broader historical patterns.

**Notes** Recorded Texas Historic Landmark, and listed in the National Register of Historic Places. Vereins Kirche is a replica of the original structure. The original corner stone was used in the replica. The building served as a community church, a fort for protection against the Indians, a storehouse and a meeting place.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking 1

Previous Photo References

Roll 29

Frame -----

100 (Washroom) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 168  
**Address** 100 (Washroom) W. Main  
**Date** 2000  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll -----

Frame -----

101 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 267  
**Address** 101 W. Main  
**Date** 1930  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey

Previous Site No. 464

Previous Ranking 3

Previous Photo References

Roll 17

Frame 28

108 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 365  
**Address** 108 W. Main  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R5528](#)  
**Owner** CITY OF FREDERICKSBURG  
**Historic District** Yes Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes** Some original windows replaced w/ aluminum-frame units.

1983 Historic Resources Survey

Previous Site No. 465

Previous Ranking 4

Previous Photo References

Roll 32

Frame 20

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

115 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 266  
**Address** 115 W. Main  
**Date** 1882  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Property contributes significantly to local history or broader historical patterns.  
**Notes** Recorded Texas Historic Landmark

1983 Historic Resources Survey			
Previous Site No.	466		
Previous Ranking	1		
Previous Photo References			
Roll	26	26	26
Frame	32	33	34

125 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 265  
**Address** 125 W. Main  
**Date** 1940  
**Stylistic Influence** Art Deco  
**GCAD Hyperlink** [R64003](#)  
**Owner** COUNTY OF GILLESPIE 101 W MAIN UNIT #9  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes** Resource houses a mural that was painted by WPA artist Otis Dozier in 1941.

1983 Historic Resources Survey			
Previous Site No.	468		
Previous Ranking	4		
Previous Photo References			
Roll	32		
Frame	37		

126 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 364  
**Address** 126 W. Main  
**Date** 1985  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.  
**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll			
Frame			

201 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 264  
**Address** 201 W. Main  
**Date** 1968  
**Stylistic Influence**  
**GCAD Hyperlink** [R26339](#)  
**Owner** SECURITY STATE BANK & TRUST  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.  
**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll			
Frame			

204 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 363  
**Address** 204 W. Main  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R18454](#)  
**Owner** BROADWAY NATIONAL BANK  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.  
**Notes**

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll			
Frame			

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

206 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 362  
**Address** 206 W. Main  
**Date** 1875  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R18452](#)  
**Owner** BROADWAY NATIONAL BANK  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** William Wahmund House. Property is a Recorded Texas Historic Landmark.

### 1983 Historic Resources Survey

**Previous Site No.** 469  
**Previous Ranking** 1  
**Previous Photo References**

Roll 32  
 Frame 17

211 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 263  
**Address** 211 W. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R2631](#)  
**Owner** FERGUSON, ANNE MOSELY  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 471  
**Previous Ranking** 3  
**Previous Photo References**

Roll 17 32  
 Frame 35 35

214 -216 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 361  
**Address** 214 -216 W. Main  
**Date** 1907  
**Stylistic Influence**  
**GCAD Hyperlink** [R28702](#)  
**Owner** FRANTZEN, LESTER & ROXANNE  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Schwartz Building. Some original windows have been replaced

### 1983 Historic Resources Survey

**Previous Site No.** 470  
**Previous Ranking** 1  
**Previous Photo References**

Roll 32  
 Frame 16

215 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 261  
**Address** 215 W. Main  
**Date** 1868  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22933](#)  
**Owner** FERGUSON, ANNE MOSELY  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Recorded Texas Historic Landmark

### 1983 Historic Resources Survey

**Previous Site No.** 472  
**Previous Ranking** 2  
**Previous Photo References**

Roll 17 17  
 Frame 36 37

215 A W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 262  
**Address** 215 A W. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R22933](#)  
**Owner** FERGUSON, ANNE MOSELY  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

218 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 360  
**Address** 218 W. Main  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21792](#)  
**Owner** FARMER, EVELYN S DR  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Deitz Hotel. Rear porch enclosed w/ vertical plywood panels. Property is a RTHL.

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References \_\_\_\_\_

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

219 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 260  
**Address** 219 W. Main  
**Date** 1920  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R19855](#)  
**Owner** CARTER, CHERYLL B & ROBERT BARRETT  
 CARTER FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 474  
 Previous Ranking 2  
 Previous Photo References \_\_\_\_\_

Roll 18 32  
 Frame 3 34

221 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 259  
**Address** 221 W. Main  
**Date** 1920  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** \_\_\_\_\_  
**Owner** \_\_\_\_\_  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 475  
 Previous Ranking 3  
 Previous Photo References \_\_\_\_\_

Roll 18  
 Frame 4

224 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 359  
**Address** 224 W. Main  
**Date** 1900  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R15379](#)  
**Owner** RBD PROPERTIES PARTNERSHIP  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Exterior walls reclad with stone veneer and ribbed metal panels; original windows and doors replaced.

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References \_\_\_\_\_

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

225 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 257  
**Address** 225 W. Main  
**Date** 1890  
**Stylistic Influence** Spanish Eclectic  
**GCAD Hyperlink** [R55922](#)  
**Owner** KNOPP & METZGER INC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey			
Previous Site No.	477		
Previous Ranking	3		
Previous Photo References			
Roll	18	18	32
Frame	5	6	33

229 -231 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 256  
**Address** 229 -231 W. Main  
**Date** 1880  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R20347](#)  
**Owner** KNOPP & METZGER INC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey			
Previous Site No.	478		
Previous Ranking	3		
Previous Photo References			
Roll	18	18	
Frame	7	8	

232 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 358  
**Address** 232 W. Main  
**Date** 1897  
**Stylistic Influence**  
**GCAD Hyperlink** [R22937](#)  
**Owner** PATTON, BUILDING LTD  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

A. L. Patton Building. Resource is a Recorded Texas Historic Landmark.

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

234 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 357  
**Address** 234 W. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R22176](#)  
**Owner** MEADOWS, FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Stucco added to front façade walls.

1983 Historic Resources Survey			
Previous Site No.	476		
Previous Ranking	2		
Previous Photo References			
Roll	32	32	
Frame	11	12	

236 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 356  
**Address** 236 W. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R26394](#)  
**Owner** SEGNER, JOHN J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Front façade walls reclad with stone veneer and ribbed metal; original windows replaced w/aluminum sash unties; and original primary entrance replaced.

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

240 -242 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 355  
**Address** 240 -242 W. Main  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R28745](#)  
**Owner** WEBER, SAMUEL K & PATRICIA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	479
Previous Ranking	2
Previous Photo References	
Roll	32
Frame	9

244 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 354  
**Address** 244 W. Main  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R28745](#)  
**Owner** WEBER, SAMUEL K & PATRICIA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	480
Previous Ranking	2
Previous Photo References	
Roll	32
Frame	8

247 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 255  
**Address** 247 W. Main  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R20345](#)  
**Owner** KNOPP & METZGER INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

261 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 254  
**Address** 261 W. Main  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R22368](#)  
**Owner** METZGER, FREDERICK J ETAL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

300 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 353  
**Address** 300 W. Main  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R13974](#)  
**Owner** GUARANTY FEDERAL BANK, FSB GUARANTY RESIDENTIAL LENDING  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

301 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 253  
**Address** 301 W. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R29235](#)  
**Owner** FISHER, MARY LOUISE %ALTDORF RESTAURANT  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	481
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	30

303 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 252  
**Address** 303 W. Main  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R19051](#)  
**Owner** SCHWETTMANN, EARL R  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	482
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	31

305 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 251  
**Address** 305 W. Main  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19051](#)  
**Owner** SCHWETTMANN, EARL R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Marble panels added.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

307 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 250  
 Address 307 W. Main  
 Date 1860  
 Stylistic Influence Victorian Italianate  
 GCAD Hyperlink [R32280](#)  
 Owner VANCE, JOE  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Recorded Texas Historic Landmark

### 1983 Historic Resources Survey

Previous Site No. 483  
 Previous Ranking 2  
 Previous Photo References

Roll 33  
 Frame 32

309 (Kammiah Home and Store) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 239  
 Address 309 (Kammiah Home and Store) W. Main  
 Date 1849  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Considered among the most significant resources in the project area.

Notes Recorded Texas Historic Landmark

### 1983 Historic Resources Survey

Previous Site No. 484  
 Previous Ranking 1  
 Previous Photo References

Roll 33 33 33  
 Frame 33 34 35

309 (Kammiah Barn) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 241  
 Address 309 (Kammiah Barn) W. Main  
 Date 1884  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Kammiah Smokehouse) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 240  
 Address 309 (Kammiah Smokehouse) W. Main  
 Date 1875  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Arhelger Bathhouse) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 248  
 Address 309 (Arhelger Bathhouse) W. Main  
 Date 1910  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment Example of a distinctive building plan or architectural style. Resource was moved from its original site to its present location.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

309 (Fassel-Roeder House) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 247  
 Address 309 (Fassel-Roeder House) W. Main  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Property contributes significantly to local history or broader historical patterns.

Notes

1983 Historic Resources Survey  
 Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Restroom) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 249  
 Address 309 (Restroom) W. Main  
 Date 1990  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey  
 Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Volunteer Fire Department) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 243  
 Address 309 (Volunteer Fire Department) W. Main  
 Date 1990  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey  
 Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Wagon Shed) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 246  
 Address 309 (Wagon Shed) W. Main  
 Date 1980  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey  
 Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 (Walton-Smith Log Cabin) W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 242  
 Address 309 (Walton-Smith Log Cabin) W. Main  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource was moved from its original site to its present location.

Notes

1983 Historic Resources Survey  
 Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References  
 Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

309 (Weber Sunday House) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 244  
**Address** 309 (Weber Sunday House) W. Main  
**Date** 1904  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource was moved from its original site to its present location.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

309 (White Oak School) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 245  
**Address** 309 (White Oak School) W. Main  
**Date** 1920  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource was moved from its original site to its present location.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

312 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 352  
**Address** 312 W. Main  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20530](#)  
**Owner** ITZ INN LLC % GARCIA, ANTONIO  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes** Krauskopf Building.

1983 Historic Resources Survey	
Previous Site No.	485
Previous Ranking	1
Previous Photo References	
Roll	32
Frame	7

312 (rear) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 631  
**Address** 312 (rear) W. Main  
**Date** 1915  
**Stylistic Influence**  
**GCAD Hyperlink** [R20539](#)  
**Owner** OBOYLE, DEBORAH JEAN  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Some window openings infilled w/ wood siding. Building is located to the rear of 312 W. Main (see site ID# 352).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

323 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 238  
**Address** 323 W. Main  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R22367](#)  
**Owner** METZGER, FREDERICK J ETAL  
**Historic District** Yes Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

325 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 237  
 Address 325 W. Main  
 Date 1980  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R27441](#)  
 Owner CITY OF FREDERICKSBURG  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

328 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 351  
 Address 328 W. Main  
 Date 1900  
 Stylistic Influence vernacular  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Rudolph Itz Saloon and Home. One story log cabin and stone wings adjacent to this building's west façade were erected c. 1860.

1983 Historic Resources Survey	
Previous Site No.	486
Previous Ranking	1
Previous Photo References	
Roll	32
Frame	6

328 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 630  
 Address 328 W. Main  
 Date 1860  
 Stylistic Influence vernacular  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Peter Its Log Cabin. House was originally a one-room log cabin. Stone portion added c. 1880. Resource is adjacent to the former Itz Hotel (see site ID# 351).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

330 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 350  
 Address 330 W. Main  
 Date 1908  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R22363](#)  
 Owner METZGER, FREDERICK J ETAL  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	487
Previous Ranking	1
Previous Photo References	
Roll	32
Frame	5

334 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 349  
 Address 334 W. Main  
 Date 1935  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R22361](#)  
 Owner HALLFORD, E W JR  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Buildings exterior walls reclad with vertical plywood panes. Resource has a large rear concrete block and wood frame addition.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

338 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 348  
**Address** 338 W. Main  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13643](#)  
**Owner** KOENNECKE, RUBY ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Original exterior materials covered w/cement fiberboard, all original windows replaced w/aluminum sash units, and east façade addition.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

340 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 347  
**Address** 340 W. Main  
**Date** 1880  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R14977](#)  
**Owner** HENDRICK, RICHARD G & CAROLYN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Evers Building.

1983 Historic Resources Survey	
Previous Site No.	488
Previous Ranking	2
Previous Photo References	
Roll	32 32
Frame	3 4

401 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 236  
**Address** 401 W. Main  
**Date** 1950  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** \_\_\_\_\_  
**Owner** \_\_\_\_\_  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

402 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 346  
**Address** 402 W. Main  
**Date** 1886  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14224](#)  
**Owner** JOLLY, LLOYD & MARIAN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** William C. Henke Home. Original porch posts replaced with metal columns.

1983 Historic Resources Survey	
Previous Site No.	489
Previous Ranking	1
Previous Photo References	
Roll	33
Frame	29

405 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 235  
**Address** 405 W. Main  
**Date** 1970  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R20420](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

406 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 345  
**Address** 406 W. Main  
**Date** 1925  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23989](#)  
**Owner** PENICK, JIMMY R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Henke Butcher Shop.

### 1983 Historic Resources Survey

**Previous Site No.** 490  
**Previous Ranking** 2  
**Previous Photo References**

Roll 33  
 Frame 28

408 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 344  
**Address** 408 W. Main  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R64633](#)  
**Owner** OESTREICH, E DWIGHT & KAREN  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

410 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 343  
**Address** 410 W. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27519](#)  
**Owner** OESTREICH, E DWIGHT & KAREN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Front façade bay window added.

### 1983 Historic Resources Survey

**Previous Site No.** 491  
**Previous Ranking** 2  
**Previous Photo References**

Roll 33  
 Frame 27

413 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 234  
**Address** 413 W. Main  
**Date** 1950  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R14456](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

414 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 342  
**Address** 414 W. Main  
**Date** 1995  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2180](#)  
**Owner** BLANCHARD, AGNES  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

415 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 233  
**Address** 415 W. Main  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14456](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	492
Previous Ranking	1
Previous Photo References	
Roll	33 33
Frame	3 8

415 (rear) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 682  
**Address** 415 (rear) W. Main  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14456](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Resource has historic shed-roof additions.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

418 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 341  
**Address** 418 W. Main  
**Date** 1905  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R23027](#)  
**Owner** MURCHISON, PHIL & MARY ANN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	493
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	26

419 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 232  
**Address** 419 W. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20855](#)  
**Owner** MONTGOMERY, KEVIN PAUL % STEPHEN MONTGOMERY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	494
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	4

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

421 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 231  
**Address** 421 W. Main  
**Date** 1875  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22828](#)  
**Owner** MONTGOMERY, LOUISE & STEPHEN E  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Johan and Sophie Schlaudt House.

1983 Historic Resources Survey	
Previous Site No.	495
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	5

424 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 339  
**Address** 424 W. Main  
**Date** 1853  
**Stylistic Influence**  
**GCAD Hyperlink** [R2612](#)  
**Owner** ZION LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Zion Evangelical Lutheran Church. Property is an RTHL. Front entrance and steeple added in 1907. Large rear educational annex erected in 1953.

1983 Historic Resources Survey	
Previous Site No.	499
Previous Ranking	1
Previous Photo References	
Roll	33
Frame	23

424 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 629  
**Address** 424 W. Main  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2615](#)  
**Owner** ZION LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Porch posts covered with aluminum panels and eaves boxed with aluminum siding. Aluminum sash windows added in rear. House shares the same address as the Zion Evangelical Lutheran Church (see site ID# 339).

1983 Historic Resources Survey	
Previous Site No.	497
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	24

425 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 230  
**Address** 425 W. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20861](#)  
**Owner** CRENWELGE, TIMOTHY M & KAREN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	498
Previous Ranking	1
Previous Photo References	
Roll	33 33
Frame	6 7

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

422 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 340  
**Address** 422 W. Main  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25230](#)  
**Owner** ZION EVANGELICAL LUTHERAN CHURCH OF FREDBURG  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Building's exterior walls reclad with asbestos shingles. Has a rear addition with aluminum sash horizontal sliding windows that is not visible from street.

1983 Historic Resources Survey	
Previous Site No.	496
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	25

501 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 229  
**Address** 501 W. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R19534](#)  
**Owner** R&R INVESTMENTS  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

504 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 338  
**Address** 504 W. Main  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R1766](#)  
**Owner** BEHREND, GARAGE INC DBA IMMEL MOTORS  
**Historic District** Yes Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

505 W. Main



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 228  
**Address** 505 W. Main  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20377](#)  
**Owner** COLUNGA, LUPE  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Resource displays distinctive stylistic elements.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	500
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	9

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

507 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 227  
**Address** 507 W. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R29118](#)  
**Owner** WAYSHOWER, INC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

508 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 337  
**Address** 508 W. Main  
**Date** 1846  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18466](#)  
**Owner** PAYNE, PERRY & DEBORAH  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Alterations are sensitive to original historic appearance.

Notes

Loeffler-Weber House. House is an RTHL. Rear shed-roof lean-to added in 1905. East façade addition in keeping with historic appearance.

1983 Historic Resources Survey

Previous Site No. 501  
 Previous Ranking 1  
 Previous Photo References

Roll 33  
 Frame 22

509 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 226  
**Address** 509 W. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R29116](#)  
**Owner** WYNN, JOSEPHINE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

Front porch enclosed, stucco added, and new front façade doors added.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

511 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 225  
**Address** 511 W. Main  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28171](#)  
**Owner** CLAYPOLE, STEVEN B - CONTRACT-D/O ASSOCIATES FINANCIAL SERVICES COMPANY INC

**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 502  
 Previous Ranking 3  
 Previous Photo References

Roll 33  
 Frame 10

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

512 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 336  
**Address** 512 W. Main  
**Date** 1890  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R19169](#)  
**Owner** WALLENDORF, MELVIN  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	503
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	21

515 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 224  
**Address** 515 W. Main  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R15184](#)  
**Owner** DODDS, JOHN W  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	504
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	11

516 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 335  
**Address** 516 W. Main  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R24054](#)  
**Owner** METZGER, DIANE  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	505
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	20

519 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 223  
**Address** 519 W. Main  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R13749](#)  
**Owner** CANCINO, RAMONA-LIFE ESTATE-D/O JULIA CANCINO ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

520 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 334  
**Address** 520 W. Main  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R24634](#)  
**Owner** HOERSTER, RICHARD ETAL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority. Resource has undergone alterations.

**Notes** Stucco and fixed-framed windows added to central, gabled-roof mass.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

522 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 333  
**Address** 522 W. Main  
**Date** 1953  
**Stylistic Influence**  
**GCAD Hyperlink** [R24632](#)  
**Owner** PATE, REAL ESTATE LTD % CHARLES & MABEL PATE  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes** Stone front façade added recently, front façade windows added.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

523 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 222  
**Address** 523 W. Main  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

528 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 332  
**Address** 528 W. Main  
**Date** 1995  
**Stylistic Influence**  
**GCAD Hyperlink** [R2446](#)  
**Owner** STROEHER & OLFERS PROP  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

601 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 221  
**Address** 601 W. Main  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17845](#)  
**Owner** WARD, JOHNNIE Q II & ELAINE H  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	506
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	12

601 A W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 760  
**Address** 601 A W. Main  
**Date** 1920  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17845](#)  
**Owner** WARD, JOHNNIE Q II & ELAINE H  
**Historic District** No Outside Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

602 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 331  
**Address** 602 W. Main  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2288](#)  
**Owner** WILBURN, LYNNE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Betz-Kammlah Home. Original porch replaced.

1983 Historic Resources Survey	
Previous Site No.	507
Previous Ranking	1
Previous Photo References	
Roll	33
Frame	19

602 (rear) W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 330  
**Address** 602 (rear) W. Main  
**Date** 1970  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2288](#)  
**Owner** WILBURN, LYNNE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes Resource was erected c. 1970 and shares the lot with the house at 602 W. Main.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

605 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 220  
**Address** 605 W. Main  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R20203](#)  
**Owner** BOPP, FRIEDHELM C  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	509
Previous Ranking	2
Previous Photo References	
Roll	33
Frame	13

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

607 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 219  
 Address 607 W. Main  
 Date 1950  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R20205](#)  
 Owner GARNER, JIM C  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

609 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 218  
 Address 609 W. Main  
 Date 1900  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R23856](#)  
 Owner WADE, KENNETH & MARIE  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	510
Previous Ranking	3
Previous Photo References	
Roll	33
Frame	14

609 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 618  
 Address 609 W. Main  
 Date 1920  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R23856](#)  
 Owner WADE, KENNETH & MARIE  
 Historic District Yes Historic District  
 Assessment Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

611 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 217  
 Address 611 W. Main  
 Date 1920  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	511
Previous Ranking	4
Previous Photo References	
Roll	_____
Frame	_____

612 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 329  
 Address 612 W. Main  
 Date 1995  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

614 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 328  
**Address** 614 W. Main  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R1769](#)  
**Owner** BEHREND, AUGUST & ELIZABETH  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

616 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 327  
**Address** 616 W. Main  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R27578](#)  
**Owner** LAUGHLIN, RICHARD  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey

Previous Site No. 512  
 Previous Ranking 3  
 Previous Photo References

Roll 33  
 Frame 17

617 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 216  
**Address** 617 W. Main  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R14495](#)  
**Owner** CRENWELGE, ROGER ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

618 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 326  
**Address** 618 W. Main  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24321](#)  
**Owner** ACORN STREET TRUST % ABEL PIERCE JR  
 ETAL TRUSTEE  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes Peter-Schmidt-Treibs-Langehennig House.

1983 Historic Resources Survey

Previous Site No. 514  
 Previous Ranking 1  
 Previous Photo References

Roll 31 31 31  
 Frame 34 35 36

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

619 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 215  
**Address** 619 W. Main  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R16432](#)  
**Owner** WILLIAMS, DEBORA GAY  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	513
Previous Ranking	2
Previous Photo References	
Roll	33 33
Frame	15 16

629 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 214  
**Address** 629 W. Main  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R23723](#)  
**Owner** LEISSNER, LAYTON L  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

701 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 213  
**Address** 701 W. Main  
**Date** 1847  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17773](#)  
**Owner** HASCHKE, KAREN ANN  
**Historic District** No Outside Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Property contributes significantly to local history or broader historical patterns. Considered among the most significant resources in the project area.

**Notes** Johann and Elizabeth Klingehoefer House. Resource is the oldest home in Fredericksburg.

1983 Historic Resources Survey	
Previous Site No.	523
Previous Ranking	1
Previous Photo References	
Roll	22 22 22
Frame	19 20 21

702 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 325  
**Address** 702 W. Main  
**Date** 1960  
**Stylistic Influence** Ranch  
**GCAD Hyperlink** [R18782](#)  
**Owner** RODE, WAYNE E & SHERRY K  
**Historic District** No Outside Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

709 W. Main



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 960  
**Address** 709 W. Main  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22132](#)  
**Owner** MCKAY, AUGUSTA MORITZ INDIV ETAL  
**Historic District** No Local Landmark

**Assessment** Example of a distinctive building plan or architectural style.

Notes

1983 Historic Resources Survey	
Previous Site No.	526
Previous Ranking	1
Previous Photo References	
Roll	9
Frame	18

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

714 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 918  
 Address 714 W. Main  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R18872](#)  
 Owner HUESTIS, JOHN E & SHARON  
 Historic District No Local Landmark

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes RTHL - Schneider-Klinelhoffer House

1983 Historic Resources Survey	
Previous Site No.	528
Previous Ranking	2
Previous Photo References	
Roll	9
Frame	33

811 W. Main



2002 Re-evaluation

High  Medium  Low

Site ID No. 920  
 Address 811 W. Main  
 Date 1900  
 Stylistic Influence Queen Anne  
 GCAD Hyperlink [R20466](#)  
 Owner MJTJ INVESTMENTS FLP  
 Historic District No Local Landmark

Assessment Example of a distinctive building plan or architectural style.

Notes

1983 Historic Resources Survey	
Previous Site No.	532
Previous Ranking	2
Previous Photo References	
Roll	9
Frame	13

105 N. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 550  
 Address 105 N. Milam  
 Date 1970  
 Stylistic Influence  
 GCAD Hyperlink [R14976](#)  
 Owner DIETEL, LUCILLE MRS  
 Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes Scored concrete added to front façade.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

106 ? N. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 843  
 Address 106 ? N. Milam  
 Date  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

107 N. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 549  
 Address 107 N. Milam  
 Date 1890  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Exterior walls reclad with asbestos shingles, some windows replaced, original porch posts replaced with metal columns, and major rear additions.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 -1/2 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 794  
**Address** 108 -1/2 N. Milam  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R18187](#)  
**Owner** GRONA, JULIA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	536
Previous Ranking	4
Previous Photo References	
Roll	23
Frame	8

109 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 548  
**Address** 109 N. Milam  
**Date** 1890  
**Stylistic Influence**  
**GCAD Hyperlink** [R25155](#)  
**Owner** PENICK, JIMMY R  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Exterior walls reclad with asbestos shingles, some windows replaced, original porch posts replaced with metal columns, and major rear additions.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

110 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 152  
**Address** 110 N. Milam  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R25975](#)  
**Owner** REAGAN FAMILY TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

A significant number of windows have been altered. Asbestos siding was added over original exterior building fabric.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

201 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 60  
**Address** 201 N. Milam  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R24196](#)  
**Owner** DAVIS, KATHLEEN -LIFE ESTATE-  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

Notes

Resource has a small c. 1980 east façade addition.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

202 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 793  
**Address** 202 N. Milam  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R18541](#)  
**Owner** MADLYNS INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

203 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 547  
**Address** 203 N. Milam  
**Date** 1955  
**Stylistic Influence**  
**GCAD Hyperlink** [R22345](#)  
**Owner** MADLYNS INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** One front façade window replaced.

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

205 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 546  
**Address** 205 N. Milam  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R24084](#)  
**Owner** TRIPLETT, MELISSA  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes** Excellent example of its type.

1983 Historic Resources Survey

Previous Site No. 538  
 Previous Ranking 2  
 Previous Photo References

Roll 29  
 Frame 20

206 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 792  
**Address** 206 N. Milam  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R19277](#)  
**Owner** 307 FREDERICKSBURG LTD  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

207 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 545  
**Address** 207 N. Milam  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R24615](#)  
**Owner** MADLYNS INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

209 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 544  
**Address** 209 N. Milam  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R18543](#)  
**Owner** DURST, BRENDA G 188 COUNTRY  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

404 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 940  
**Address** 404 N. Milam  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26385](#)  
**Owner** LANE, ROY H JR & CONNIE  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	539
Previous Ranking	2
Previous Photo References	
Roll	14
Frame	31

608 N. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 945  
**Address** 608 N. Milam  
**Date** 1907  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1254](#)  
**Owner** JOHNSON, RAY EDWIN & FRANCES M  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Historic rear addition and historic carport, shed, and 2-story outbuilding.

1983 Historic Resources Survey	
Previous Site No.	545
Previous Ranking	2
Previous Photo References	
Roll	14
Frame	33

104 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 795  
**Address** 104 S. Milam  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	549
Previous Ranking	1
Previous Photo References	
Roll	23 23 23
Frame	5 6 7

106 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 796  
**Address** 106 S. Milam  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	550
Previous Ranking	2
Previous Photo References	
Roll	23 23
Frame	3 4

107 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 551  
**Address** 107 S. Milam  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 S. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 797  
 Address 108 S. Milam  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	551
Previous Ranking	1
Previous Photo References	
Roll	23
Frame	2

205 S. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 552  
 Address 205 S. Milam  
 Date 1940  
 Stylistic Influence  
 GCAD Hyperlink [R22185](#)  
 Owner RICHARDSON, MICHAEL & SUSAN ALSTON  
 Historic District Yes Historic District  
 Assessment Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

207 S. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 553  
 Address 207 S. Milam  
 Date 1945  
 Stylistic Influence  
 GCAD Hyperlink [R19000](#)  
 Owner BIRCK, DARLEEN  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

208 S. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 798  
 Address 208 S. Milam  
 Date 1930  
 Stylistic Influence  
 GCAD Hyperlink [R14744](#)  
 Owner MACWITHEY, HAROLD S  
 Historic District Yes Historic District  
 Assessment Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

209 S. Milam



2002 Re-evaluation

High  Medium  Low

Site ID No. 554  
 Address 209 S. Milam  
 Date 1881  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R26547](#)  
 Owner DRAGOO, SHARON D  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Side façade reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	552
Previous Ranking	2
Previous Photo References	
Roll	29 29
Frame	17 18

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

305 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 555  
**Address** 305 S. Milam  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19004](#)  
**Owner** BAKER, SUSAN P  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a significant rear addition.

### 1983 Historic Resources Survey

**Previous Site No.** 553  
**Previous Ranking** 3  
**Previous Photo References**

Roll 5  
 Frame 33

306 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 799  
**Address** 306 S. Milam  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19517](#)  
**Owner** CRENWELGE, LINDSAY L & HEATH & MICHELLE CRENWELGE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 554  
**Previous Ranking** 2  
**Previous Photo References**

Roll 5  
 Frame 34

410 S. Milam



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 916  
**Address** 410 S. Milam  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20212](#)  
**Owner** KLIER, MILDRED  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 556  
**Previous Ranking** 1  
**Previous Photo References**

Roll 5 6  
 Frame 36 4

201 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 117  
**Address** 201 Mistletoe  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R14564](#)  
**Owner** PATTERSON, KIT R & JILL R  
**Historic District** Yes Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Resource displays distinctive stylistic elements.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 560  
**Previous Ranking** 3  
**Previous Photo References**

Roll 5  
 Frame 19

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

201 A Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 118  
**Address** 201 A Mistletoe  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14564](#)  
**Owner** PATTERSON, KIT R & JILL R  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Considered among the most significant resources in the project area.

**Notes** One set of windows replaced at rear of building. Small modern addition at rear of building.

1983 Historic Resources Survey	
Previous Site No.	561
Previous Ranking	1
Previous Photo References	
Roll	23 23
Frame	22 23

203 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 119  
**Address** 203 Mistletoe  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R28570](#)  
**Owner** PATTERSON, KIT R & JILL R  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	562
Previous Ranking	3
Previous Photo References	
Roll	5
Frame	20

205 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 120  
**Address** 205 Mistletoe  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R9444](#)  
**Owner** PENICK, JIMMY R  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

206 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 129  
**Address** 206 Mistletoe  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R25302](#)  
**Owner** PENICK, MICHAEL R ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

207 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 121  
**Address** 207 Mistletoe  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R25899](#)  
**Owner** MARSHALL, JANE D  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Small bay window inserted along west façade at rear

1983 Historic Resources Survey	
Previous Site No.	563
Previous Ranking	3
Previous Photo References	
Roll	5
Frame	21

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

208 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 128  
**Address** 208 Mistletoe  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18290](#)  
**Owner** HERBORT, ANNIE MAE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Large addition with carport on east side of house.

### 1983 Historic Resources Survey

Previous Site No. 564  
 Previous Ranking 3  
 Previous Photo References

Roll 5  
 Frame 24

209 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 122  
**Address** 209 Mistletoe  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R16068](#)  
**Owner** DONATO, LYNDA A  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. 565  
 Previous Ranking 3  
 Previous Photo References

Roll 5  
 Frame 22

210 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 127  
**Address** 210 Mistletoe  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R24458](#)  
**Owner** PRIESS, ROBERTA  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

211 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 123  
**Address** 211 Mistletoe  
**Date** 1950  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R25870](#)  
**Owner** SCHMIDT, GERTRUDE L  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** The exterior siding was changed to asbestos siding. A car port was added onto the east side.

### 1983 Historic Resources Survey

Previous Site No. 566  
 Previous Ranking 3  
 Previous Photo References

Roll 5  
 Frame 23

213 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 124  
**Address** 213 Mistletoe  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R24194](#)  
**Owner** PETSCH, JAMES E  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Rear addition on west side

### 1983 Historic Resources Survey

Previous Site No. 567  
 Previous Ranking 4  
 Previous Photo References

Roll 31  
 Frame 29

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

214 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 126  
**Address** 214 Mistletoe  
**Date** 1998  
**Stylistic Influence**  
**GCAD Hyperlink** [R72777](#)  
**Owner** SUMMERS SPECIALTIES INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

215 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 125  
**Address** 215 Mistletoe  
**Date** 1930  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26574](#)  
**Owner** SMITH, DONALD C  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Addition at rear

1983 Historic Resources Survey

Previous Site No. 568  
 Previous Ranking 4  
 Previous Photo References

Roll 31  
 Frame 30

217 Mistletoe



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 565  
**Address** 217 Mistletoe  
**Date** 1985  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18631](#)  
**Owner** ARCHER, ROBERT R  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

212 W. Morse



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 949  
**Address** 212 W. Morse  
**Date** 1900  
**Stylistic Influence** vernacular; Queen Anne  
**GCAD Hyperlink** [R28722](#)  
**Owner** SCHMIDT, KARL A JR ETUX  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic rear addition with non-historic alterations; historic barn/garage; historic Basse block cistern house.

1983 Historic Resources Survey

Previous Site No. 584  
 Previous Ranking 2  
 Previous Photo References

Roll 3  
 Frame 13

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

107 N. Orange



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 561  
**Address** 107 N. Orange  
**Date** 1890  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R14910](#)  
**Owner** HAEBIG, JOHN D ETUX -LIFE ESTATE- D/O GILLESPIE COUNTY HISTORIAL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.  
**Notes** Property is a Recorded Texas Historic Landmark.

1983 Historic Resources Survey			
Previous Site No.	589		
Previous Ranking	1		
Previous Photo References			
Roll	29	29	29
Frame	26	27	28

109 N. Orange



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 560  
**Address** 109 N. Orange  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25346](#)  
**Owner** WEST, DEBORAH LINDA  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.  
**Notes**

1983 Historic Resources Survey			
Previous Site No.	590		
Previous Ranking	2		
Previous Photo References			
Roll	29		
Frame	25		

109 (rear) N. Orange



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 683  
**Address** 109 (rear) N. Orange  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R25346](#)  
**Owner** WEST, DEBORAH LINDA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.  
**Notes** Former barn that currently functions as a guesthouse.

1983 Historic Resources Survey			
Previous Site No.	590		
Previous Ranking	2		
Previous Photo References			
Roll			
Frame			

109 (rear) N. Orange



**2002 Re-evaluation**

High  Medium  Low

**Site ID No.** 684  
**Address** 109 (rear) N. Orange  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R25346](#)  
**Owner** WEST, DEBORAH LINDA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.  
**Notes** Former barn that currently functions as a guesthouse.

1983 Historic Resources Survey			
Previous Site No.	590		
Previous Ranking	2		
Previous Photo References			
Roll			
Frame			

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

112 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 802  
**Address** 112 N. Orange  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R25585](#)  
**Owner** TOLBERT, SANDRA K & STEPHEN SCHAEFER  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 801  
**Address** 204 N. Orange  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R24467](#)  
**Owner** PRIESS, WESLEY A ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

205 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 559  
**Address** 205 N. Orange  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R19966](#)  
**Owner** SUMMERS SPECIALTIES INC  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	591
Previous Ranking	4
Previous Photo References	
Roll	7 29
Frame	6 24

206 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 800  
**Address** 206 N. Orange  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R20993](#)  
**Owner** KUHLMANN, SELMA META IRREVOCABLE TRUST  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	592
Previous Ranking	3
Previous Photo References	
Roll	7 23
Frame	7 9

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

207 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 558  
**Address** 207 N. Orange  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R67355](#)  
**Owner** SUMMERS SPECIALTIES INC  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

209 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 557  
**Address** 209 N. Orange  
**Date** 1945  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R20050](#)  
**Owner** RUEBSAHM, KATHERINE KLEIN -KITTY-  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

305 N. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 556  
**Address** 305 N. Orange  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R20052](#)  
**Owner** RUEBSAHM, KATHERINE KLEIN -KITTY-  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	593
Previous Ranking	4
Previous Photo References	
Roll	7
Frame	8

201 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 567  
**Address** 201 S. Orange  
**Date** 1930  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R23911](#)  
**Owner** PEHL, ALFRED G MRS (ELIZABETH)  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

202 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 212  
**Address** 202 S. Orange  
**Date** 1960  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R2591](#)  
**Owner** ST MARYS CATHOLIC SCHOOL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

203 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 568  
**Address** 203 S. Orange  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21044](#)  
**Owner** JUNG, JOE CHARLES & SYLVIA C  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey

Previous Site No. 599  
 Previous Ranking 4  
 Previous Photo References

Roll 29  
 Frame 30

205 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 569  
**Address** 205 S. Orange  
**Date** 1865  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22987](#)  
**Owner** JUNG, JOE CHARLES & SYLVIA C  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 600  
 Previous Ranking 2  
 Previous Photo References

Roll 29 29  
 Frame 31 32

207 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 570  
**Address** 207 S. Orange  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R22992](#)  
**Owner** FAUBION, MARY ANN %GERTRUDE FAUBION  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

209 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 571  
**Address** 209 S. Orange  
**Date** 1965  
**Stylistic Influence**  
**GCAD Hyperlink** [R22993](#)  
**Owner** ARBOR, HOMES INC %NANCY OFFER LOWE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

303 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 572  
**Address** 303 S. Orange  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R1006](#)  
**Owner** GOOD, VERA L  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

304 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 803  
**Address** 304 S. Orange  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	601
Previous Ranking	4
Previous Photo References	
Roll	34
Frame	1

305 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 573  
**Address** 305 S. Orange  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R22794](#)  
**Owner** THOMPSON, RICHARD ALLAN  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	602
Previous Ranking	3
Previous Photo References	
Roll	6
Frame	26

306 S. Orange



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 804  
**Address** 306 S. Orange  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R1869](#)  
**Owner** RYAN, CHERYL COLLEEN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

201 W. Park



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 914  
**Address** 201 W. Park  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1462](#)  
**Owner** IBANEZ, VICTORIANO & MAYRA  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	622
Previous Ranking	2
Previous Photo References	
Roll	31
Frame	14

101 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 703  
**Address** 101 E. San Antonio  
**Date** 1940  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

102 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 415  
**Address** 102 E. San Antonio  
**Date** 1937  
**Stylistic Influence** Moderne  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Some window openings infilled with concrete. Large rear addition addressed as 104 E. San Antonio has been added to rear of building.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

104 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 416  
**Address** 104 E. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16568](#)  
**Owner** COUNTY OF GILLESPIE  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Former Central Hotel. Significant additions to rear & side facades. Some door & window openings enclosed. Some original window removed & replaced with fixed-pane, aluminum-frame units.

1983 Historic Resources Survey	
Previous Site No.	<u>36</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	30 30 30
Frame	11 12 13

109 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 704  
**Address** 109 E. San Antonio  
**Date** 1847  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes** Property is a Recorded Texas Historic Landmark. Resource has an historic wood-frame addition.

1983 Historic Resources Survey	
Previous Site No.	<u>646</u>
Previous Ranking	<u>1</u>
Previous Photo References	
Roll	19 19
Frame	18 19

110 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 417  
**Address** 110 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18751](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District

**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	<u>647</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	<u>27</u>
Frame	<u>3</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

113 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 474  
**Address** 113 E. San Antonio  
**Date** 1961  
**Stylistic Influence**  
**GCAD Hyperlink** [R2595](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

113 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 473  
**Address** 113 E. San Antonio  
**Date** 1820  
**Stylistic Influence** Gothic Revival  
**GCAD Hyperlink** [R2595](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Property is an RTHL. Holy Ghost Lutheran.

1983 Historic Resources Survey	
Previous Site No.	648
Previous Ranking	1
Previous Photo References	
Roll	19 19
Frame	16 17

113 (rear) E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 638  
**Address** 113 (rear) E. San Antonio  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R2595](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations. Resource has undergone alterations.

Notes Exterior walls re clad with synthetic siding. Resource is to the rear of 113 E. San Antonio (see site ID# 474).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

117 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 472  
**Address** 117 E. San Antonio  
**Date** 1922  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R2595](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Originally pastor's residence for neighboring church. Corner stone inscribed "A. Koerner, Pastor 1922."

1983 Historic Resources Survey	
Previous Site No.	649
Previous Ranking	3
Previous Photo References	
Roll	19
Frame	15

117 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 828  
**Address** 117 E. San Antonio  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R2595](#)  
**Owner** HOLY GHOST LUTHERAN CHURCH  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

203 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 470  
**Address** 203 E. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R24244](#)  
**Owner** BOLTON, JOHN T & CAROL  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

203 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 471  
**Address** 203 E. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R24914](#)  
**Owner** RENDON, EVANGELINA  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

207 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 469  
**Address** 207 E. San Antonio  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R24246](#)  
**Owner** HANCOCK, JAMES T & EVE  
**Historic District** Yes Extension of Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes Wood wheelchair ramp added to front façade.

1983 Historic Resources Survey	
Previous Site No.	650
Previous Ranking	2
Previous Photo References	
Roll	13
Frame	9

208 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 418  
**Address** 208 E. San Antonio  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19988](#)  
**Owner** KEATING, ANTONETTE M  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Vertical plywood siding added to front façade gable end.

1983 Historic Resources Survey	
Previous Site No.	652
Previous Ranking	2
Previous Photo References	
Roll	27 27
Frame	4 5

208 (rear) E. E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 634  
**Address** 208 (rear) E. E. San Antonio  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19988](#)  
**Owner** KEATING, ANTONETTE M  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

208 (rear) E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 633  
**Address** 208 (rear) E. San Antonio  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R19988](#)  
**Owner** KEATING, ANTONETTE M  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

209 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 468  
**Address** 209 E. San Antonio  
**Date** 1895  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R27086](#)  
**Owner** BLOUNT, JERALD D ETUX  
**Historic District** Yes Extension of Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Concrete wheelchair ramp added to front façade. Resource has a rear c. 1950 flat-roof addition.

1983 Historic Resources Survey	
Previous Site No.	<u>651</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	13
Frame	10

211 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 467  
**Address** 211 E. San Antonio  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R25624](#)  
**Owner** ZEY, DOROTHY & KATYE DUDERSTADT  
**Historic District** Yes Extension of Historic District  
**Assessment** Resource is an empty lot.

Notes

Resource is an empty lot w/ a small masonry storage building in the 200 block of E. San Antonio

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

213 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 466  
**Address** 213 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R22490](#)  
**Owner** ROCKWOOD, ANDREW P M D & MELISSA DIANE  
**Historic District** Yes Extension of Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	<u>653</u>
Previous Ranking	<u>3</u>
Previous Photo References	
Roll	13 15
Frame	11 31

214 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 419  
**Address** 214 E. San Antonio  
**Date** 1975  
**Stylistic Influence**  
**GCAD Hyperlink** [R19694](#)  
**Owner** DURST, M COMPANY %DURST, MARK & KAY  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

216 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 420  
**Address** 216 E. San Antonio  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24075](#)  
**Owner** BLOUNT, JERALD DON ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Has a rear, wood-frame addition.

1983 Historic Resources Survey			
Previous Site No.	654		
Previous Ranking	1		
Previous Photo References			
Roll	27	27	27
Frame	6	7	8

301 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 465  
**Address** 301 E. San Antonio  
**Date** 1934  
**Stylistic Influence**  
**GCAD Hyperlink** [R25609](#)  
**Owner** SCHAEFFER, OLIVER ETAL  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Building had an extensive renovation c. 1999.

1983 Historic Resources Survey			
Previous Site No.	655		
Previous Ranking	4		
Previous Photo References			
Roll	13	13	
Frame	12	18	

303 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 464  
**Address** 303 E. San Antonio  
**Date** 1952  
**Stylistic Influence**  
**GCAD Hyperlink** [R25622](#)  
**Owner** SCHAEFFER, OLIVER ETUX  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes**

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

304 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 422  
**Address** 304 E. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25844](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Exterior walls re clad with asbestos shingles. Resource has a small house to its rear.

1983 Historic Resources Survey			
Previous Site No.	656		
Previous Ranking	3		
Previous Photo References			
Roll	27		
Frame	9		

304 (rear) E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 635  
**Address** 304 (rear) E. San Antonio  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R25844](#)  
**Owner** CRENWELGE, MILTON M & JACQUELYN J  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource is a small house to the rear of 304 E. San Antonio (see ID# 422).

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

305 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 463  
**Address** 305 E. San Antonio  
**Date** 1999  
**Stylistic Influence**  
**GCAD Hyperlink** [R70789](#)  
**Owner** SCHAETTER, BRYON  
**Historic District** Yes Extension of Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

306 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 423  
**Address** 306 E. San Antonio  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R25613](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

307 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 462  
**Address** 307 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R17962](#)  
**Owner** PAPE, MARLENE A ESTATE  
**Historic District** Yes Extension of Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Exterior walls reclad with vinyl siding.

1983 Historic Resources Survey	
Previous Site No.	657
Previous Ranking	3
Previous Photo References	
Roll	13
Frame	14

308 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 424  
**Address** 308 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R25629](#)  
**Owner** HAGEMANN, GAIL ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes** Resource has a small rear addition that connects it to the garage.

1983 Historic Resources Survey	
Previous Site No.	658
Previous Ranking	3
Previous Photo References	
Roll	27
Frame	10

309 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 461  
**Address** 309 E. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R27536](#)  
**Owner** TIETZ, WILLIAM A  
**Historic District** Yes Extension of Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Porch infilled.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	-----
Frame	-----

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

311 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 460  
**Address** 311 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R21576](#)  
**Owner** LANG, ROBERT H  
**Historic District** Yes Extension of Historic District  
**Assessment** Outstanding example of a unique building plan that displays distinctive stylistic features and retains original materials. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	659
Previous Ranking	3
Previous Photo References	
Roll	13
Frame	16

312 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 425  
**Address** 312 E. San Antonio  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R19358](#)  
**Owner** SCHMIDT, GERALD W & PATRICIA J  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

313 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 459  
**Address** 313 E. San Antonio  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R28126](#)  
**Owner** WATSON, TENNEV  
**Historic District** Yes Extension of Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	660
Previous Ranking	3
Previous Photo References	
Roll	13
Frame	17

314 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 426  
**Address** 314 E. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25618](#)  
**Owner** SCHAEFFER, DWAYNE M  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	661
Previous Ranking	3
Previous Photo References	
Roll	27
Frame	11

316 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 427  
**Address** 316 E. San Antonio  
**Date** 1900  
**Stylistic Influence**  
**GCAD Hyperlink** [R13820](#)  
**Owner** CASTILLO, EPIFANIA  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Exterior walls covered with asbestos shingles and vertical plywood panels, all original windows replaced w/aluminum sash units, side shed-roof addition, and front porch enclosed.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

318 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 428  
**Address** 318 E. San Antonio  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R20045](#)  
**Owner** KLEIN, EDMUND J  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

**Notes** Exterior walls partially reclad with asbestos shingles. Original porch posts replaced with metal columns.

501 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 617  
**Address** 501 E. San Antonio  
**Date** 1865  
**Stylistic Influence**  
**GCAD Hyperlink** [R2628](#)  
**Owner** LANGERHANS, MARK WAYNE ETAL  
 %CARLETTA SMITH  
 %CARLETTA SMITH  
 %CARLETTA SMITH  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

1983 Historic Resources Survey	
Previous Site No.	<u>662</u>
Previous Ranking	<u>4</u>
Previous Photo References	
Roll	<u>16</u>
Frame	<u>36</u>

**Notes** Formerly the "Old Mill." Building originally had a flat roof.

510 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 900  
**Address** 510 E. San Antonio  
**Date** 1905  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R23884](#)  
**Owner** KOTHE, KENNETH K  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

1983 Historic Resources Survey	
Previous Site No.	<u>663</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>10 10</u>
Frame	<u>18 19</u>

**Notes**

517 E. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 901  
**Address** 517 E. San Antonio  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R18952](#)  
**Owner** BLOUNT, JERALD D ETUX  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

1983 Historic Resources Survey	
Previous Site No.	<u>664</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>10 10</u>
Frame	<u>7 8</u>

**Notes**

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

608 S. Creek



2002 Re-evaluation

High  Medium  Low

Site ID No. 903  
 Address 608 S. Creek  
 Date \_\_\_\_\_  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R15749](#)  
 Owner ECKHARDT, RODNEY J  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	665
Previous Ranking	2
Previous Photo References	
Roll	10
Frame	9

611 E. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 902  
 Address 611 E. San Antonio  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R22015](#)  
 Owner CHAVARRIA, ANGEL  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	667
Previous Ranking	2
Previous Photo References	
Roll	10 10
Frame	11 12

100 Block W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 413  
 Address 100 Block W. San Antonio  
 Date 1910  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

Resource is a gazebo located within a large grassy public park in the 100 Block of W. San Antonio

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

100 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 414  
 Address 100 W. San Antonio  
 Date 1970  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

Gillespie County Law Enforcement Building.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

105 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 702  
 Address 105 W. San Antonio  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R20276](#)  
 Owner BRYLA, CARROLL J ETUX ETAL  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	675
Previous Ranking	1
Previous Photo References	
Roll	19 19
Frame	20 21

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

107 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 701  
**Address** 107 W. San Antonio  
**Date** 1905  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R19395](#)  
**Owner** NAGEL, DON A  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Resource has historic flat-roof west façade and rear facade additions.

1983 Historic Resources Survey

Previous Site No. 676  
 Previous Ranking 2  
 Previous Photo References

Roll 19  
 Frame 22

109 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 700  
**Address** 109 W. San Antonio  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R70895](#)  
**Owner** NAGEL, DON A  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

113 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 299  
**Address** 113 W. San Antonio  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R23075](#)  
**Owner** ABRAHAM, LU ELLEN ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes**

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

117 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 298  
**Address** 117 W. San Antonio  
**Date** 1885  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R2605](#)  
**Owner** COUNTY OF GILLESPIE 101 W MAIN UNIT #9  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements. Property contributes significantly to local history or broader historical patterns.

**Notes** Recorded Texas Historic Landmark

1983 Historic Resources Survey

Previous Site No. 677  
 Previous Ranking 1  
 Previous Photo References

Roll 19  
 Frame 23

119 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 297  
**Address** 119 W. San Antonio  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R13769](#)  
**Owner** EVERETT, CLARA LYNN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey

Previous Site No. 678  
 Previous Ranking 4  
 Previous Photo References

Roll 19  
 Frame 24

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

121 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 296  
**Address** 121 W. San Antonio  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R20076](#)  
**Owner** KLEIN, HAZEL -LIFE ESTATE- D/O JANIS T JOSEPH MAUND  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey

Previous Site No. 679  
 Previous Ranking 2  
 Previous Photo References

Roll 19  
 Frame 25

123 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 295  
**Address** 123 W. San Antonio  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R19345](#)  
**Owner** JOSEPH, HENRY L  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Resource displays distinctive stylistic elements.

**Notes** Window openings on the east façade sunporch have been partially infilled and windows replaced.

1983 Historic Resources Survey

Previous Site No. 680  
 Previous Ranking 4  
 Previous Photo References

Roll 19  
 Frame 26

125 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 294  
**Address** 125 W. San Antonio  
**Date** 1879  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17527](#)  
**Owner** TURNER, RANDALL M  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Recorded Historic Texas Landmark

1983 Historic Resources Survey

Previous Site No. 681  
 Previous Ranking 1  
 Previous Photo References

Roll 19 19 19  
 Frame 27 28 29

203 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 293  
**Address** 203 W. San Antonio  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1726](#)  
**Owner** BECKMANN, ROY F  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey

Previous Site No. 682  
 Previous Ranking 2  
 Previous Photo References

Roll 19  
 Frame 30

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

207 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 292  
**Address** 207 W. San Antonio  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R23827](#)  
**Owner** PARKER, CLAUDIA L  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has substantial rear historic additions.

### 1983 Historic Resources Survey

**Previous Site No.** 683  
**Previous Ranking** 2  
**Previous Photo References**

Roll 19  
 Frame 31

209 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 291  
**Address** 209 W. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19510](#)  
**Owner** DUBOSE, JEAN L & BEVERLYN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Appears that original detached rear kitchen has been attached to main house.

### 1983 Historic Resources Survey

**Previous Site No.** 684  
**Previous Ranking** 1  
**Previous Photo References**

Roll 19 19  
 Frame 32 33

211 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 290  
**Address** 211 W. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25316](#)  
**Owner** RUSCHE, ERWIN W MRS  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 685  
**Previous Ranking** 1  
**Previous Photo References**

Roll 19 19  
 Frame 34 35

214 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 411  
**Address** 214 W. San Antonio  
**Date** 1900  
**Stylistic Influence** Mission Revival  
**GCAD Hyperlink** [R2632](#)  
**Owner** ST MARYS CATHOLIC SCHOOL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** "St. Joseph's Halle, 1900" is inscribed in parapet.

### 1983 Historic Resources Survey

**Previous Site No.** 686  
**Previous Ranking** 2  
**Previous Photo References**

Roll 26  
 Frame 31

214 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 566  
**Address** 214 W. San Antonio  
**Date** 1923  
**Stylistic Influence** Classical Revival  
**GCAD Hyperlink** [R2632](#)  
**Owner** ST MARYS CATHOLIC SCHOOL  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 687  
**Previous Ranking** 2  
**Previous Photo References**

Roll 26 26  
 Frame 29 30

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

217 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 289  
**Address** 217 W. San Antonio  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R23974](#)  
**Owner** PEHLS FLOWER SHOP  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** A gabled-roof greenhouse has been attached to the resource's rear façade.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

302 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 324  
**Address** 302 W. San Antonio  
**Date** 1863  
**Stylistic Influence** Gothic Revival  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

**Notes** Old Saint Mary's Church-Marienkirche. Property is a Recorded Texas Historic Landmark and was documented by HABS (Historic American Building Survey) in 1934.

### 1983 Historic Resources Survey

**Previous Site No.** 688  
**Previous Ranking** 1  
**Previous Photo References**

Roll 26 26  
 Frame 25 28

304 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 323  
**Address** 304 W. San Antonio  
**Date** 1906  
**Stylistic Influence** Gothic Revival  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.

**Notes** Property is a Recorded Texas Historic Landmark and is individually listed in the NRHP. St. Mary's Catholic Church. Is a "painted church."

### 1983 Historic Resources Survey

**Previous Site No.** 689  
**Previous Ranking** 1  
**Previous Photo References**

Roll 26 26 26  
 Frame 24 26 27

305 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 211  
**Address** 305 W. San Antonio  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R19564](#)  
**Owner** ST MARYS CATHOLIC CHURCH  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

306 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 322  
**Address** 306 W. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource has a house w/attached garage to rear (see site ID# 628).

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

306 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 628  
**Address** 306 W. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes** Garage added to west façade. House is to the rear of 306 W. San Antonio (see site ID# 322).

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

307 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 210  
**Address** 307 W. San Antonio  
**Date** 1948  
**Stylistic Influence**  
**GCAD Hyperlink** [R16843](#)  
**Owner** FLORES, P F ARCHBISHOP ARCHDIOCESSE OF SAN ANTONIO  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

308 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 321  
**Address** 308 W. San Antonio  
**Date** 1945  
**Stylistic Influence**  
**GCAD Hyperlink** [R2644](#)  
**Owner** ST MARYS CATHOLIC CHURCH  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

309 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 209  
**Address** 309 W. San Antonio  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16498](#)  
**Owner** FRANKE, EMMA M -LIFE ESTATE-D/O RUBY LEE WEIGAND ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 690  
**Previous Ranking** 3  
**Previous Photo References**

Roll 19  
 Frame 36

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

311 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 208  
**Address** 311 W. San Antonio  
**Date** 1930  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17539](#)  
**Owner** OLOUGHLIN, DANIEL D  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

313 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 207  
**Address** 313 W. San Antonio  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22572](#)  
**Owner** FRIEDRICH, JAMES P & JULIE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

314 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 320  
**Address** 314 W. San Antonio  
**Date** 1855  
**Stylistic Influence** Craftsman: Gothic Revival  
**GCAD Hyperlink** [R52005](#)  
**Owner** GILLESPIE COUNTY HISTORICAL SOCIETY  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

Former First Methodist Church, now used by the Gillespie County Historical Society. Rear addition constructed c. 1923.

1983 Historic Resources Survey	
Previous Site No.	691
Previous Ranking	2
Previous Photo References	
Roll	26 26 26
Frame	21 22 23

315 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 206  
**Address** 315 W. San Antonio  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R22017](#)  
**Owner** MILLS, GARY L & VICKYE  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

317 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 205  
**Address** 317 W. San Antonio  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R27313](#)  
**Owner** MOELLENDORF, MARGARET ETAL  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

320 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 319  
**Address** 320 W. San Antonio  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R19175](#)  
**Owner** GILLESPIE COUNTY HISTORICAL SOCIETY  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Building's exterior walls have been partially re clad with asbestos shingles. Wing added to east façade and some original windows replaced w/aluminum sash units.

### 1983 Historic Resources Survey

**Previous Site No.** 692  
**Previous Ranking** 3  
**Previous Photo References**

Roll 26  
 Frame 20

401 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 204  
**Address** 401 W. San Antonio  
**Date** 1930  
**Stylistic Influence** Tudor Revival  
**GCAD Hyperlink** [R22356](#)  
**Owner** METZGER, FREDERICK J  
**Historic District** Yes Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

402 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 318  
**Address** 402 W. San Antonio  
**Date** 1995  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14340](#)  
**Owner** SCHOPPE, GERALD C & MELINDA N  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

404 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 317  
**Address** 404 W. San Antonio  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R25966](#)  
**Owner** SCHMIDTZINSKY, ALMA -LIFE ESTATE- D/O ROY & ELMER SCHMIDTZINSKY  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

405 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 202  
 Address 405 W. San Antonio  
 Date 1900  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R28193](#)  
 Owner KIEHNE, GARY & LINDA -LIFE EST-D/O  
TERENCE N KIEHNE ETAL

Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

1983 Historic Resources Survey

Previous Site No. 693

Previous Ranking 3

Previous Photo References

Roll 20 20

Frame 3 4

405 1/2 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 203  
 Address 405 1/2 W. San Antonio  
 Date 1989  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R28193](#)  
 Owner KIEHNE, GARY & LINDA -LIFE EST-D/O  
TERENCE N KIEHNE ETAL

Historic District Yes Historic District

Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_

Previous Ranking \_\_\_\_\_

Previous Photo References

Roll \_\_\_\_\_

Frame \_\_\_\_\_

406 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 316  
 Address 406 W. San Antonio  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R20349](#)  
 Owner KNOPP & METZGER INC

Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey

Previous Site No. 694

Previous Ranking 1

Previous Photo References

Roll 26 26 26

Frame 17 18 19

407 W. San Antonio



2002 Re-evaluation

High  Medium  Low

Site ID No. 201  
 Address 407 W. San Antonio  
 Date 1904  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R22428](#)  
 Owner COX, JOSEPH P & CHARLENE

Historic District Yes Historic District

Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Original porch infilled and new primary entrance added.

1983 Historic Resources Survey

Previous Site No. 695

Previous Ranking 4

Previous Photo References

Roll 20

Frame 5

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

408 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 315  
**Address** 408 W. San Antonio  
**Date** 1860  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14449](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Heinrich Speier Home. Fachwerk portion erected c. 1860

## 1983 Historic Resources Survey

**Previous Site No.** 696  
**Previous Ranking** 1  
**Previous Photo References**

Roll 26  
 Frame 16

409 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 200  
**Address** 409 W. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

## 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

410 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 314  
**Address** 410 W. San Antonio  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14462](#)  
**Owner** CRENWELGE MOTOR SALES  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has an historic shed-roof side addition.

## 1983 Historic Resources Survey

**Previous Site No.** 697  
**Previous Ranking** 1  
**Previous Photo References**

Roll 26  
 Frame 15

412 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 313  
**Address** 412 W. San Antonio  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R14461](#)  
**Owner** CRENWELGE MOTOR SALES  
**Historic District** Yes Historic District

**Assessment** Resource is an empty lot.

**Notes** Resource is an empty lot.

## 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

413 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 199  
**Address** 413 W. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R2590](#)  
**Owner** HOLDFORTH, L F & D A LIVING TRUST  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

## 1983 Historic Resources Survey

**Previous Site No.**  
**Previous Ranking**  
**Previous Photo References**

Roll  
 Frame

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

414 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 312  
**Address** 414 W. San Antonio  
**Date** 1880  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R26899](#)  
**Owner** CRENWELGE, MILTON M  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Porch and wood-frame rear portion likely added circa 1920.

1983 Historic Resources Survey	
Previous Site No.	698
Previous Ranking	2
Previous Photo References	
Roll	26 26
Frame	13 14

415 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 198  
**Address** 415 W. San Antonio  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21490](#)  
**Owner** GILLESPIE, MICHAEL G ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	699
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	6

417 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 197  
**Address** 417 W. San Antonio  
**Date** 1998  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R61646](#)  
**Owner** BRYK, CLARENCE C & ANEDA E  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

419 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 196  
**Address** 419 W. San Antonio  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2157](#)  
**Owner** SKINNER, JUDITH A  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Despite alterations or deterioration, resource retains much of its original form and character. Alterations are sensitive to original historic appearance.

**Notes** Resource has a rear wood-frame addition.

1983 Historic Resources Survey	
Previous Site No.	700
Previous Ranking	1
Previous Photo References	
Roll	20 20 20
Frame	7 8 9

501 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 195  
**Address** 501 W. San Antonio  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R21609](#)  
**Owner** PEAKE, DAVID W & KATHERINE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	701
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	10

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

503 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 194  
**Address** 503 W. San Antonio  
**Date** 1930  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R28297](#)  
**Owner** WEIDENFELLER, TELKA ESTATE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

### 1983 Historic Resources Survey

Previous Site No. 702  
 Previous Ranking 4  
 Previous Photo References

Roll -----  
 Frame -----

505 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 193  
**Address** 505 W. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26758](#)  
**Owner** STAUDT, CLEMENS J ETUX -LIFE ESTATE- D/O SANDRA STAUDT STATON ETAL  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

A small section at the west end of the porch has been enclosed. Awnings have been added to windows on west side. A carport has been added to west side of house.

### 1983 Historic Resources Survey

Previous Site No. 703  
 Previous Ranking 3  
 Previous Photo References

Roll 20  
 Frame 11

506 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 311  
**Address** 506 W. San Antonio  
**Date** 2002  
**Stylistic Influence**  
**GCAD Hyperlink** [R69316](#)  
**Owner** BACON, JAMES L MD & SUE  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll -----  
 Frame -----

507 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 192  
**Address** 507 W. San Antonio  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R20149](#)  
**Owner** METZGER, DIANE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

Rear addition and carport added along east façade. Exterior materials has been altered to synthetic siding

### 1983 Historic Resources Survey

Previous Site No. \_\_\_\_\_  
 Previous Ranking \_\_\_\_\_  
 Previous Photo References

Roll -----  
 Frame -----

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

508 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 310  
**Address** 508 W. San Antonio  
**Date** 2002  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R69316](#)  
**Owner** PARKHURST, FREDERICK & NANCY  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

509 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 191  
**Address** 509 W. San Antonio  
**Date** 1950  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R17229](#)  
**Owner** JRS LAWN SERVICES INC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

511 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 190  
**Address** 511 W. San Antonio  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24524](#)  
**Owner** HENKE, CAROLYN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

1983 Historic Resources Survey	
Previous Site No.	704
Previous Ranking	1
Previous Photo References	
Roll	20 20
Frame	12 13

512 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 309  
**Address** 512 W. San Antonio  
**Date** 1975  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R18068](#)  
**Owner** BURNETT, MARTHA R & GUY BURNETT JR ETAL  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

514 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 308  
**Address** 514 W. San Antonio  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R25986](#)  
**Owner** PEARSON, GRAHAM D  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

1983 Historic Resources Survey	
Previous Site No.	705
Previous Ranking	2
Previous Photo References	
Roll	26 26
Frame	11 12

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

515 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 189  
**Address** 515 W. San Antonio  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R20534](#)  
**Owner** MONTGOMERY, WILLIAM S & MARY H  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Alterations are sensitive to original historic appearance.

**Notes** Large additions on rear and along east façade

1983 Historic Resources Survey			
Previous Site No.	706		
Previous Ranking	3		
Previous Photo References			
Roll	20	20	20
Frame	14	15	1

518 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 307  
**Address** 518 W. San Antonio  
**Date** 1885  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Kollett Home.

1983 Historic Resources Survey			
Previous Site No.	707		
Previous Ranking	1		
Previous Photo References			
Roll	26	26	26
Frame	6	7	8

604 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 306  
**Address** 604 W. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R27915](#)  
**Owner** WALLACE, GRACE LORAINE  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Building's exterior walls have been re clad with asbestos shingles.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

606 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 305  
**Address** 606 W. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R70794](#)  
**Owner** MEURER, JOE P ETAL % CHRISTINE & JULIA MEURER  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Building's exterior walls have been re clad with asbestos shingles.

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

607 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 188  
**Address** 607 W. San Antonio  
**Date** 1910  
**Stylistic Influence**  
**GCAD Hyperlink** [R2274](#)  
**Owner** KAISER, PATTI D  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	709
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	17

608 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 304  
**Address** 608 W. San Antonio  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R27915](#)  
**Owner** WALLACE, GRACE LORAINE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Asbestos shingles added to gable end.

1983 Historic Resources Survey	
Previous Site No.	708
Previous Ranking	4
Previous Photo References	
Roll	31
Frame	32

609 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 187  
**Address** 609 W. San Antonio  
**Date** 1980  
**Stylistic Influence**  
**GCAD Hyperlink** [R28166](#)  
**Owner** WEBER, EDGAR S  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	710
Previous Ranking	3
Previous Photo References	
Roll	20
Frame	18

610 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 303  
**Address** 610 W. San Antonio  
**Date** 1900  
**Stylistic Influence** Colonial Revival  
**GCAD Hyperlink** [R26182](#)  
**Owner** WARD, BONNIE B  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Second story of porch infilled, front gable added to porch.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

611 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 186  
**Address** 611 W. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R28164](#)  
**Owner** KADERLI, GREGORY G ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Small addition between double garage and main house.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

612 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 302  
**Address** 612 W. San Antonio  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R26184](#)  
**Owner** COBB, TIMOTHY B ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource has 2 small houses to the rear (see site ID #s 626 and 627)

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

612 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 626  
**Address** 612 W. San Antonio  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R26184](#)  
**Owner** COBB, TIMOTHY B ETUX  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** House to the rear of 612 W. San Antonio (see site ID# 302).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

612 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 627  
**Address** 612 W. San Antonio  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R26184](#)  
**Owner** COBB, TIMOTHY B ETUX  
**Historic District** Yes Historic District  
**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations.

**Notes** House to the rear of 612 W. San Antonio (see site ID# 302).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

614 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 301  
**Address** 614 W. San Antonio  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R24751](#)  
**Owner** JOHNSON, JACK E & BETTY W  
**Historic District** Yes Historic District  
**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered minor or no alterations.

**Notes** Original porch and porch posts replaced.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

615 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 185  
**Address** 615 W. San Antonio  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22911](#)  
**Owner** MOLDENHAUER, WALTER JR & KARYN  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Large addition at rear connecting original house and garage

1983 Historic Resources Survey	
Previous Site No.	711
Previous Ranking	3
Previous Photo References	
Roll	22 22
Frame	24 25

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

617 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 184  
**Address** 617 W. San Antonio  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R28073](#)  
**Owner** WANNER, CHARLES J  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

Notes

1983 Historic Resources Survey	
Previous Site No.	712
Previous Ranking	3
Previous Photo References	
Roll	22
Frame	26

714 W. San Antonio



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 917  
**Address** 714 W. San Antonio  
**Date** 1850  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22128](#)  
**Owner** MCKAY, AUGUSTA MORITZ  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

early example of vernacular residential architecture; changes include large bay window on east façade and attached guest house to the east

1983 Historic Resources Survey	
Previous Site No.	715
Previous Ranking	2
Previous Photo References	
Roll	9
Frame	34

101 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 131  
**Address** 101 E. Schubert  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R13903](#)  
**Owner** AVERY, JAMES  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

101 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 132  
**Address** 101 E. Schubert  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R13903](#)  
**Owner** AVERY, JAMES  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

102 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 30  
**Address** 102 E. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular; Victorian Italianate  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey	
Previous Site No.	718
Previous Ranking	2
Previous Photo References	
Roll	28 28 28
Frame	14 15 16

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

104 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 31

Address 104 E. Schubert

Date 1890

Stylistic Influence vernacular

GCAD Hyperlink [R24648](#)

Owner TEAGUE, HELEN T

Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes

1983 Historic Resources Survey

Previous Site No. 719

Previous Ranking 3

Previous Photo References

Roll 28

Frame 18

105 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 133

Address 105 E. Schubert

Date 1922

Stylistic Influence vernacular

GCAD Hyperlink [R9662](#)

Owner KOWERT, ARTHUR H

Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Property contributes significantly to local history or broader historical patterns. Resource was moved from its original site to its present location.

Notes Gillespie County's only schoolhouse for colored children was moved to its present location early in 1981. The building was erected on the foundation of an earlier structure built in 1877.

1983 Historic Resources Survey

Previous Site No. 720

Previous Ranking 4

Previous Photo References

Roll 14

Frame 3

106 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 32

Address 106 E. Schubert

Date 1870

Stylistic Influence vernacular

GCAD Hyperlink [R20720](#)

Owner AVERY, JAMES ETAL

Historic District Yes Historic District

Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes Original porch replaced.

1983 Historic Resources Survey

Previous Site No. 721

Previous Ranking 1

Previous Photo References

Roll 28 28 28

Frame 19 20 21

107 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 134

Address 107 E. Schubert

Date 1920

Stylistic Influence Craftsman

GCAD Hyperlink [R20697](#)

Owner KOWERT, ARTHUR H

Historic District Yes Historic District

Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes The front porch has been partially infilled.

1983 Historic Resources Survey

Previous Site No. 722

Previous Ranking 3

Previous Photo References

Roll 14

Frame 4

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 33  
**Address** 108 E. Schubert  
**Date** 1871  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13830](#)  
**Owner** HOLLIN-AVERY LTD  
**Historic District** Yes Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Despite alterations or deterioration, resource retains much of its original form and character. Outstanding decorative features contribute to the resource's significance. Considered among the most significant resources in the project area.

**Notes** Charles Jung Home. Rear addition erected c. 1977.

### 1983 Historic Resources Survey

**Previous Site No.** 723  
**Previous Ranking** 1  
**Previous Photo References**

Roll	28	28	28
Frame	22	23	24

109 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 135  
**Address** 109 E. Schubert  
**Date** 1920  
**Stylistic Influence** Queen Anne; Craftsman  
**GCAD Hyperlink** [R24863](#)  
**Owner** REICHENAU, JAMES NEIL  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 724  
**Previous Ranking** 3  
**Previous Photo References**

Roll	14
Frame	5

111 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 36  
**Address** 111 E. Schubert  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R24865](#)  
**Owner** REICHENAU, JAMES NEIL  
**Historic District** Yes Historic District

**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Resource has a small house to the rear with garage attached (see site ID # 621).

### 1983 Historic Resources Survey

**Previous Site No.** 725  
**Previous Ranking** 3  
**Previous Photo References**

Roll	14
Frame	6

111 E. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 621  
**Address** 111 E. Schubert  
**Date** 1930  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24865](#)  
**Owner** REICHENAU, JAMES NEIL  
**Historic District** Yes Historic District

**Assessment** Typical example of a common building form, architectural style, or plan type that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** House to the rear of 111 E Schubert. Garage has been built on to the resource's north façade and original windows replaced.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

112 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 34  
 Address 112 E. Schubert  
 Date 1880  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R26463](#)  
 Owner HERNDON, DEALEY D  
 Historic District Yes Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey			
Previous Site No.	726		
Previous Ranking	3		
Previous Photo References			
Roll	28	28	28
Frame	26	27	28

115 ? E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 179  
 Address 115 ? E. Schubert  
 Date  
 Stylistic Influence  
 GCAD Hyperlink  
 Owner  
 Historic District Yes Historic District  
 Assessment Resource is an empty lot.

Notes

1983 Historic Resources Survey			
Previous Site No.	_____		
Previous Ranking	_____		
Previous Photo References			
Roll	_____		
Frame	_____		

207 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 927  
 Address 207 E. Schubert  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R25384](#)  
 Owner DOBSON, CHARLES & ELYSE  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes Altered - windows, doors, asbestos; historic rear addition; side addition

1983 Historic Resources Survey			
Previous Site No.	729		
Previous Ranking	2		
Previous Photo References			
Roll	7		
Frame	23		

410 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 923  
 Address 410 E. Schubert  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R17466](#)  
 Owner MANGUM, MARGARET F  
 Historic District No Local Landmark  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey			
Previous Site No.	732		
Previous Ranking	2		
Previous Photo References			
Roll	3	3	_____
Frame	31	34	_____

507 E. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 922  
 Address 507 E. Schubert  
 Date 1870  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R19114](#)  
 Owner BELLOWS, ROY T  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey			
Previous Site No.	735		
Previous Ranking	2		
Previous Photo References			
Roll	7		
Frame	25		

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 26  
 Address 108 W. Schubert  
 Date 1960  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes 2 pools & 3 buildings

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

110 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 25  
 Address 110 W. Schubert  
 Date 2002  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink R13479  
 Owner ROGERS, HOWARD & AUDREY L  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes \_\_\_\_\_

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

110 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 24  
 Address 110 W. Schubert  
 Date 2002  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink R13479  
 Owner ROGERS, HOWARD & AUDREY L  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes \_\_\_\_\_

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

112 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 23  
 Address 112 W. Schubert  
 Date 1945  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink R19375  
 Owner HAVIGHORST, R JANSEN VON  
 Historic District No Outside Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes \_\_\_\_\_

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

204 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 22  
 Address 204 W. Schubert  
 Date 1893  
 Stylistic Influence vernacular  
 GCAD Hyperlink R13788  
 Owner JML, NO SIXTEEN LIMITED  
 Historic District No Outside Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes Henry Cordes House. Resource is a RTHL. Resource has a rear wood-frame addition and a west façade, stucco addition w/aluminum sash windows.

1983 Historic Resources Survey	
Previous Site No.	<u>736</u>
Previous Ranking	<u>2</u>
Previous Photo References	
Roll	<u>3</u>
Frame	<u>27</u>

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

208 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 21  
**Address** 208 W. Schubert  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R70658](#)  
**Owner** BARNHOUSE, WILLIAM T & JOYCE  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	737
Previous Ranking	3
Previous Photo References	
Roll	3
Frame	26

210 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 20  
**Address** 210 W. Schubert  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R70658](#)  
**Owner** BARNHOUSE, WILLIAM T & JOYCE  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

212 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 19  
**Address** 212 W. Schubert  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R67271](#)  
**Owner** CROOKS, FRED J & SHIRLEY F  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

216 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 18  
**Address** 216 W. Schubert  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R21645](#)  
**Owner** KRAUSKOPF, PATRICK ETUX  
**Historic District** No Outside Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes Resource's garage has been attached to its rear façade.

1983 Historic Resources Survey	
Previous Site No.	738
Previous Ranking	3
Previous Photo References	
Roll	3
Frame	25

302 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 17  
**Address** 302 W. Schubert  
**Date** 1855  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22164](#)  
**Owner** CLAUSI, AL S  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Splittgerber-Schneider Home. Resource has c. 1945 additions. Most original windows replaced with metal casement units and original porch replaced.

1983 Historic Resources Survey	
Previous Site No.	739
Previous Ranking	3
Previous Photo References	
Roll	3
Frame	24

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

304 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 16  
**Address** 304 W. Schubert  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R16477](#)  
**Owner** SMITH, ORALIA LEAL  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

306 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 15  
**Address** 306 W. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21192](#)  
**Owner** CLARK, RONEIL T & SANDRA D  
**Historic District** No Outside Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Outstanding decorative features contribute to the resource's significance.

Notes French doors added to rear of east façade.

1983 Historic Resources Survey	
Previous Site No.	741
Previous Ranking	2
Previous Photo References	
Roll	3
Frame	23

307 (A) W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 113  
**Address** 307 (A) W. Schubert  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22831](#)  
**Owner** FOUR-M LAND & CATTLE CO  
**Historic District** Yes Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Considered among the most significant resources in the project area.

Notes

1983 Historic Resources Survey	
Previous Site No.	742
Previous Ranking	1
Previous Photo References	
Roll	21 21 21
Frame	33 34 35

307 (B) W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 112  
**Address** 307 (B) W. Schubert  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2630](#)  
**Owner** ZELLA PROPERTIES LC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes Dormer added to gable roof

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

307 (C) W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 115  
**Address** 307 (C) W. Schubert  
**Date** 2000  
**Stylistic Influence**  
**GCAD Hyperlink** [R24471](#)  
**Owner** EBERT, KARL R  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	740
Previous Ranking	2
Previous Photo References	
Roll	_____
Frame	_____

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

307 (D) W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 116  
**Address** 307 (D) W. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22831](#)  
**Owner** FOUR-M LAND & CATTLE CO  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes** Old building form has been changed significantly

1983 Historic Resources Survey			
Previous Site No.	742		
Previous Ranking	1		
Previous Photo References			
Roll	21	21	21
Frame	33	34	35

312 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 12  
**Address** 312 W. Schubert  
**Date** 1903  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28659](#)  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes** Christian Crenwelge Place, McAdoo White Home. Resource is a RTHL.

1983 Historic Resources Survey			
Previous Site No.	744		
Previous Ranking	1		
Previous Photo References			
Roll	29	29	
Frame	22	23	

312 (rear) W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 14  
**Address** 312 (rear) W. Schubert  
**Date** 1890  
**Stylistic Influence**  
**GCAD Hyperlink** [R28659](#)  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** House is to the rear of a house addressed on Turner Street. Resource was formerly one story (per Sanborn Map). Original exterior materials materials and windows replaced. Garage added c. 1995.

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

312 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 620  
**Address** 312 W. Schubert  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28659](#)  
**Owner**  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Building is actually part of a lot addressed on Turner Street. Has a shed-roof side addition.

1983 Historic Resources Survey			
Previous Site No.			
Previous Ranking			
Previous Photo References			
Roll			
Frame			

309 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 111  
**Address** 309 W. Schubert  
**Date** 1871  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R2247](#)  
**Owner** ZELLA PROPERTIES LC  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character. Alterations are sensitive to original historic appearance.

**Notes** Additions along side and rear.  
 Recorded Historic Texas Landmark

1983 Historic Resources Survey			
Previous Site No.	743		
Previous Ranking	1		
Previous Photo References			
Roll	22	22	22
Frame	2	3	4

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

310 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 13  
**Address** 310 W. Schubert  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R28651](#)  
**Owner** REYNOLDS, ROBERT E & SANDRA G  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

403 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 110  
**Address** 403 W. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R14597](#)  
**Owner** HOERSTER, MAXIE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

A dormer window was inserted in the gable roof and a large addition was added to the west side. The windows have been changed.

1983 Historic Resources Survey	
Previous Site No.	745
Previous Ranking	3
Previous Photo References	
Roll	22 22
Frame	5 6

403 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 109  
**Address** 403 W. Schubert  
**Date** \_\_\_\_\_  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R14597](#)  
**Owner** HOERSTER, MAXIE  
**Historic District** Yes Historic District  
**Assessment** Resource is an empty lot.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

406 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 11  
**Address** 406 W. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13465](#)  
**Owner** JEFFERS, JOHN & PAMELA  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

Notes

Resource has c. 1970 east and west façade additions with vertical plywood panel exterior cladding. All original windows have been replaced with aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

408 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 10  
**Address** 408 W. Schubert  
**Date** 1870  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13943](#)  
**Owner** BILLUPS, FRANCES HEARD TRUSTEE  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity. Despite alterations or deterioration, resource retains much of its original form and character.

Notes

Original, c. 1870 portion is the log cabin and rear stone wing. Fachwerk portion added c. 1985. Porch also likely added c. 1985.

1983 Historic Resources Survey	
Previous Site No.	747
Previous Ranking	1
Previous Photo References	
Roll	7
Frame	27

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

411 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 107  
**Address** 411 W. Schubert  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R1962](#)  
**Owner** BUTTLE TRUST 1  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Alterations are sensitive to original historic appearance.

**Notes** The building has undergone major renovations. An addition has been added on the rear.

1983 Historic Resources Survey	
Previous Site No.	746
Previous Ranking	3
Previous Photo References	
Roll	22
Frame	7

412 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 9  
**Address** 412 W. Schubert  
**Date** 1935  
**Stylistic Influence**  
**GCAD Hyperlink** [R15111](#)  
**Owner** SCHMIDT, ROY W & LAVERN  
**Historic District** No Outside Historic District

**Assessment** Example of a more recent common local building form, architectural style or plan type with no known historical associations. Resource has undergone alterations.

**Notes** Original exteriors covered w/asbestos shingles and original windows replaced with single-hung, aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	748
Previous Ranking	3
Previous Photo References	
Roll	
Frame	

501 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 105  
**Address** 501 W. Schubert  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R22139](#)  
**Owner** CORBYN, RONALD C  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

501 ? W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 106  
**Address** 501 ? W. Schubert  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink** [R22139](#)  
**Owner** CORBYN, RONALD C  
**Historic District** Yes Historic District

**Assessment** Resource is an empty lot.

**Notes** Resource is an empty lot.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

505 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 104  
**Address** 505 W. Schubert  
**Date** 1920  
**Stylistic Influence**  
**GCAD Hyperlink** [R28592](#)  
**Owner** WENDEL, MARTIN CONRAD  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	749
Previous Ranking	4
Previous Photo References	
Roll	22
Frame	8

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

507 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 103  
 Address 507 W. Schubert  
 Date 1910  
 Stylistic Influence Craftsman  
 GCAD Hyperlink [R17829](#)  
 Owner JOHNSON, DOROTHY A  
 Historic District Yes Historic District  
 Assessment Example of a distinctive building plan that has undergone alterations or deterioration.

Notes The exterior siding has been altered

1983 Historic Resources Survey	
Previous Site No.	750
Previous Ranking	4
Previous Photo References	
Roll	22
Frame	9

508 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 6  
 Address 508 W. Schubert  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R22180](#)  
 Owner KILES, MERCEDES C  
 Historic District No Outside Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	751
Previous Ranking	2
Previous Photo References	
Roll	28 28
Frame	29 30

508 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 7  
 Address 508 W. Schubert  
 Date  
 Stylistic Influence  
 GCAD Hyperlink [R22184](#)  
 Owner KILES, MERCEDES C  
 Historic District No Outside Historic District  
 Assessment Resource is an empty lot.

Notes Resource is an empty lot in the 500 block of W. Schubert.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

510 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 5  
 Address 510 W. Schubert  
 Date 1890  
 Stylistic Influence vernacular  
 GCAD Hyperlink [R17030](#)  
 Owner ALEXANDER, THEODOR W ETUX  
 Historic District No Outside Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

Notes Original exterior materials covered w/asbestos shingles, original windows replaced on rear 1-story wing, large rear stone clad addition appended to rear.

1983 Historic Resources Survey	
Previous Site No.	752
Previous Ranking	2
Previous Photo References	
Roll	28 28
Frame	31 32

603 W. Schubert



2002 Re-evaluation

High  Medium  Low

Site ID No. 102  
 Address 603 W. Schubert  
 Date 1950  
 Stylistic Influence  
 GCAD Hyperlink [R22964](#)  
 Owner ZEY, EDWARD B & CHRIS J  
 Historic District Yes Historic District  
 Assessment The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

Notes

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

605 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 101  
**Address** 605 W. Schubert  
**Date** 1914  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21870](#)  
**Owner** RHEINHARDT, DELANE F &  
**Historic District** Yes Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance.

**Notes** Windows replaced with aluminum sash units.

1983 Historic Resources Survey	
Previous Site No.	753
Previous Ranking	3
Previous Photo References	
Roll	22 28
Frame	11 35

606 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 4  
**Address** 606 W. Schubert  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21394](#)  
**Owner** LEHMANN, ESTHER  
**Historic District** No Outside Historic District

**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Alterations are sensitive to original historic appearance.

**Notes** Resource has a side façade, shed roof addition and original north façade exterior staircase altered.

1983 Historic Resources Survey	
Previous Site No.	754
Previous Ranking	3
Previous Photo References	
Roll	28
Frame	36

608 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 3  
**Address** 608 W. Schubert  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21251](#)  
**Owner** RODE, ANDREW & THERESA  
**Historic District** No Outside Historic District

**Assessment** Example of a distinctive building type or architectural style that has suffered severe alterations or deterioration, resulting in a loss of historical integrity. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Garage has been attached to house also original exterior materials covered with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	755
Previous Ranking	3
Previous Photo References	
Roll	29
Frame	3

609 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 100  
**Address** 609 W. Schubert  
**Date** 2000  
**Stylistic Influence**  
**GCAD Hyperlink** [R76109](#)  
**Owner** BARTEL, RALPH E & MILDRED L  
**Historic District** Yes Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

610 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 2  
**Address** 610 W. Schubert  
**Date** 1960  
**Stylistic Influence** Ranch  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Outside Historic District

**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Building has an attached garage.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

612 W. Schubert



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 1  
**Address** 612 W. Schubert  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R21266](#)  
**Owner** TURNER, NANCY LOU  
**Historic District** No Outside Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Original exterior materials replaced. Resource also has a shed roof west façade addition.

1983 Historic Resources Survey	
Previous Site No.	756
Previous Ranking	4
Previous Photo References	
Roll	-----
Frame	-----

406 Sycamore



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 926  
**Address** 406 Sycamore  
**Date** 1905  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R50368](#)  
**Owner** ALEXANDER, GREGORY G & MARY E  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	767
Previous Ranking	2
Previous Photo References	
Roll	7
Frame	33

102 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 28  
**Address** 102 E. Travis  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	-----
Previous Ranking	-----
Previous Photo References	
Roll	-----
Frame	-----

107 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 181  
**Address** 107 E. Travis  
**Date** 1950  
**Stylistic Influence**  
**GCAD Hyperlink** [R24248](#)  
**Owner** PFEIFFER, HERBERT MRS  
**Historic District** Yes Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	-----
Previous Ranking	-----
Previous Photo References	
Roll	-----
Frame	-----

112 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 29  
**Address** 112 E. Travis  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18212](#)  
**Owner** HENKE, CECILIA H  
**Historic District** Yes Potential Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations. Resource displays distinctive stylistic elements.

**Notes** Exterior walls re clad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	768
Previous Ranking	3
Previous Photo References	
Roll	1
Frame	21

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

116 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 592  
**Address** 116 E. Travis  
**Date** 1874  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R166077](#)  
**Owner** UTLEY, O B JR ETUX  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Carl Henke Home. Resource is a Recorded Texas Historic Landmark. The building has several historic rear and side additions.

1983 Historic Resources Survey	
Previous Site No.	769
Previous Ranking	1
Previous Photo References	
Roll	1
Frame	22

202 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 594  
**Address** 202 E. Travis  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

204 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 855  
**Address** 204 E. Travis  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Outstanding decorative features contribute to the resource's significance.

**Notes** Resource has a non-historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	770
Previous Ranking	
Previous Photo References	
Roll	1
Frame	23

204 E. Travis (rear)



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 856  
**Address** 204 E. Travis (rear)  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Primary entrances are horizontal sliding glass doors and an overhead door.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

205 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 854  
**Address** 205 E. Travis  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes** Original porch posts replaced.

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

206 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 857  
**Address** 206 E. Travis  
**Date** 1880  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22548](#)  
**Owner** MITTENDORF, ALEX MRS -LEONIE-  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Resource has an historic rear addition.

### 1983 Historic Resources Survey

**Previous Site No.** 771  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 24

208 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 662  
**Address** 208 E. Travis  
**Date** 1905  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R19131](#)  
**Owner** COKER, E C FAMILY PARTNERSHIP LTD  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 772  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 25

209 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 853  
**Address** 209 E. Travis  
**Date** 1970  
**Stylistic Influence**  
**GCAD Hyperlink** [R23727](#)  
**Owner** OTTMERS, WERNER & GERTRUDE -LIFE ESTATE- D/O GERALD OTTMERS ETAL  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

210 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 661  
**Address** 210 E. Travis  
**Date** 1925  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R1539](#)  
**Owner** CHESER, GREGORY K  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a rear addition with stucco exteriors.

### 1983 Historic Resources Survey

**Previous Site No.** 773  
**Previous Ranking** 4  
**Previous Photo References**

Roll 1  
 Frame 26

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

212 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 659  
**Address** 212 E. Travis  
**Date** 1901  
**Stylistic Influence** Victorian Italianate  
**GCAD Hyperlink** [R17210](#)  
**Owner** RENFRO, WILLIAM J & JEAN  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations. Resource displays distinctive stylistic elements.

**Notes** Property is an Recorded Texas Historic Landmark. Retain original wrought iron fence. Resource has a house to the rear (see ID# 660).

### 1983 Historic Resources Survey

**Previous Site No.** 774  
**Previous Ranking** 1  
**Previous Photo References**

Roll 1  
 Frame 27

212 (rear) E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 660  
**Address** 212 (rear) E. Travis  
**Date** 1930  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R17210](#)  
**Owner** RENFRO, WILLIAM J & JEAN  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original exterior materials replaced.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

213 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 852  
**Address** 213 E. Travis  
**Date** 1930  
**Stylistic Influence** \_\_\_\_\_  
**GCAD Hyperlink** [R23259](#)  
**Owner** NEWELL, OLIVER W JR  
**Historic District** Yes Potential Historic District  
**Assessment** Typical example of a distinctive building plan that has suffered minor or no alterations.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 775  
**Previous Ranking** 4  
**Previous Photo References**

Roll 4  
 Frame 4

215 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 851  
**Address** 215 E. Travis  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R22545](#)  
**Owner** MITTENDORF, ALEX MRS -LEONIE-  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Brick cladding and chimney added to exterior walls.

### 1983 Historic Resources Survey

**Previous Site No.** 776  
**Previous Ranking** 3  
**Previous Photo References**

Roll 4  
 Frame 3

301 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 850  
**Address** 301 E. Travis  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22123](#)  
**Owner** CLARK, MARY LOIS  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** 777  
**Previous Ranking** 2  
**Previous Photo References**

Roll 4  
 Frame 2

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

302 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 657  
**Address** 302 E. Travis  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22734](#)  
**Owner** RICHEY, JOYCE K  
**Historic District** Yes Potential Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Despite alterations or deterioration, resource retains much of its original form and character.

**Notes** Original front façade porch infilled and new entry added, exterior walls reclad with stone veneer, and garage has been attached to the rear of the house. Resource has a building to the rear (see # 658).

### 1983 Historic Resources Survey

**Previous Site No.** 778  
**Previous Ranking** 4  
**Previous Photo References**

Roll 1  
 Frame 28

302 (rear) E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 658  
**Address** 302 (rear) E. Travis  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District

**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.


**Notes** Resource is a house to the rear of 302 E. Travis (see Site ID# 657).

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

303 E. Travis

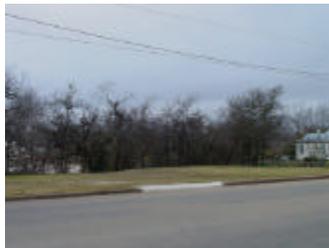

2002 Re-evaluation

High  Medium  Low

**Site ID No.** 849  
**Address** 303 E. Travis  
**Date**  
**Stylistic Influence**  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Resource is an empty lot.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

305 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 848  
**Address** 305 E. Travis  
**Date** 1925  
**Stylistic Influence**  
**GCAD Hyperlink** [R10231](#)  
**Owner** JORDAN, MAXINE  
**Historic District** Yes Potential Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes**

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

306 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 656  
**Address** 306 E. Travis  
**Date** 1940  
**Stylistic Influence**  
**GCAD Hyperlink** [R1276](#)  
**Owner** HARTMANN, MAXINE E  
**Historic District** Yes Potential Historic District

**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Rear garage has been attached, original exterior materials have been replaced, and original porch replaced.

### 1983 Historic Resources Survey

**Previous Site No.** \_\_\_\_\_  
**Previous Ranking** \_\_\_\_\_  
**Previous Photo References**

Roll \_\_\_\_\_  
 Frame \_\_\_\_\_

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

308 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 655  
**Address** 308 E. Travis  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R17851](#)  
**Owner** TAYLOR, TIM T & PAMELA  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration. Alterations are sensitive to original historic appearance.

**Notes** House has significant rear and side additions in keeping with historic fabric).

1983 Historic Resources Survey	
Previous Site No.	779
Previous Ranking	3
Previous Photo References	
Roll	1
Frame	29

309 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 846  
**Address** 309 E. Travis  
**Date** 1990  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

309 (side) E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 847  
**Address** 309 (side) E. Travis  
**Date** 1990  
**Stylistic Influence**  
**GCAD Hyperlink** [R27070](#)  
**Owner** JARREAU, JAMES W & DANITA J  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	780
Previous Ranking	3
Previous Photo References	
Roll	31
Frame	18

310 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 654  
**Address** 310 E. Travis  
**Date** 1900  
**Stylistic Influence** Queen Anne; Craftsman  
**GCAD Hyperlink** [R1678](#)  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	781
Previous Ranking	3
Previous Photo References	
Roll	1
Frame	30

311 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 845  
**Address** 311 E. Travis  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22213](#)  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Exterior wall materials and shed roof additions are historic alterations.

1983 Historic Resources Survey	
Previous Site No.	782
Previous Ranking	2
Previous Photo References	
Roll	31
Frame	17

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

312 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 651  
**Address** 312 E. Travis  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13364](#)  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** House has a rear circa 1920 addition (likely rear porch that was enclosed). Resource has two buildings to the rear (see #s 652 and 653).

1983 Historic Resources Survey	
Previous Site No.	783
Previous Ranking	2
Previous Photo References	
Roll	1
Frame	31

312 (rear) E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 652  
**Address** 312 (rear) E. Travis  
**Date** 1980  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R13364](#)  
**Owner** WEHMEYER, ROBERT M & JULI L  
**Historic District** Yes Potential Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes** Resource is to the rear of 312 E. Travis (see # 651).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

312 (rear) E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 653  
**Address** 312 (rear) E. Travis  
**Date** 1890  
**Stylistic Influence**  
**GCAD Hyperlink** [R13364](#)  
**Owner** WEHMEYER, ROBERT M & JULI L  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource seems to be an old cistern house that has been converted into living quarters. Located to the rear of 312 E. Travis (see # 651).

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

313 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 844  
**Address** 313 E. Travis  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R22215](#)  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Original porch posts replaced; exterior walls reclad with aluminum siding; and historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

402 E. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 650  
**Address** 402 E. Travis  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R17126](#)  
**Owner**  
**Historic District** Yes Potential Historic District  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	786
Previous Ranking	2
Previous Photo References	
Roll	1
Frame	32

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

404 E. Travis



2002 Re-evaluation

High  Medium  Low

Site ID No. 649  
 Address 404 E. Travis  
 Date 1910  
 Stylistic Influence Queen Anne  
 GCAD Hyperlink [R2532](#)  
 Owner \_\_\_\_\_  
 Historic District Yes Potential Historic District  
 Assessment An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

Notes

1983 Historic Resources Survey	
Previous Site No.	787
Previous Ranking	2
Previous Photo References	
Roll	1
Frame	33

408 E. Travis



2002 Re-evaluation

High  Medium  Low

Site ID No. 648  
 Address 408 E. Travis  
 Date 1910  
 Stylistic Influence Queen Anne  
 GCAD Hyperlink [R29179](#)  
 Owner \_\_\_\_\_  
 Historic District Yes Potential Historic District  
 Assessment Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

Notes Exterior walls reclad with asbestos shingles.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

408 E. Travis



2002 Re-evaluation

High  Medium  Low

Site ID No. 647  
 Address 408 E. Travis  
 Date 1910  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink [R29179](#)  
 Owner \_\_\_\_\_  
 Historic District Yes Potential Historic District  
 Assessment Typical example of a distinctive building plan that has suffered minor or no alterations.

Notes Resource has rear additions w/vertical plywood exterior siding. Some original windows replaced.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

106 W. Travis



2002 Re-evaluation

High  Medium  Low

Site ID No. 27  
 Address 106 W. Travis  
 Date 1871  
 Stylistic Influence \_\_\_\_\_  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Outside Historic District  
 Assessment Resource has undergone alterations. Property contributes significantly to local history or broader historical patterns.

Notes "Turner Social Club". Building faces onto Turner Street.

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

110 B E. Travis



2002 Re-evaluation

High  Medium  Low

Site ID No. 964  
 Address 110 B E. Travis  
 Date 1876  
 Stylistic Influence vernacular  
 GCAD Hyperlink \_\_\_\_\_  
 Owner \_\_\_\_\_  
 Historic District No Local Landmark  
 Assessment Example of a distinctive building plan that has been altered.

Notes RTHL - Fredericksburg College (1971) 1935 addition with Mission Revival influence

1983 Historic Resources Survey	
Previous Site No.	792
Previous Ranking	2
Previous Photo References	
Roll	31
Frame	20

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

206 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 944  
**Address** 206 W. Travis  
**Date** 1910  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R14861](#)  
**Owner** MAGEE, LEE  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Rear addition and non-historic guest house.

### 1983 Historic Resources Survey

**Previous Site No.** 796  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 19

302 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 943  
**Address** 302 W. Travis  
**Date** 1910  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R27001](#)  
**Owner** SIKES, BARRY D & TAMMY  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

**Notes** Non-historic rear addition; non-historic outbuilding.

### 1983 Historic Resources Survey

**Previous Site No.** 800  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 17

314 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 942  
**Address** 314 W. Travis  
**Date** 1880  
**Stylistic Influence** vernacular: Queen Anne  
**GCAD Hyperlink** [R26036](#)  
**Owner** RODE, LUTHER S  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Historic rear addition and historic rear shed.

### 1983 Historic Resources Survey

**Previous Site No.** 804  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 14

320 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 941  
**Address** 320 W. Travis  
**Date** 1905  
**Stylistic Influence** vernacular: Classical Revival  
**GCAD Hyperlink** [R24445](#)  
**Owner** PRIESS, EDWIN ALFONS  
**Historic District** No Local Landmark  
**Assessment** An outstanding, unique, or good representative example of architecture with only minor alterations or no alterations.

**Notes** Rear concrete-block addition.

### 1983 Historic Resources Survey

**Previous Site No.** 806  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 12

406 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 939  
**Address** 406 W. Travis  
**Date** 1870  
**Stylistic Influence** vernacular: Queen Anne  
**GCAD Hyperlink** [R14245](#)  
**Owner** JOHNSON, CARLOS M ETUX  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** Walter Jenschke Sunday House; historic garage and shed.

### 1983 Historic Resources Survey

**Previous Site No.** 807  
**Previous Ranking** 2  
**Previous Photo References**

Roll 1  
 Frame 11

## Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

408 W. Travis



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 938  
**Address** 408 W. Travis  
**Date** 1890  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R21593](#)  
**Owner** LOCHTE, ATLEE G  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** Historic rear addition, dilapidated hen shed, and non-historic concrete cistern building.

1983 Historic Resources Survey	
Previous Site No.	808
Previous Ranking	2
Previous Photo References	
Roll	1
Frame	10

302 E. Ufer



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 904  
**Address** 302 E. Ufer  
**Date** 1920  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R27019](#)  
**Owner** CITY OF FREDERICKSBURG  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

**Notes** metal shed additions

1983 Historic Resources Survey	
Previous Site No.	820
Previous Ranking	2
Previous Photo References	
Roll	12
Frame	32

107 N. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 612  
**Address** 107 N. Washington  
**Date** 1900  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R16097](#)  
**Owner** HAUERLAND, DIANNE  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes** Resource has a large non-historic rear addition.

1983 Historic Resources Survey	
Previous Site No.	836
Previous Ranking	2
Previous Photo References	
Roll	30 30 30
Frame	32 33 34

208 N. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 833  
**Address** 208 N. Washington  
**Date** 1960  
**Stylistic Influence**  
**GCAD Hyperlink** [R27909](#)  
**Owner** BRISBIN, WILLIAM A ETUX  
**Historic District** No Outside Historic District  
**Assessment** The resource's construction date fails to meet the age threshold for designation as a high or medium preservation priority.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	
Previous Ranking	
Previous Photo References	
Roll	
Frame	

106 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 837  
**Address** 106 S. Washington  
**Date** 1920  
**Stylistic Influence** Craftsman  
**GCAD Hyperlink** [R18839](#)  
**Owner** HOWARD, GERALD E  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building type or architectural style that has undergone alterations or deterioration.

**Notes**

1983 Historic Resources Survey	
Previous Site No.	838
Previous Ranking	3
Previous Photo References	
Roll	24
Frame	5

# Inventory of Properties - Fredericksburg Historic District and Local Landmarks (2002-03)

108 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 838  
**Address** 108 S. Washington  
**Date** 1930  
**Stylistic Influence**  
**GCAD Hyperlink** [R25607](#)  
**Owner** SCHAEFFER, ALOIS  
**Historic District** Yes Historic District  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	_____
Previous Ranking	_____
Previous Photo References	
Roll	_____
Frame	_____

301 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 898  
**Address** 301 S. Washington  
**Date** 1848  
**Stylistic Influence** vernacular  
**GCAD Hyperlink**  
**Owner**  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes

Resource is a RTHL and is known as the "Mueller-Petmecky House". Property is attached to the Fredericksburg Inn and Suites Hotel.

1983 Historic Resources Survey	
Previous Site No.	839
Previous Ranking	1
Previous Photo References	
Roll	_____
Frame	_____

607 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 907  
**Address** 607 S. Washington  
**Date** 1910  
**Stylistic Influence** vernacular  
**GCAD Hyperlink** [R24286](#)  
**Owner** WILKINSON, JOHN M JR & MONICA G  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes

1983 Historic Resources Survey	
Previous Site No.	844
Previous Ranking	2
Previous Photo References	
Roll	15
Frame	9

610 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 908  
**Address** 610 S. Washington  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R14984](#)  
**Owner** THREADGILL, RAINEY & DEANNA  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan or architectural style.

Notes

set far back from road; possibly moved to this site.

1983 Historic Resources Survey	
Previous Site No.	846
Previous Ranking	2
Previous Photo References	
Roll	15
Frame	18

611 S. Washington



2002 Re-evaluation

High  Medium  Low

**Site ID No.** 906  
**Address** 611 S. Washington  
**Date** 1900  
**Stylistic Influence** Queen Anne  
**GCAD Hyperlink** [R63559](#)  
**Owner** EDGEcombe, MELAINE J  
**Historic District** No Local Landmark  
**Assessment** Example of a distinctive building plan that has undergone alterations or deterioration.

Notes

1983 Historic Resources Survey	
Previous Site No.	847
Previous Ranking	2
Previous Photo References	
Roll	15 15
Frame	10 11

**APPENDIX C: UPDATE OF THE  
FREDERICKSBURG  
HISTORIC RESOURCES  
SURVEY OF 1983**

### Update of the Fredericksburg Historic Resources Survey of 1983

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
1	105 N. Acorn	2		525	MEDIUM
2	108 N. Acorn	1		758	MEDIUM
3	112 N. Acorn	2		757	MEDIUM
4	302 N. Acorn	3		751	MEDIUM
5	306 N. Acorn	3			MEDIUM
6	407 N. Acorn	4			LOW
7	408 N. Acorn	4			LOW
8	109 S. Acorn	4		527	LOW
9	110 S. Acorn	3		761	LOW
10	202 S. Acorn	2		762	MEDIUM
11	212 S. Acorn	2		765	MEDIUM
12	103 N. Adams	2		585	MEDIUM
13	105 N. Adams	2		584	HIGH
14	107 N. Adams	2		583	HIGH
15	109 N. Adams	2		582	HIGH
16	203 N. Adams	3	211 -? N. Adams	580	MEDIUM
17	304 N. Adams	2		819	MEDIUM
18	403 N. Adams	3		672	MEDIUM
19	407 N. Adams	3		670	MEDIUM
20	408 N. Adams	4		867	LOW
21	412 N. Adams	2		865	HIGH
22	501 N. Adams	3			MEDIUM
23	504 N. Adams	3		864	HIGH
24	506 N. Adams	3		862	HIGH
25	508 N. Adams	3		861	HIGH
26	510 N. Adams	3		860	MEDIUM
27	514 N. Adams	4		858	MEDIUM
28	515 N. Adams	3		664	LOW
29	604 N. Adams	3			MEDIUM
30	606 N. Adams	2		958	HIGH
31	610 N. Adams	3			MEDIUM
32	612 N. Adams	4			LOW
33	710 N. Adams	3			MEDIUM
34	103 S. Adams	3	101 S. Adams	586	MEDIUM
35	105 S. Adams	4		587	MEDIUM
36	109 -111 S. Adams	2	104 E. San Antonio	416	LOW
37	112 S. Adams	4			LOW
38	206 S. Adams	1		822	HIGH
39	207 S. Adams	2		589	HIGH
40	209 S. Adams	3		590	MEDIUM
41	214 S. Adams	1	210 S. Adams	823	LOW
42	402 S. Adams	2		909	HIGH
43	404 S. Adams	2		910	HIGH
44	406 S. Adams	3			MEDIUM
45	408 S. Adams	4			LOW
46	510 S. Adams	2	no longer extant		N/A
47	703 S. Adams	2		911	MEDIUM
48	604 Apple	3			MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
49	609 Apple	3			MEDIUM
50	701 Apple	3			MEDIUM
51	104 E. Austin	1		74	HIGH
52	107 E. Austin	3		169	LOW
53	108 E. Austin	3		77	HIGH
54	111 E. Austin	1		170	HIGH
55	112 E. Austin	3		79	HIGH
56	114 E. Austin	3		80	HIGH
57	115 E. Austin	4		171	LOW
58	116 E. Austin	2		81	MEDIUM
59	203 E. Austin	3		172	HIGH
60	209 E. Austin	1		174	HIGH
61	216 E. Austin	1		86	MEDIUM
62	306 E. Austin	2		88	HIGH
63	308 E. Austin	2		89	HIGH
64	314 E. Austin	4		92	MEDIUM
65	318 E. Austin	4		94	MEDIUM
66	402 E. Austin	1		96	HIGH
67	502 E. Austin	1		182	HIGH
68	805 E. Austin	2		933	HIGH
69	905 E. Austin	3			MEDIUM
70	102 W. Austin	1		71	HIGH
71	114 W. Austin	1		69	HIGH
72	202 W. Austin	4		67	LOW
73	205 W. Austin	2		162	MEDIUM
74	209 W. Austin	1		161	MEDIUM
75	302 W. Austin	3		65	MEDIUM
76	303 W. Austin	2		159	MEDIUM
77	304 W. Austin	4		64	LOW
78	309 W. Austin	3		156	MEDIUM
79	310 W. Austin	3		62	MEDIUM
80	312 W. Austin	2		61	HIGH
81	313 W. Austin	2		154	MEDIUM
82	315 W. Austin	2		153	HIGH
83	403 W. Austin	2		151	HIGH
84	405 W. Austin	2		150	HIGH
85	407 W. Austin	3		149	HIGH
86	408 W. Austin	1		58	MEDIUM
87	409 W. Austin	3		148	HIGH
88	412 W. Austin	2		57	HIGH
89	414 W. Austin	1		56	HIGH
90	415 W. Austin	2		147	MEDIUM
91	418 W. Austin	1		55	HIGH
92	420 W. Austin	1		54	HIGH
93	503 W. Austin	2		146	HIGH
94	504 W. Austin	2		52	HIGH
95	505 W. Austin	2		145	MEDIUM
96	506 W. Austin	2	508 W. Austin	51	HIGH
97	507 W. Austin	2		144	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
98	508 W. Austin	3	510 W. Austin	50	LOW
99	509 W. Austin	2		143	MEDIUM
100	512 W. Austin	3		49	MEDIUM
101	513 W. Austin	3		141	HIGH
102	514 W. Austin	2		48	HIGH
103	515 W. Austin	3		140	MEDIUM
104	518 W. Austin	3		46	MEDIUM
105	522 W. Austin	2		45	MEDIUM
106	524 W. Austin	4		44	MEDIUM
107	602 W. Austin	1		43	MEDIUM
108	607 W. Austin	2		137	HIGH
109	608 W. Austin	3		40	MEDIUM
110	609 W. Austin	2		136	MEDIUM
111	612 W. Austin	4		38	LOW
112	702 W. Austin	3		756	HIGH
113	708 W. Austin	4			LOW
115	712 W. Austin	4			LOW
114	713 W. Austin	3			MEDIUM
116	714 W. Austin	4			LOW
117	809 W. Austin	4			LOW
118	813 W. Austin	3			MEDIUM
119	601 Bell	3			MEDIUM
120	801 Bell	3			MEDIUM
121	810 Bell	4			LOW
122	901 Bell	3			MEDIUM
123	904 Bell	4			LOW
124	905 Bell	4			LOW
125	907 Bell	4			LOW
126	913 Bell	3			MEDIUM
127	917 Bell	3			MEDIUM
128	921 Bell	3			MEDIUM
129	922 Bell	3			MEDIUM
130	110 N. Bowie	1		771	HIGH
131	204 N. Bowie	2		770	HIGH
132	206 N. Bowie	2		769	HIGH
133	209 N. Bowie	2		531	MEDIUM
134	210 N. Bowie	1		768	HIGH
135	202 S. Bowie	2		775	MEDIUM
136	206 S. Bowie	2		776	MEDIUM
137	207 S. Bowie	2		535	LOW
138	310 S. Bowie	3		779	MEDIUM
143	40 ? Burbank	2	407 W. Burbank	946	MEDIUM
139	108 E. Burbank	4			LOW
140	205 E. Burbank	4			LOW
141	211 W. Burbank	2		947	MEDIUM
142	214 W. Burbank	3			MEDIUM
144	104 E. Centre	2		953	HIGH
145	106 E. Centre	3			MEDIUM
146	112 E. Centre	1		954	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
147	206 E. Centre	2		930	HIGH
148	208 E. Centre	3			MEDIUM
149	209 E. Centre	3			MEDIUM
150	212 E. Centre	3			MEDIUM
151	310 E. Centre	3			MEDIUM
152	404 E. Centre	3			MEDIUM
153	405 E. Centre	3			MEDIUM
154	104 W. Centre	4			LOW
155	110 W. Centre	2		952	HIGH
156	112 W. Centre	3			MEDIUM
157	203 W. Centre	2		951	HIGH
158	104 N. Cherry	2		935	HIGH
159	108 N. Cherry	2	110 N. Cherry	936	MEDIUM
160	211 N. Cherry	2		937	MEDIUM
161	102 S. Cherry	2		919	MEDIUM
162	204 S. Cherry	3			MEDIUM
163	206 E. College	4			LOW
164	207 E. College	4			LOW
165	302 E. College	3			MEDIUM
166	320 E. College	2	312 E. College	925	HIGH
167	401 E. College	4			LOW
168	408 E. College	2		924	MEDIUM
169	409 E. College	3			MEDIUM
170	413 E. College	4			LOW
171	419 E. College	4			LOW
172	106 W. College	3			MEDIUM
173	112 W. College	2		950	HIGH
174	208 W. College	3			MEDIUM
175	216 W. College	3			MEDIUM
176	226 W. College	4			LOW
177	303 W. College	3			MEDIUM
178	305 W. College	3			MEDIUM
179	306 W. College	2		948	HIGH
180	307 W. College	3			MEDIUM
181	311 W. College	3			MEDIUM
182	313 W. College	3			MEDIUM
183	315 W. College	3			MEDIUM
184	409 W. College	3			MEDIUM
185	410 W. College	3			MEDIUM
186	502 W. College	3			MEDIUM
187	506 W. College	3			MEDIUM
188	514 W. College	3			MEDIUM
189	110 S. Columbus	4			LOW
190	207 S. Columbus	4			LOW
191	210 S. Columbus	3			MEDIUM
192	402 Cora	2		613	MEDIUM
193	403 Cora	3		680	HIGH
194	405 Cora	3		679	HIGH
195	407 Cora	3		678	MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
196	408 Cora	2		878	HIGH
197	409 Cora	3		677	MEDIUM
198	506 Cora	3		874	HIGH
199	512 Cora	3		870	MEDIUM
200	103 E. Creek	2		516	MEDIUM
201	106 E. Creek	2		509	MEDIUM
202	107 E. Creek	3		514	MEDIUM
203	110 E. Creek	2		511	HIGH
204	110 -B E. Creek	2		512	HIGH
205	111 E. Creek	4		513	LOW
206	201 E. Creek	4		881	LOW
207	205 E. Creek	2		882	HIGH
208	207 E. Creek	3		883	HIGH
209	209 E. Creek	4		884	MEDIUM
210	210 E. Creek	3		889	LOW
211	211 E. Creek	4		885	LOW
212	213 E. Creek	2		886	MEDIUM
213	401 E. Creek	1		899	HIGH
214	501 E. Creek	3			MEDIUM
215	507 E. Creek	3			MEDIUM
216	510 E. Creek	3			MEDIUM
217	601 E. Creek	3			MEDIUM
218	603 E. Creek	4			LOW
219	604 E. Creek	3			MEDIUM
220	605 E. Creek	3			MEDIUM
221	201 S. Creek	3			MEDIUM
222	205 S. Creek	4			LOW
223	307 S. Creek	3			MEDIUM
224	405 S. Creek	3			MEDIUM
225	603 S. Creek	1		934	HIGH
665	601 E. San Antonio	2	608 S. Creek	903	LOW
226	101 W. Creek	2		517	MEDIUM
227	103 W. Creek	2		518	MEDIUM
228	104 W. Creek	4		508	MEDIUM
229	105 W. Creek	3		750	HIGH
230	106 W. Creek	3		507	MEDIUM
231	112 W. Creek	3		505	HIGH
232	113 W. Creek	3		746	MEDIUM
233	115 W. Creek	2		745	MEDIUM
234	119 W. Creek	2		744	HIGH
235	203 W. Creek	2		741	MEDIUM
236	204 W. Creek	2		502	MEDIUM
237	206 W. Creek	2		501	MEDIUM
238	207 W. Creek	1		739	MEDIUM
239	208 W. Creek	3		500	MEDIUM
240	210 W. Creek	3		499	HIGH
241	211 W. Creek	3		738	MEDIUM
242	212 W. Creek	2		498	MEDIUM
243	213 W. Creek	1		737	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
244	223 W. Creek	1		733	LOW
245	301 W. Creek	2		732	MEDIUM
246	305 W. Creek	3		731	HIGH
247	311 W. Creek	2		730	HIGH
248	314 W. Creek	1		496	HIGH
249	317 W. Creek	2		727	MEDIUM
250	319 W. Creek	3		726	MEDIUM
251	401 W. Creek	3		724	MEDIUM
252	403 W. Creek	2		723	HIGH
253	407 W. Creek	3	405 W. Creek	722	LOW
254	409 W. Creek	2		721	HIGH
255	413 W. Creek	2		719	HIGH
256	414 W. Creek	3		494	MEDIUM
257	418 W. Creek	3		489	LOW
258	501 W. Creek	3		718	LOW
259	504 W. Creek	2		487	HIGH
260	506 W. Creek	4		486	LOW
261	508 W. Creek	4		485	LOW
262	511 W. Creek	3		714	MEDIUM
263	512 W. Creek	1		484	HIGH
264	513 W. Creek	3		713	HIGH
265	518 W. Creek	3		481	LOW
266	605 W. Creek	1	601 W. Creek	710	HIGH
267	606 W. Creek	3		480	HIGH
268	610 W. Creek	2		478	HIGH
268	610 W. Creek	2		487	HIGH
269	611 W. Creek	3			MEDIUM
270	613 W. Creek	3		707	HIGH
271	614 W. Creek	3		476	LOW
272	615 W. Creek	2		706	HIGH
273	714 W. Creek	4			LOW
274	716 W. Creek	3			MEDIUM
275	112 N. Crockett	1		810	HIGH
276	114 N. Crockett	1		809	MEDIUM
277	206 N. Crockett	4		807	MEDIUM
278	604 N. Crockett	3			MEDIUM
279	908 N. Crockett	3			MEDIUM
280	120 S. Crockett	4			LOW
281	204 S. Crockett	1		813	HIGH
282	210 S. Crockett	2	208 S. Crockett	815	MEDIUM
283	211 S. Crockett	3		576	MEDIUM
284	212 S. Crockett	1		816	HIGH
285	406 Cross Mountain	4			LOW
286	502 Cross Mountain	4			LOW
287	509 ? Cross Mountain	4			LOW
288	105 N. Edison	4			LOW
289	110 N. Edison	2		785	HIGH
290	112 N. Edison	2		784	HIGH
291	304 N. Edison	4			LOW

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
292	604 N. Edison	3			MEDIUM
293	105 S. Edison	2		540	MEDIUM
294	106 S. Edison	3		788	MEDIUM
295	207 S. Edison	4		543	LOW
296	710 Elite	2		912	HIGH
297	104 S. Elk	3		840	MEDIUM
298	107 S. Elk	3		616	MEDIUM
299	108 S. Elk	4		842	LOW
300	207 S. Elk	4			LOW
301	605 Franklin	4			LOW
302	606 Franklin	4			LOW
303	705 Franklin	3			MEDIUM
304	801 Franklin	4			LOW
305	803 Franklin	3			MEDIUM
306	906 Franklin	3			MEDIUM
307	309 Fulton	3			MEDIUM
308	401 Fulton	2		915	HIGH
309	405 Fulton	3			MEDIUM
310	410 Fulton	3			MEDIUM
311	508 Fulton	3			MEDIUM
312	205 Goehmann	2		962	MEDIUM
313	404 ? Granite	4			LOW
314	504 Granite	3			MEDIUM
315	510 Granite	2		905	MEDIUM
316	101 E. Hackberry	2		955	HIGH
317	107 E. Hackberry	4			LOW
318	205 E. Hackberry	3			MEDIUM
319	212 E. Hackberry	4			LOW
320	101 W. Hackberry	4			LOW
321	111 W. Hackberry	3			MEDIUM
322	112 W. Hackberry	3			MEDIUM
323	209 W. Hackberry	4			LOW
324	210 W. Hackberry	3			MEDIUM
325	211 W. Hackberry	3			MEDIUM
326	102 Hale	3			MEDIUM
327	209 Hale	4			LOW
328	301 Hale	3			MEDIUM
329	305 Hale	3			MEDIUM
330	319 Hale	3			MEDIUM
331	112 ? E. Highway	2	112 E. Highway	913	HIGH
332	312 E. Highway	3			MEDIUM
333	918 E. Highway	3			MEDIUM
334	101 ? Jung	3			MEDIUM
335	103 ? Jung	3			MEDIUM
336	105 ? Jung	4			LOW
337	302 Kay	2		959	HIGH
338	504 -506 . Kraupahen	4			LOW
339	Lady Bird Johnson Park	2		921	MEDIUM
340	106 S. Lee	3			MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
341	101 N. Lincoln	1		608	HIGH
342	102 N. Lincoln	4		830	MEDIUM
343	108 N. Lincoln	3		175	LOW
352		4			LOW
344	106 S. Lincoln	1		831	HIGH
345	107 S. Lincoln	1		610	HIGH
346	111 S. Lincoln	4		611	LOW
347	203 S. Lincoln	3		897	MEDIUM
348	206 S. Lincoln	3			MEDIUM
351	300 block S. Lincoln	3			MEDIUM
349	305 S. Lincoln	3		595	HIGH
349	305 S. Lincoln	3		896	LOW
350	306 S. Lincoln	4		894	MEDIUM
353	415 S. Lincoln	3			MEDIUM
354	505 S. Lincoln	3			MEDIUM
355	105 E. Live Oak	3			MEDIUM
356	405 E. Live Oak	3			MEDIUM
357	103 ? W. Live Oak	3			MEDIUM
358	302 W. Live Oak	3			MEDIUM
359	103 N. Llano	4		602	LOW
360	105 N. Llano	3		601	MEDIUM
361	109 -111 N. Llano	4	109 N. Llano	599	MEDIUM
362	201 N. Llano	2		598	MEDIUM
363	305 N. Llano	4			LOW
364	408 N. Llano	2		956	HIGH
365	413 N. Llano	1		928	HIGH
366	501 N. Llano	2		929	MEDIUM
367	502 N. Llano	2		957	HIGH
368	602 N. Llano	3			MEDIUM
369	608 N. Llano	3			MEDIUM
370	609 N. Llano	1		931	HIGH
371	711 N. Llano	1		932	HIGH
372	803 N. Llano	3			MEDIUM
373	812 N. Llano	4			LOW
374	902 N. Llano	4			LOW
375	1004 N. Llano	3			MEDIUM
376	103 S. Llano	2		603	HIGH
377	105 S. Llano	2		604	MEDIUM
378	107 S. Llano	3		605	LOW
379	112 S. Llano	4		827	HIGH
380	208 S. Llano	2		829	MEDIUM
381	306 S. Llano	3			MEDIUM
382	101 -103 E. Main	2	101 E. Main	268	HIGH
383	102 -104 E. Main	3	102 E. Main	366	MEDIUM
384	109 -111 E. Main	2	107 -109 E. Main	269	MEDIUM
385	115 -117 E. Main	2	115 E. Main	271	HIGH
386	119 E. Main	3		272	HIGH
387	120 (122) E. Main	1	118 -120 E. Main	371	HIGH
388	121 E. Main	3		273	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
389	123 -125 E. Main	1	123 E. Main	274	HIGH
390	124 E. Main	2		373	HIGH
391	126 E. Main	2	128 E. Main	374	LOW
392	127 E. Main	4		275	MEDIUM
393	131 -133 E. Main	3	131 E. Main	276	MEDIUM
394	134 -136 E. Main	4	138 E. Main	376	MEDIUM
395	137 E. Main	2	141 E. Main	277	HIGH
396	138 E. Main	4	142 E. Main	377	LOW
397	139 E. Main	3	143 E. Main	278	MEDIUM
398	142 E. Main	3	146 E. Main	378	HIGH
399	143 -145 E. Main	4	147 -149 E. Main	280	HIGH
400	147 E. Main	4	151 E. Main	281	LOW
401	201 E. Main	4		284	LOW
402	202 E. Main	3	204 E. Main	380	LOW
403	205 -207 E. Main	2	203 -207 E. Main	285	HIGH
404	208 E. Main	4	206 E. Main	381	LOW
405	217 E. Main	4		287	LOW
406	218 E. Main	2		384	MEDIUM
407	221 E. Main	2		288	HIGH
408	222 E. Main	1		385	HIGH
409	223 E. Main	3		458	HIGH
410	223 -227 E. Main	2	229 E. Main	457	HIGH
411	229 -231 E. Main	3	231 -235 E. Main	456	HIGH
412	230 -232 E. Main	3	230 E. Main	386	MEDIUM
413	235 E. Main	4	239 E. Main	455	LOW
414	241 -245 E. Main	3	245 E. Main	454	HIGH
415	242 E. Main	1		388	HIGH
416	244 E. Main	1	248 E. Main	389	HIGH
417	247 E. Main	1		453	HIGH
418	251 E. Main	3	249 A/B E. Main	452	HIGH
419	252 E. Main	2		390	HIGH
420	254 E. Main	1		391	HIGH
421	258 E. Main	3		392	HIGH
422	302 E. Main	2		393	HIGH
423	308 E. Main	2	310 E. Main	395	HIGH
424	310 E. Main	1	312 E. Main	396	HIGH
425	315 E. Main	3		449	HIGH
426	319 E. Main	3		448	HIGH
427	320 E. Main	4	320 -322 E. Main	398	MEDIUM
428	322 E. Main	3	324 E. Main	399	HIGH
429	323 -325 E. Main	4	323 E. Main	446	LOW
430	327 E. Main	2		445	HIGH
431	328 E. Main	3		401	MEDIUM
432	329 E. Main	2		443	MEDIUM
433	335 -337 E. Main	3	339 E. Main	441	LOW
434	340 E. Main	3		177	LOW
434	340 E. Main	3	328 E. Main	402	MEDIUM
435	403 E. Main	4		439	MEDIUM
436	407 E. Main	1	405 E. Main	438	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
437	411 E. Main	3		436	HIGH
438	412 E. Main	1	414 E. Main	406	MEDIUM
438	412 E. Main	1		405	LOW
439	413 E. Main	3		435	MEDIUM
440	415 E. Main	2		434	HIGH
441	417 E. Main	3		433	HIGH
442	418 E. Main	3		408	MEDIUM
443	421 E. Main	4		431	LOW
444	422 E. Main	2	424 E. Main	409	MEDIUM
445	502 E. Main	4		410	MEDIUM
446	506 E. Main	3			MEDIUM
447	509 E. Main	2	511 E. Main	963	HIGH
448	510 E. Main	4			LOW
449	513 E. Main	2	no longer extant		N/A
450	515 E. Main	3			MEDIUM
451	517 E. Main	4			LOW
452	600 E. Main	2		961	HIGH
453	606 E. Main	3			MEDIUM
454	607 E. Main	3			MEDIUM
455	610 E. Main	3			MEDIUM
456	703 E. Main	4			LOW
457	710 E. Main	4			LOW
458	801 E. Main	3			MEDIUM
459	805 E. Main	4			LOW
460	1101 E. Main	4			LOW
461	1108 E. Main	3			MEDIUM
462	1201 E. Main	4			LOW
463	1211 E. Main	4			LOW
464	101 W. Main	3		267	HIGH
465	104 -106 W. Main	4	108 W. Main	365	LOW
466	115 W. Main	1		266	HIGH
467	118 W. Main	4			LOW
468	125 W. Main	4		265	HIGH
469	206 W. Main	1		362	HIGH
470	210 -212 W. Main	1	214 -216 W. Main	361	HIGH
471	211 W. Main	3		263	MEDIUM
472	215 W. Main	2		261	MEDIUM
473	218 W. Main	1		384	MEDIUM
474	219 W. Main	2		260	HIGH
475	221 W. Main	3		259	MEDIUM
476	222 W. Main	2	234 W. Main	357	LOW
477	225 W. Main	3		257	MEDIUM
478	231 W. Main	3	229 -231 W. Main	256	MEDIUM
479	240 -242 W. Main	2		355	HIGH
480	244 W. Main	2		354	HIGH
481	301 W. Main	2		253	MEDIUM
482	303 W. Main	2		252	LOW
483	307 W. Main	2		250	HIGH
484	309 W. Main	1		239	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
485	320 W. Main	1	312 W. Main	352	MEDIUM
486	328 W. Main	1		351	HIGH
487	330 W. Main	1		350	HIGH
488	342 W. Main	2	340 W. Main	347	MEDIUM
489	402 W. Main	1		346	MEDIUM
490	406 W. Main	2		345	HIGH
491	410 W. Main	2		343	MEDIUM
492	415 -417 W. Main	1	415 W. Main	233	HIGH
493	418 W. Main	3		341	HIGH
494	419 W. Main	2		232	HIGH
495	421 W. Main	2		231	HIGH
496	422 W. Main	3		340	MEDIUM
497	424 W. Main	3		629	MEDIUM
498	425 -427 W. Main	1	425 W. Main	230	MEDIUM
499	426 W. Main	1	424 W. Main	339	MEDIUM
500	505 W. Main	3		228	HIGH
501	508 W. Main	1		337	HIGH
502	511 W. Main	3		225	HIGH
503	512 W. Main	3		336	HIGH
504	513 W. Main	3	515 W. Main	224	LOW
505	516 W. Main	3		335	HIGH
506	601 W. Main	2		221	HIGH
507	602 W. Main	1		331	HIGH
508	604 W. Main	4			LOW
509	605 W. Main	2	no longer extant	220	N/A
510	609 W. Main	3		218	HIGH
511	611 W. Main	4		217	MEDIUM
512	616 W. Main	3		327	HIGH
513	619 W. Main	2		215	HIGH
514	622 W. Main	1	618 W. Main	326	HIGH
523	701 W. Main	1		213	HIGH
524	706 W. Main	3			MEDIUM
525	708 W. Main	3			MEDIUM
526	709 W. Main	1		960	HIGH
527	711 W. Main	3			MEDIUM
528	714 W. Main	2		918	HIGH
529	801 W. Main	4			LOW
530	804 W. Main	3			MEDIUM
531	809 W. Main	3			MEDIUM
532	811 W. Main	2		920	HIGH
533	108 S. Mesquite	4			LOW
534	502 S. Mesquite	3			MEDIUM
535	512 S. Mesquite	3			MEDIUM
547		3			MEDIUM
546		4			LOW
536	108 N. Milam	4	108 -1/2 N. Milam	794	MEDIUM
537	201 N. Milam	3			MEDIUM
538	205 N. Milam	2		546	HIGH
539	404 N. Milam	2		940	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
540	406 N. Milam	2	no longer extant		N/A
541	407 N. Milam	4			LOW
542	409 N. Milam	3			MEDIUM
543	501 N. Milam	4			LOW
544	505 N. Milam	4			LOW
545	608 N. Milam	2		945	HIGH
548	1404 N. Milam	3			MEDIUM
549	104 S. Milam	1		795	MEDIUM
550	106 S. Milam	2		796	MEDIUM
551	108 S. Milam	1		797	MEDIUM
552	209 S. Milam	2		554	MEDIUM
553	305 S. Milam	3		555	MEDIUM
554	306 S. Milam	2		799	MEDIUM
555	405 S. Milam	3			MEDIUM
556	410 S. Milam	1		916	HIGH
557	411 S. Milam	3			MEDIUM
558	412 S. Milam	3			MEDIUM
559	420 S. Milam	4			LOW
560	201 Mistletoe	3		117	HIGH
561	201 rear Mistletoe	1		118	HIGH
562	203 Mistletoe	3		119	MEDIUM
563	207 Mistletoe	3		121	MEDIUM
564	208 Mistletoe	3		128	LOW
565	209 Mistletoe	3		122	MEDIUM
566	211 Mistletoe	3		123	MEDIUM
567	213 Mistletoe	4		124	MEDIUM
568	215 Mistletoe	4		125	MEDIUM
569	101 E. Morse	3			MEDIUM
570	105 E. Morse	4			LOW
571	106 E. Morse	3			MEDIUM
572	205 E. Morse	3			MEDIUM
573	207 E. Morse	3			MEDIUM
574	208 E. Morse	4			LOW
575	303 E. Morse	3			MEDIUM
576	304 E. Morse	3			MEDIUM
577	405 E. Morse	3			MEDIUM
578	102 W. Morse	4			LOW
579	109 W. Morse	3			MEDIUM
580	113 W. Morse	3			MEDIUM
581	114 W. Morse	4			LOW
582	115 W. Morse	3			MEDIUM
583	208 W. Morse	3			MEDIUM
584	212 W. Morse	2		949	HIGH
585	308 W. Morse	4			LOW
586	318 W. Morse	4			LOW
587	511 Mueller	3			MEDIUM
588	102 N. Olive	3			MEDIUM
589	107 N. Orange	1		561	HIGH
590	109 N. Orange	2		560	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
590	109 N. Orange	2		683	MEDIUM
590	109 N. Orange	2		684	MEDIUM
591	205 N. Orange	4		559	MEDIUM
592	208 N. Orange	3	206 N. Orange	800	MEDIUM
593	301 N. Orange	4	305 N. Orange	556	MEDIUM
594	404 N. Orange	4			LOW
595	406 N. Orange	3			MEDIUM
596	610 N. Orange	3			MEDIUM
597	702 N. Orange	3			MEDIUM
598	706 N. Orange	4			LOW
599	203 S. Orange	4		568	LOW
600	205 S. Orange	2		569	HIGH
601	304 S. Orange	4		803	MEDIUM
602	305 S. Orange	3		573	LOW
603	422 S. Orange	4			LOW
604	110 E. Orchard	4			LOW
605	208 E. Orchard	3			MEDIUM
606	210 E. Orchard	3			MEDIUM
607	212 E. Orchard	3			MEDIUM
607	214 E. Orchard	3			MEDIUM
609	302 E. Orchard	3			MEDIUM
610	304 E. Orchard	4			LOW
611	408 E. Orchard	3			MEDIUM
612	409 E. Orchard	4			LOW
614	425 E. Orchard	4			LOW
613	501 E. Orchard	4			LOW
615	206 W. Orchard	3			MEDIUM
616	208 W. Orchard	4			LOW
617	211 W. Orchard	4			LOW
618	212 W. Orchard	3			MEDIUM
619	318 W. Orchard	4			LOW
620	320 W. Orchard	3			MEDIUM
621	110 W. Park	3			MEDIUM
622	201 W. Park	2		914	HIGH
623	202 Peach	4			LOW
624	207 Peach	3			MEDIUM
625	208 Peach	3			MEDIUM
626	209 Peach	4			LOW
627	212 Peach	3			MEDIUM
628	213 Peach	4			LOW
629	216 Peach	3			MEDIUM
630	507 Peach	3			MEDIUM
631	515 Peach	3			MEDIUM
632	516 Peach	3			MEDIUM
633	517 Peach	3			MEDIUM
634	601 Peach	3			MEDIUM
635	604 Peach	3			MEDIUM
636	403 Pecan	3			MEDIUM
637	404 Pecan	3			MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
638	408 Pecan	3			MEDIUM
639	508 Pecan	4			LOW
640	410 Pine	4			LOW
641	115 ? Pioneer Plaza	1		167	HIGH
642	406 Plum	3			MEDIUM
643	413 Plum	4			LOW
644	703 Poplar	3			MEDIUM
645	707 ? Poplar	4			LOW
646	109 E. San Antonio	1		704	HIGH
647	110 E. San Antonio	3		417	HIGH
648	115 E. San Antonio	1	113 E. San Antonio	473	HIGH
649	117 E. San Antonio	3		472	HIGH
650	207 E. San Antonio	2		469	HIGH
651	209 E. San Antonio	2		468	HIGH
652	210 E. San Antonio	2	208 E. San Antonio	418	MEDIUM
653	213 E. San Antonio	3		466	MEDIUM
654	216 E. San Antonio	1		420	MEDIUM
655	301 E. San Antonio	4		465	LOW
656	304 E. San Antonio	3		422	MEDIUM
657	307 E. San Antonio	3		462	MEDIUM
658	308 E. San Antonio	3		424	MEDIUM
659	311 E. San Antonio	3		460	HIGH
660	313 E. San Antonio	3		459	MEDIUM
661	314 E. San Antonio	3		426	HIGH
662	501 E. San Antonio	4		617	MEDIUM
663	510 E. San Antonio	2		900	MEDIUM
664	517 E. San Antonio	2		901	HIGH
665	601 E. San Antonio	2	608 S. Creek	903	LOW
666	607 E. San Antonio	3			MEDIUM
667	611 E. San Antonio	2		902	MEDIUM
668	614 E. San Antonio	4			LOW
669	615 E. San Antonio	3			MEDIUM
670	618 E. San Antonio	3			MEDIUM
671	620 E. San Antonio	4			LOW
672	709 E. San Antonio	4			LOW
673	711 E. San Antonio	4			LOW
674	802 E. San Antonio	4			LOW
675	105 W. San Antonio	1		702	HIGH
676	107 W. San Antonio	2		701	HIGH
677	117 W. San Antonio	1		298	HIGH
678	119 W. San Antonio	4		297	MEDIUM
679	121 W. San Antonio	2		296	HIGH
680	123 W. San Antonio	4		295	MEDIUM
681	125 W. San Antonio	1		294	HIGH
682	203 W. San Antonio	2		293	HIGH
683	207 W. San Antonio	2		292	MEDIUM
684	209 W. San Antonio	1		291	MEDIUM
685	211 W. San Antonio	1		290	HIGH
686	212 W. San Antonio	2		411	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
687	214 W. San Antonio	2		566	HIGH
688	302 W. San Antonio	1		324	HIGH
689	304 W. San Antonio	1		323	HIGH
690	309 W. San Antonio	3		209	MEDIUM
691	312 W. San Antonio	2	314 W. San Antonio	320	HIGH
692	320 W. San Antonio	3		319	LOW
693	405 W. San Antonio	3		202	LOW
694	406 W. San Antonio	1		316	HIGH
695	407 W. San Antonio	4		201	LOW
696	408 W. San Antonio	1		315	HIGH
697	410 W. San Antonio	1		314	HIGH
698	414 W. San Antonio	2		312	HIGH
699	415 W. San Antonio	3		198	MEDIUM
700	419 W. San Antonio	1		196	HIGH
701	501 W. San Antonio	3		195	MEDIUM
702	503 W. San Antonio	4		194	LOW
703	505 W. San Antonio	3		193	MEDIUM
704	511 W. San Antonio	1		190	MEDIUM
705	514 W. San Antonio	2		308	MEDIUM
706	517 W. San Antonio	3	515 W. San Antonio	189	MEDIUM
707	518 W. San Antonio	1		307	HIGH
708	604 -606-608 W. San Antonio	4	608 W. San Antonio	304	MEDIUM
709	607 W. San Antonio	3		188	MEDIUM
710	609 W. San Antonio	3		187	LOW
711	615 W. San Antonio	3		185	MEDIUM
712	617 W. San Antonio	3		184	HIGH
713	711 W. San Antonio	3			MEDIUM
714	712 W. San Antonio	4			LOW
715	714 W. San Antonio	1		917	MEDIUM
716	807 W. San Antonio	4			LOW
717	101 E. Schubert	3			LOW
718	102 E. Schubert	2		30	HIGH
719	104 E. Schubert	3		31	HIGH
720	105 E. Schubert	4		133	HIGH
721	106 E. Schubert	1		32	HIGH
722	107 E. Schubert	3		134	LOW
723	108 E. Schubert	1		33	MEDIUM
724	109 E. Schubert	3		135	MEDIUM
725	111 E. Schubert	3		36	MEDIUM
726	112 E. Schubert	3		34	HIGH
727	202 E. Schubert	3			MEDIUM
728	205 E. Schubert	4			LOW
729	207 E. Schubert	2		927	LOW
730	404 E. Schubert	3			MEDIUM
731	408 E. Schubert	3			MEDIUM
732	410 E. Schubert	2		923	HIGH
733	416 E. Schubert	3			MEDIUM
734	506 E. Schubert	3			MEDIUM
735	507 E. Schubert	2		922	MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
736	204 W. Schubert	2		22	MEDIUM
737	208 -210 W. Schubert	3	208 W. Schubert	21	LOW
738	216 W. Schubert	3		18	MEDIUM
739	302 W. Schubert	3		17	MEDIUM
740	303 W. Schubert	2	307 (C) W. Schubert	115	LOW
741	306 W. Schubert	2		15	HIGH
742	307 W. Schubert	1	307 (A) W. Schubert	113	HIGH
742	307 W. Schubert	1	307 (D) W. Schubert	116	LOW
743	309 W. Schubert	1		111	HIGH
744	312 W. Schubert	1		12	HIGH
745	403 W. Schubert	3		110	LOW
746	407 W. Schubert	3	411 W. Schubert	107	MEDIUM
747	408 W. Schubert	1		10	MEDIUM
748	412 W. Schubert	3		9	LOW
749	505 W. Schubert	4		104	LOW
750	507 W. Schubert	4		103	LOW
751	508 W. Schubert	2		6	HIGH
752	510 W. Schubert	2		5	MEDIUM
753	605 W. Schubert	3		101	MEDIUM
754	606 W. Schubert	3		4	HIGH
755	608 W. Schubert	3		3	MEDIUM
756	612 W. Schubert	4		1	LOW
757	705 W. Schubert	3			MEDIUM
758	706 W. Schubert	3			MEDIUM
759	710 W. Schubert	3			MEDIUM
760	309 Shaw	3			MEDIUM
761	409 Spruce	3			MEDIUM
762	510 St. Geralda	3			MEDIUM
763	502 St. Mary	3			MEDIUM
764	516 St. Mary	3			MEDIUM
765	518 St. Mary	3			MEDIUM
766	405 Sycamore	3			MEDIUM
767	406 Sycamore	2		926	HIGH
768	112 E. Travis	3		29	MEDIUM
769	116 E. Travis	1		592	HIGH
770	204 E. Travis	2		855	MEDIUM
771	206 E. Travis	2		857	HIGH
772	208 E. Travis	2		662	HIGH
773	210 E. Travis	4		661	MEDIUM
774	212 E. Travis	1		659	HIGH
775	213 E. Travis	4		852	MEDIUM
776	215 E. Travis	3		851	LOW
777	301 E. Travis	2		850	MEDIUM
778	302 E. Travis	4		657	MEDIUM
779	308 E. Travis	3		655	MEDIUM
780	309 E. Travis	3		847	LOW
781	310 E. Travis	3		654	HIGH
782	311 E. Travis	2		845	HIGH
783	312 E. Travis	2		651	HIGH

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
784	313 E. Travis	3		844	MEDIUM
785	401 E. Travis	4			LOW
786	402 E. Travis	2		650	HIGH
787	404 E. Travis	3		649	HIGH
788	406 E. Travis	3			MEDIUM
789	103 W. Travis	4			LOW
790	105 W. Travis	3			MEDIUM
791	110 -A W. Travis	3			MEDIUM
792	110 -B W. Travis	2			
793	110 -C W. Travis	3			MEDIUM
794	111 W. Travis	3			MEDIUM
795	202 W. Travis	3			MEDIUM
796	206 W. Travis	2		944	MEDIUM
797	207 W. Travis	3			MEDIUM
798	210 W. Travis	3			MEDIUM
799	301 W. Travis	3			MEDIUM
800	302 W. Travis	2		943	MEDIUM
801	307 W. Travis	3			MEDIUM
802	310 W. Travis	3			MEDIUM
803	312 W. Travis	3			MEDIUM
804	314 W. Travis	2		942	HIGH
805	316 W. Travis	4			LOW
806	320 W. Travis	2		941	MEDIUM
807	406 W. Travis	2		939	HIGH
808	408 W. Travis	2		938	HIGH
809	508 W. Travis	4			LOW
810	604 W. Travis	3			MEDIUM
811	704 W. Travis	4			LOW
812	706 W. Travis	3			MEDIUM
813	708 W. Travis	3			MEDIUM
814	710 W. Travis	3			MEDIUM
815	110 E. Ufer	4			LOW
816	112 E. Ufer	3			MEDIUM
817	202 E. Ufer	3			MEDIUM
818	204 E. Ufer	4			MEDIUM
819	212 E. Ufer	3			MEDIUM
820	302 ? E. Ufer	2	302 E. Ufer	904	HIGH
821	310 E. Ufer	3			MEDIUM
822	501 E. Ufer	3			MEDIUM
823	503 E. Ufer	3			MEDIUM
824	505 E. Ufer	3			MEDIUM
825	207 W. Ufer	3			MEDIUM
826	209 W. Ufer	3			MEDIUM
827	214 W. Ufer	3			MEDIUM
828	216 W. Ufer	3			MEDIUM
829	217 W. Ufer	3			MEDIUM
830	508 W. Ufer	4			LOW
831	103 ? E. Walch	3			MEDIUM
832	111 E. Walch	3			MEDIUM

Historic Resources Survey of 1983			2002-03 Survey Update		
Old Site No	Address	Rating	Corrected Address	New Site No.	Priority
833	105 W. Walch	3			MEDIUM
834	202 Walnut	4			LOW
835	411 Walnut	4			LOW
836	107 N. Washington	2		612	MEDIUM
837	408 N. Washington	3			MEDIUM
838	106 S. Washington	3		837	MEDIUM
839	301 S. Washington	1		898	HIGH
841	306 S. Washington	3			MEDIUM
840	307 S. Washington	3			MEDIUM
842	313 S. Washington	3			MEDIUM
843	402 S. Washington	3			MEDIUM
844	607 S. Washington	2		907	HIGH
845	608 S. Washington	3			MEDIUM
846	610 S. Washington	2		908	HIGH
847	611 S. Washington	2		906	MEDIUM
848	612 S. Washington	3			MEDIUM
849	614 S. Washington	3			MEDIUM
850	617 S. Washington	3			MEDIUM
851	618 S. Washington	3			MEDIUM
852	620 S. Washington	3			MEDIUM
853	623 S. Washington	3			MEDIUM
854	627 S. Washington	3			MEDIUM